

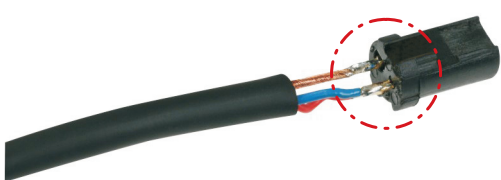
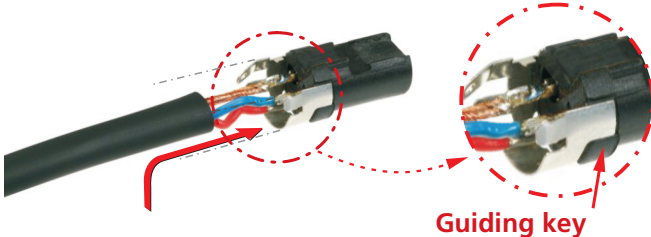


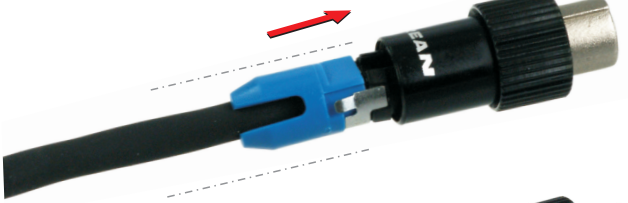


- A** Slide the boot (1) onto the cable.
- B** Prepare cable as shown.
- C** Insert wires into the terminals and solder them.
- D** Apply the grounding to the cable and position it on the insert.
Attention: Pay attention to the key.
- E** Grounding Option: Ground with housing, solder #1 to the solder lug of the grounding.
- F** Put chuck onto the cable.
Attention: Pay attention to the guiding key.
Black chuck: O.D. 2.0 - 3.5 mm
Blue chuck: O.D. 3.0 - 4.5 mm
- G** Slide insert and chuck together into the housing.
- H** Screw the bushing onto the connector.
The RT*FCT-B type is ready.
- 
- 
- 
- 
- 
- 
- 
- 