

# Voltage / Current Calibrator

## User Manual



**Part Number: 72-17175**

## Features

1. Portable instrument for calibrating process devices and measuring process signals.
2. Adjustable 0-24mA current source.
3. Adjustable -199.9mV to +199.9mV DCV source.
4. Current calibrator drives loads up to 500 ohms.
5. The instrument powers or measures a two-wire current loop.
6. Four function provide the quality and accuracy of handheld calibrator:
  - 1) Precision current source,
  - 2) Measurement of a current signal,
  - 3) Power and measurement of two wire loop,
  - 4) Precision DC mV source.

## Specifications

### General Specifications

Display	LCD display, max display counts 1999.
Function	1) Current source:
	2) Current measurement:
	3) Power and current measurement of
	4) DC mV source:
Sampling Time	Approx. 0.4 second.
Over input Indication	Indication of "1".
Operating environment	0°C to 50°C (32°F to 122°F). at <70 % relative humidity.
Power Supply	DC9V, NEDA1604/IEC6F22 battery or equivalent. Alkaline type or heavy duty type.
	Current measurement: Approx. DC 12mA
	Power and current measurement: Approx. DC 33mA
	Current source(under 10 mA signal out put): Approx. DC 33mA
	DC mV source(under 100mV signal out put): Approx. DC 12mA
Dimension	150mm (H) × 70mm (W) × 40mm (D)
Weight	Approx.: 232g (including battery.)

## 2. Electrical Specifications (23 ±5°C)

Current source		
Range	Display Resolution	Accuracy
0 -19.99mA	0.01mA	± (0.25%FS+1d)
0 -24mA	0.1mA	± (0.5%FS+1d)
*Output 0 to 24mA current for loads up to 500Ω. Output >20mA current for loads up to 400Ω. *FS: full scale		

Current measurement		
Range	Display Resolution	Accuracy
0 -19.99mA	0.01mA	± (0.25%FS+1d)
0 -24mA	0.1mA	± (0.5%FS+1d)
* FS: full scale		

Power and current measurement of two wire loop		
Range	Display Resolution	Accuracy
0 -19.99mA	0.01mA	± (0.25%FS+1d)
0 -24mA	0.1mA	± (0.5%FS+1d)
* Provides power DC 12V ±2V to the loop and measures current. * FS: full scale		

DC mV source		
Range	Display Resolution	Accuracy
-199.9mV to +199.9mV	0.1mV	± (0.25%FS+1d)
* Output measured load impedance should >1kΩ. * FS: full scale		

### Remark:

The above specifications are tested under the environment RF Field Strength less than 3V/M & frequency less than the 30 MHz only.

### Measuring Procedure

#### 1. Current Source

- 1) Insert the black test lead banana plug into the negative (COM) jack and the red test lead banana plug into the positive (mV-mA) jack.
- 2) Set the Function Switch to the "CURRENT (mA) source" position.
- 3) Press the "0~19.9mA" key for getting the 0.01mA display resolution (max display is 19.99mA); press the "0~24mA" key for getting the 0.1mA display resolution
- 4) Adjust the "Calibration Adjust knob" will generate the current output same as the display value.

## 2. Current measurement

- 1) Insert the black test lead banana plug into the negative (COM) jack and the red test lead banana plug into the positive (mV-mA) jack.
- 2) Set the Function Switch to the "CURRENT (mA) measure" position.
- 3) Press the "0~19.9mA" key for getting the 0.01mA display resolution (max display is 19.99mA); press the "0~24mA" key for getting the 0.1mA display resolution
- 4) Remove power from the circuit under test, then open up the circuit at the point where you wish to measure current.
- 5) Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit, and read the current value in the display.

## 3. Power and current measurement of two wire loop.

- 1) Insert the black test lead banana plug into the negative (COM) jack and the red test lead banana plug into the positive (mV-mA) jack.
- 2) Set the Function Switch to the "POWER/mA measure" position.
- 3) Press the "0~19.9mA" key for getting the 0.01mA display resolution (max display is 19.99mA); press the "0~24mA" key for getting the 0.1mA display resolution
- 4) Open up the circuit in which is to be measured and connect the red test probe and the black test probe securely in series with the load in which the current is to be measured.

### 4. DC mV source

- 1) Insert the black test lead banana plug into the negative (COM) jack and the red test lead banana plug into the positive (mV-mA) jack.
- 2) Set the Function Switch to the "Voltage ( mV) source" position.
- 3) Adjust the "Calibration Adjust knob" will generate the voltage (mV) output same as the display value.

## Replacing the Battery

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery door.

1. When the batteries become exhausted or drop below the operating voltage, "BAT" will appear in the left-hand side of the LCD display. The battery should be replaced.
2. Follow instructions for installing battery. See the Battery Installation section of this manual.
3. Dispose of the old battery properly.

WARNING: To avoid electric shock, do not operate your meter until the battery door is in place and fastened securely.

## Battery Installation

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery door.

1. Disconnect the test leads from the meter.
2. Open the battery door by loosening the screw using a Phillips head screwdriver.
3. Insert the battery into battery holder, observing the correct polarity.
4. Put the battery door back in place. Secure with the two screws.

WARNING: To avoid electric shock, do not operate the meter until the battery door is in place and fastened securely.

NOTE: If your meter does not work properly, check the battery to make sure that they are still good and that they are properly inserted.

**Important Notice** : This data sheet and its contents (the "Information") belong to the members of the Premier Farnell group of companies (the "Group") or are licensed to it. No licence is granted for the use of it other than for information purposes in connection with the products to which it relates. No licence of any intellectual property rights is granted. The Information is subject to change without notice and replaces all data sheets previously supplied. The Information supplied is believed to be accurate but the Group assumes no responsibility for its accuracy or completeness, any error in or omission from it or for any use made of it. Users of this data sheet should check for themselves the Information and the suitability of the products for their purpose and not make any assumptions based on information included or omitted. Liability for loss or damage resulting from any reliance on the Information or use of it (including liability resulting from negligence or where the Group was aware of the possibility of such loss or damage arising) is excluded. This will not operate to limit or restrict the Group's liability for death or personal injury resulting from its negligence. Tenma is the registered trademark of the Group. © Premier Farnell Limited 2016.