



Product Change Notification - SYST-02WVZI795

Date:

03 Jul 2019

Product Category:

Interface- Controller Area Network (CAN)

Affected CPNs:**Notification subject:**

ERRATA - MCP2517FD Silicon Errata and Data Sheet Clarification

Notification text:

SYST-02WVZI795

Microchip has released a new DeviceDoc for the MCP2517FD Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [MCP2517FD Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: 1) Updated Section 1. Module: SPI Module. 2) Updated Figure 1. 3) Added Section 2. Module: SPI Module: Incorrect CRC for certain READ_CRC commands.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 03 July 2019

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachment(s):

[MCP2517FD Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

MCP2517FD-H/JHA
MCP2517FD-H/JHAVAO
MCP2517FD-H/SL
MCP2517FD-H/SLVAO
MCP2517FDT-H/JHA
MCP2517FDT-H/JHAV02
MCP2517FDT-H/JHAVAO
MCP2517FDT-H/SL
MCP2517FDT-H/SLV01
MCP2517FDT-H/SLVAO

MCP2517FD Silicon Errata and Data Sheet Clarification

The functionality of the MCP2517FD device is described in the device Data Sheet ([DS20005688B](#)), except for the anomalies described below.

1. Module: SPI Module

TX MAB underflow/RX MAB overflow due to long delays between SPI bytes

The SPI Interface can block the CAN FD Controller module from accessing RAM in between SPI bytes and between the last byte and the rising edge of the nCS line during an SPI READ or SPI READ CRC instruction while accessing RAM.

If the CAN FD Controller module is blocked for more than TSPIMAXDLY, a TX MAB underflow or an RX MAB overflow can occur.

Work around

Keep the delay between two SPI bytes and between the last SPI byte and the rising edge of nCS shorter than TSPIMAXDLY; see [Figure 1](#).

The maximum allowed delay between two bytes depends on which CAN message frame is transmitted and on the selected Nominal Bit Time (NBT) and Data Bit Time (DBT). [Table 1](#) lists TSPIMAXDLY for the worst-case scenarios.

For example: TSPIMAXDLY is 8.5 μ s for a CAN FD frame at 500 kbps/2 Mbps. In comparison, an SPI byte takes 0.67 μ s at 12 MHz SCK. A delay of 10 times the duration of one SPI byte could cause a TX MAB underflow. It is highly unlikely for an MCU application to introduce such a long delay, but this error could occur when running an operation system like Linux on a slower MPU.

In case of a TX MAB underflow, the device will notify the application by setting SERRIF and MODIF and by transitioning to Restricted Operation or Listen Only mode (depending on CiCON.SERR2LOM). After the application requests Normal mode, the CAN FD Controller module will automatically attempt to retransmit the message that caused the TX MAB underflow. It is not necessary to reset the device.

In case of an RX MAB overflow, the device will notify the application by setting SERRIF. The device will remain in Normal mode. The message that caused the RX MAB overflow will be discarded.

FIGURE 1: MAXIMUM DELAY BETWEEN SPI BYTES

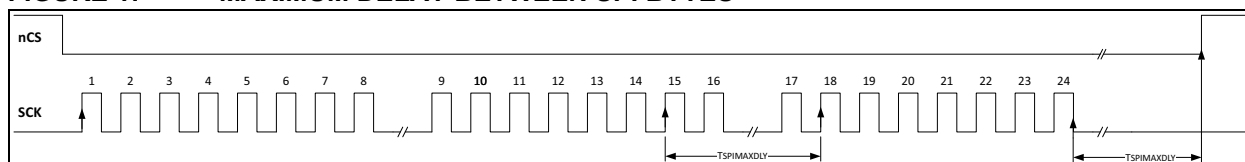


TABLE 1: WORST-CASE SCENARIOS

Scenario	Frame Format	TSPIMAXDLY
1	CAN Base Frame	5 NBT
2	CAN FD Control Field	3 NBT + 5 DBT
3	CAN FD Data Phase	32 DBT

2. Module: SPI Module

Incorrect CRC for certain READ_CRC commands

It is possible that there is a mismatch between the transmitted CRC and the actual CRC for the transmitted data when data is updated at a specific time during the SPI READ_CRC command. In these cases the transmitted CRC is wrong. The data transmitted is correct.

Fix/Work Around:

If a CRC mismatch occurs, reissue the READ_CRC command.

Only bits 7/15/23/31 of the following registers can be affected:

- CiTXIF
- CiRXIF
- CiCON
- CiTBC
- CiINT
- CiRXOVIF
- CiTXATIF
- CiTXREQ
- CiTREC
- CiBDIAG0
- CiBDIAG1
- CiTXQSTA
- CiFIFOSTAm

The occurrence can be minimized by not using FIFOs 7/15/23/31. In these cases, the registers CiTXIF, CiRXIF, CiRXOVIF, CiTXATIF and CiTXREQ are not affected.

Bit 31 of RAM reads with CRC could also be affected. This can be avoided by reading from a received FIFO only after the message has been loaded into the FIFO, indicated by the receive flags. This is the recommended procedure independent of the issue described here.

Data Sheet Clarifications:

In the MCP2517FD Data Sheet (DS20005688B), the following clarifications and corrections should be noted:

- a) None to report at this time.

APPENDIX A: REVISION HISTORY

Rev. B Document (July 2019)

- Updated [Section 1. Module: “SPI Module”](#).
- Updated [Figure 1](#).
- Added [Section 2. Module: “SPI Module”](#):
[Incorrect CRC for certain READ_CRC commands](#).

Rev. A Document (May 2018)

- Initial release of this document.

MCP2517FD

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-4720-7

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820