



Product Change Notification - SYST-11ODFZ833

Date:

12 Feb 2020

Product Category:

16-Bit - Microcontrollers and Digital Signal Controllers

Affected CPNs:



Notification subject:

ERRATA - dsPIC33CH128MP508 Family Silicon Errata and Datasheet Clarification

Notification text:

SYST-11ODFZ833

Microchip has released a new Product Documents for the dsPIC33CH128MP508 Family Silicon Errata and Datasheet Clarification of devices. If you are using one of these devices please read the document located at [dsPIC33CH128MP508 Family Silicon Errata and Datasheet Clarification](#).

Notification Status: Final

Description of Change: Added silicon issue 31 (I2C).

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 12 Feb 2020

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachment(s):

[dsPIC33CH128MP508 Family Silicon Errata and Datasheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to [receive Microchip PCNs via email](#) please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to [change your PCN profile, including opt out](#), please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

DSPIC33CH128MP202-E/2N
DSPIC33CH128MP202-E/SS
DSPIC33CH128MP202-H/2N
DSPIC33CH128MP202-H/SS
DSPIC33CH128MP202-I/2N
DSPIC33CH128MP202-I/SS
DSPIC33CH128MP202T-I/2N
DSPIC33CH128MP202T-I/SS
DSPIC33CH128MP203-E/M5
DSPIC33CH128MP203-H/M5
DSPIC33CH128MP203-I/M5
DSPIC33CH128MP203T-I/M5
DSPIC33CH128MP205-E/M4
DSPIC33CH128MP205-E/PT
DSPIC33CH128MP205-H/M4
DSPIC33CH128MP205-H/PT
DSPIC33CH128MP205-I/M4
DSPIC33CH128MP205-I/PT
DSPIC33CH128MP205T-I/M4
DSPIC33CH128MP205T-I/PT
DSPIC33CH128MP206-E/MR
DSPIC33CH128MP206-E/PT
DSPIC33CH128MP206-H/MR
DSPIC33CH128MP206-H/PT
DSPIC33CH128MP206-I/MR
DSPIC33CH128MP206-I/PT
DSPIC33CH128MP206T-I/MR
DSPIC33CH128MP206T-I/PT
DSPIC33CH128MP208-E/PT
DSPIC33CH128MP208-H/PT
DSPIC33CH128MP208-I/PT
DSPIC33CH128MP208T-I/PT
DSPIC33CH128MP502-E/2N
DSPIC33CH128MP502-E/SS
DSPIC33CH128MP502-H/2N
DSPIC33CH128MP502-H/SS
DSPIC33CH128MP502-I/2N
DSPIC33CH128MP502-I/SS
DSPIC33CH128MP502T-I/2N
DSPIC33CH128MP502T-I/SS
DSPIC33CH128MP503-E/M5
DSPIC33CH128MP503-H/M5
DSPIC33CH128MP503-I/M5
DSPIC33CH128MP503T-I/M5
DSPIC33CH128MP505-E/M4
DSPIC33CH128MP505-E/PT

DSPIC33CH128MP505-E/PTVAO
DSPIC33CH128MP505-H/M4
DSPIC33CH128MP505-H/PT
DSPIC33CH128MP505-I/M4
DSPIC33CH128MP505-I/PT
DSPIC33CH128MP505T-I/M4
DSPIC33CH128MP505T-I/PT
DSPIC33CH128MP506-E/MR
DSPIC33CH128MP506-E/MRVAO
DSPIC33CH128MP506-E/PT
DSPIC33CH128MP506-H/MR
DSPIC33CH128MP506-H/PT
DSPIC33CH128MP506-I/MR
DSPIC33CH128MP506-I/PT
DSPIC33CH128MP506T-E/MRVAO
DSPIC33CH128MP506T-I/MR
DSPIC33CH128MP506T-I/PT
DSPIC33CH128MP508-E/PT
DSPIC33CH128MP508-E/PTVAO
DSPIC33CH128MP508-H/PT
DSPIC33CH128MP508-I/PT
DSPIC33CH128MP508T-I/PT
DSPIC33CH64MP202-E/2N
DSPIC33CH64MP202-E/SS
DSPIC33CH64MP202-H/2N
DSPIC33CH64MP202-H/SS
DSPIC33CH64MP202-I/2N
DSPIC33CH64MP202-I/SS
DSPIC33CH64MP202T-I/2N
DSPIC33CH64MP202T-I/SS
DSPIC33CH64MP203-E/M5
DSPIC33CH64MP203-H/M5
DSPIC33CH64MP203-I/M5
DSPIC33CH64MP203T-I/M5
DSPIC33CH64MP205-E/M4
DSPIC33CH64MP205-E/PT
DSPIC33CH64MP205-H/M4
DSPIC33CH64MP205-H/PT
DSPIC33CH64MP205-I/M4
DSPIC33CH64MP205-I/PT
DSPIC33CH64MP205T-I/M4
DSPIC33CH64MP205T-I/PT
DSPIC33CH64MP206-E/MR
DSPIC33CH64MP206-E/PT
DSPIC33CH64MP206-H/MR
DSPIC33CH64MP206-H/PT
DSPIC33CH64MP206-I/MR
DSPIC33CH64MP206-I/PT
DSPIC33CH64MP206T-I/MR

DSPIC33CH64MP206T-I/PT
DSPIC33CH64MP208-E/PT
DSPIC33CH64MP208-H/PT
DSPIC33CH64MP208-I/PT
DSPIC33CH64MP208T-I/PT
DSPIC33CH64MP502-E/2N
DSPIC33CH64MP502-E/SS
DSPIC33CH64MP502-H/2N
DSPIC33CH64MP502-H/SS
DSPIC33CH64MP502-I/2N
DSPIC33CH64MP502-I/SS
DSPIC33CH64MP502T-I/2N
DSPIC33CH64MP502T-I/SS
DSPIC33CH64MP503-E/M5
DSPIC33CH64MP503-H/M5
DSPIC33CH64MP503-I/M5
DSPIC33CH64MP503T-I/M5
DSPIC33CH64MP505-E/M4
DSPIC33CH64MP505-E/PT
DSPIC33CH64MP505-H/M4
DSPIC33CH64MP505-H/PT
DSPIC33CH64MP505-I/M4
DSPIC33CH64MP505-I/PT
DSPIC33CH64MP505T-I/M4
DSPIC33CH64MP505T-I/PT
DSPIC33CH64MP506-E/MR
DSPIC33CH64MP506-E/PT
DSPIC33CH64MP506-H/MR
DSPIC33CH64MP506-H/PT
DSPIC33CH64MP506-I/MR
DSPIC33CH64MP506-I/PT
DSPIC33CH64MP506T-I/MR
DSPIC33CH64MP506T-I/PT
DSPIC33CH64MP508-E/PT
DSPIC33CH64MP508-H/PT
DSPIC33CH64MP508-I/PT
DSPIC33CH64MP508T-I/PT

dsPIC33CH128MP508 Family Silicon Errata and Data Sheet Clarification

The dsPIC33CH128MP508 family devices that you have received conform functionally to the current Device Data Sheet (DS70005319D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).


The errata described in this document will be addressed in future revisions of the dsPIC33CH128MP508 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A2**).

Data Sheet clarifications and corrections start on [page 12](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate website (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB IDE you are using, do one of the following:
 - a) For MPLAB IDE 8, select *Programmer > Reconnect*.
 - b) For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon ().
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various dsPIC33CH128MP508 silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

| Part Number | Device ID ⁽¹⁾ | Revision ID for Silicon Revision |
|-----------------------------|--------------------------|----------------------------------|
| | | A2 |
| Master (With CAN FD) | | |
| dsPIC33CH64MP502 | 0x8740 | 0x0002 |
| dsPIC33CH128MP502 | 0x8750 | |
| dsPIC33CH64MP503 | 0x8741 | |
| dsPIC33CH128MP503 | 0x8751 | |
| dsPIC33CH64MP505 | 0x8742 | |
| dsPIC33CH128MP505 | 0x8752 | |
| dsPIC33CH64MP506 | 0x8743 | |
| dsPIC33CH128MP506 | 0x8753 | |
| dsPIC33CH64MP508 | 0x8744 | |
| dsPIC33CH128MP508 | 0x8754 | |

Note 1: The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format "DEVID DEVREV".

dsPIC33CH128MP508

TABLE 1: SILICON DEVREV VALUES (CONTINUED)

| Part Number | Device ID ⁽¹⁾ | Revision ID for Silicon Revision |
|--------------------------------|--------------------------|----------------------------------|
| | | A2 |
| Slave (With CAN FD) | | |
| dsPIC33CH64MP502S1 | 0x87C0 | 0x0002 |
| dsPIC33CH128MP502S1 | 0x87D0 | |
| dsPIC33CH64MP503S1 | 0x87C1 | |
| dsPIC33CH128MP503S1 | 0x87D1 | |
| dsPIC33CH64MP505S1 | 0x87C2 | |
| dsPIC33CH128MP505S1 | 0x87D2 | |
| dsPIC33CH64MP506S1 | 0x87C3 | |
| dsPIC33CH128MP506S1 | 0x87D3 | |
| dsPIC33CH64MP508S1 | 0x87C4 | |
| dsPIC33CH128MP508S1 | 0x87D4 | |
| Master (Without CAN FD) | | |
| dsPIC33CH64MP202 | 0x8700 | 0x0002 |
| dsPIC33CH128MP202 | 0x8710 | |
| dsPIC33CH64MP203 | 0x8701 | |
| dsPIC33CH128MP203 | 0x8711 | |
| dsPIC33CH64MP205 | 0x8702 | |
| dsPIC33CH128MP205 | 0x8712 | |
| dsPIC33CH64MP206 | 0x8703 | |
| dsPIC33CH128MP206 | 0x8713 | |
| dsPIC33CH64MP208 | 0x8704 | |
| dsPIC33CH128MP208 | 0x8714 | |
| Slave (Without CAN FD) | | |
| dsPIC33CH64MP202S1 | 0x8780 | 0x0002 |
| dsPIC33CH128MP202S1 | 0x8790 | |
| dsPIC33CH64MP203S1 | 0x8781 | |
| dsPIC33CH128MP203S1 | 0x8791 | |
| dsPIC33CH64MP205S1 | 0x8782 | |
| dsPIC33CH128MP205S1 | 0x8792 | |
| dsPIC33CH64MP206S1 | 0x8783 | |
| dsPIC33CH128MP206S1 | 0x8793 | |
| dsPIC33CH64MP208S1 | 0x8784 | |
| dsPIC33CH128MP208S1 | 0x8794 | |

Note 1: The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format “DEVID DEVREV”.

TABLE 2: SILICON ISSUE SUMMARY

| Module | Feature | Item Number | Issue Summary | Affected Revisions |
|------------------|--------------------------|-------------|---|--------------------|
| | | | | A2 |
| ECC | Status | 1. | ECCSTATH/L registers cannot be read. | X |
| ECC | Status | 2. | SECSYNDx bits in the ECCSTATH register cannot be read. | X |
| I ² C | Interrupt | 3. | In Slave mode, an incorrect interrupt is generated with DHEN = 1. | X |
| I ² C | Error | 4. | Bus collision error cannot be cleared. | X |
| I ² C | Error | 5. | False bus collision error generated. | X |
| I ² C | Idle | 6. | Address cannot be received in Idle mode. | X |
| Oscillator | PLL | 7. | FRCDIVN drives the PLL instead of the FRC. | X |
| Oscillator | HS,XT | 8. | The Primary Oscillator Start-up Timer (OST) may indicate the oscillator is ready for use too early. | X |
| PWM | Dead Time | 9. | When feed-forward PCI is used for dead-time compensation (DTCMPSEL = 1), the PWMx outputs are overridden. | X |
| UART | FERR | 10. | The OERR bit cannot be cleared by software. | X |
| UART | OERR | 11. | The FERR bit will not get set if one Stop bit is received. | X |
| UART | TRMT | 12. | The 9th byte received will not be available to be read. | X |
| UART | TRMT | 13. | The TRMT bit takes time to set on the last transmit completion. | X |
| UART | TRMT | 14. | The TRMT bit is unreliable when there is back-to-back Break character transmission. | X |
| UART | Idle | 15. | SLPEN = 1 will not keep the UART BRG clock active in Sleep mode. | X |
| UART | RIDLE | 16. | The RIDLE bit takes one instruction cycle to get cleared after ABAUD is set. | X |
| UART | TXWRE | 17. | The TXWRE bit (UxSTAH[7]) cannot be cleared once it gets set. | X |
| UART | Address Detect | 18. | When writing to UxP1 with UTXBRK = 1, the content of P1 will not get transmitted. | X |
| UART | DMX | 19. | In DMX mode with reception enabled, no interrupt is generated on receiving start code or break of data frame. | X |
| UART | UART | 20. | When UART is used in DMX mode (MOD[3:0] (UxMODE[3:0]) = 0b1010) with reception enabled, no interrupt is generated on receiving start code or break of data frame. | X |
| UART | Smart Card | 21. | The Waiting Time Counter Interrupt Flag (WTCIF) is set when the last x character transmitted has the bit, LAST = 0. | X |
| UART | XOFF | 22. | XOFF is transmitted when one empty space remains in the RX buffer. | X |
| CPU | FLIM Instruction | 23. | When the operands are of different signs, the FLIM instruction may not force the correct data limit. | X |
| SCCP/ MCCP | Clock Source | 24. | Using FOSC as the clock source may cause synchronization issues. | X |
| I ² C | SMBus 3.0 | 25. | When Configuration bit, SMBEN (FDEVOPT[10]) = 1, the SMBus 3.0 V _{IH} minimum specification may not be met. | X |
| I/O | POR | 26. | Spike on I/O at POR. | X |
| CPU | MAXAB/MINAB Instructions | 27. | When the operands are of different signs, the MAXAB, MINAB and MINZAB instructions may not output the correct value. | X |

dsPIC33CH128MP508

TABLE 2: SILICON ISSUE SUMMARY (CONTINUED)

| Module | Feature | Item Number | Issue Summary | Affected Revisions |
|------------------|--------------------|-------------|---|--------------------|
| | | | | A2 |
| CPU | div.sd Instruction | 28. | When using the signed 32-by-16-bit division instruction, div.sd, the Overflow bit is not getting set when an overflow occurs. | X |
| DMA | ADC Triggers | 29. | DMA is triggered continuously from ADC. | X |
| PWM | Time Base Capture | 30. | PWM Capture Status (CAP) flag will not set again under certain conditions. | X |
| I ² C | I ² C | 31. | All instances of I ² C may exhibit errors and should not be used. | X |

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A2**).

1. Module: ECC

The ECCSTATH/L registers cannot be read when an ECC error happens. The ECC Double-Bit Error (ECCDBE) trap and ECC Single Bit Error (ECCSBE) interrupt will work correctly, but the ECCSTATH/ECCSTATL registers will always read as zero.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | | | |

2. Module: ECC

In the ECCSTATH register, the SECSYNDx bits cannot be read when an ECC error happens.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | | | |
| Slave | X | | |

3. Module: I²C

In Slave mode with DHEN = 1 (Data Hold Enable), if software sends a NACK, a Slave interrupt is asserted at the 9th falling edge of the clock.

Work around

Software should ignore the Slave interrupt that is asserted after sending a NACK.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

4. Module: I²C

In Slave mode, the Bus Collision Detect (BCL) bit cannot be cleared when bus collision detection is enabled (SBCDE = 1).

Work around

Disable the I²C module and then re-enable the module.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

5. Module: I²C

In Slave mode, false bus collision triggers are generated when the bus collision is enabled (SBCDE = 1) and a Stop bit is received.

Work around

Ignore the bus collision. Disable the I²C module and then re-enable the module.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

6. Module: I²C

In Slave mode, an address cannot be received when the device is in Idle and the module is set for discontinue in Idle (I2CSIDL = 1).

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

dsPIC33CH128MP508

7. Module: Oscillator

When using the 8 MHz internal FRC Oscillator with Primary PLL as either a system clock or a peripheral source, FRCDIVN drives the PLL instead of the FRC.

This means that the PLL FRC input selection is subject to the FRCDIV[2:0] bits and could lead to a condition where the minimum PLL input requirement of 8 MHz is not maintained.

Work around

Ensure FRCDIV[2:0] bits are maintained as zero when using FRCPLL as either a system clock or a peripheral source.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

8. Module: Oscillator

The Primary Oscillator Start-up Timer (OST) may indicate the oscillator is ready for use too early. Clocking the device before the oscillator is ready may result in incorrect execution and exceptions. This issue exists when the POSC is requested at power-on, during clock switching, when waking from Sleep or when a peripheral module requests the POSC directly. This issue affects XT and HS modes only.

Work around

Make sure that the Primary Oscillator clock is ready before using it by following these steps:

1. Running on a non-POSC source, request the POSC clock using a peripheral such as REFO.
2. Provide a delay to stabilize the POSC.
3. Then, switch to the POSC source.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

9. Module: PWM

When feed-forward PCI is used for dead-time compensation (DTCMPSEL = 1), the PWMx outputs are overridden.

Work around

Use Sync PCI (DTCMPSEL = 0) for dead-time compensation.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

10. Module: UART

Once the UART receive buffer overflows and the OERR bit (UxSTA[1]) is set, the OERR bit cannot be cleared by software.

Work around

1. Make sure that the receive buffer never overflows. Do not let the OERR bit get set by reading the received data byte on each byte reception.
2. Disable and enable UART before clearing the OERR bit.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

11. Module: UART

When the UART is operating with STSEL[1:0] = 2 (two Stop bits sent, two checked at receive), the FERR bit will not get set if one Stop bit is received.

Work around

Use STSELx = 3 instead of STSELx = 2. When operating with STSELx = 3 mode, the UART will be configured to send two Stop bits, but check one at receive.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

12. Module: UART

When the receive buffer overflows, the 9th byte received will get lost and cannot be read.

Work around

Do not allow the OERR bit to get set by reading the received data byte on each byte reception.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

13. Module: UART

At low BRG value, the TRMT bit takes time to set on the last transmit completion, which may result in the transmitted data getting lost.

Work around

1. Use the UTXBE bit to monitor for the next transmit
2. Provide a delay to stabilize the POSC.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

14. Module: UART

The Transmit Shifter Empty (TRMT) bit is unreliable when there is back-to-back Break character transmission.

Work around

Poll the UART Transmit Break bit, UTXBRK (UxMODE[8]), to be cleared instead of the TRMT bit.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

15. Module: UART

UART will not work correctly in Sleep mode. SLPEN = 1 will not keep the UART baud rate clock active in Sleep mode.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

16. Module: UART

During a UART Auto-Baud Detection sequence, the RIDLE bit takes one instruction cycle to get cleared after ABAUD is set.

Work around

Ignore the RIDLE bit until the Auto-Baud Detection sequence is complete.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

17. Module: UART

Once the TX Write Transmit Error Status bit, TXWRE (UxSTAH[7]), gets set, the TXWRE cannot be cleared by a single clear instruction.

Work around

Use multiple clear instructions of loop until the TXWRE bit gets cleared.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

dsPIC33CH128MP508

18. Module: UART

In UART Address Detect mode, writing to UxP1 with UTXBRK = 1 should cause a Break to be transmitted, followed by the content in P1, but the content of P1 will not get transmitted.

Work around

After writing to P1, wait for UTXBRK to get clear and then rewrite to P1.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

19. Module: UART

When UART is in DMX mode, MOD[3:0] (UxMODE[3:0]) = 0b1010 with transmission enabled, any write to the UxP1 register after enabling UART would be ignored.

Work around

Write the value of the UxP1 register before enabling the UART.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

20. Module: UART

When UART is used in DMX mode, MOD[3:0] (UxMODE[3:0]) = 0b1010 with reception enabled, no interrupt is generated on receiving a start code or break of data frame. Depending on the URXISEL[2:0] (UxSTAH[10:8]) bits, an interrupt will be generated on receiving the data bytes.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

21. Module: UART

In Smart Card T = 1 mode, the Wait Time Counter Interrupt Flag (WTCIF) is set when the last character transmitted has the bit, LAST = 0.

Work around

Ignore WTC interrupt events on non-last bytes.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

22. Module: UART

In Software Flow Control mode, XOFF is transmitted when one empty space remains in the RX buffer. XOFF transmission can get further delayed if the transmitter has already been loaded, resulting in XOFF transmission on a receive buffer full event.

Work around 1

Give a minimum one-byte delay before each byte transmission.

Work around 2

Use the UART RX interrupt with URXISEL[2:0] set to at least two empty slots. This allows the RX buffer to be read in time to prevent RX buffer overflow.

Affected Silicon Revisions.

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

23. Module: CPU

The FLIM instruction may incorrectly limit the data range when operating on signed operands of different sign values. If the operands are either all negative or all positive, the limit is correct.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

24. Module: SCCP/MCCP

When FOSC is selected as the clock source using the CLKSEL[2:0] bits (CCPxCON1L[10:8]), unexpected operation may occur. For proper SCCP/MCCP input clock synchronization, do not use FOSC as the system clock source.

Work around

Use any of the other available clock sources in CLKSEL[2:0].

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

25. Module: I²C

When selecting SMBus 3.0 operation using Configuration bit, SMBEN (FDEVOP[10]), the Voltage Input High (V_{IH}) of the SMBus 3.0 specification minimum may not be met.

Work around

None.


Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

26. Module: I/O

During a fast device power-up, when the V_{DD} ramp is less than 4 mS, the I/O pins may drive up to 100 μ A current for a duration of up to 10 μ S (Figure 1).

FIGURE 1: I/O RAMP

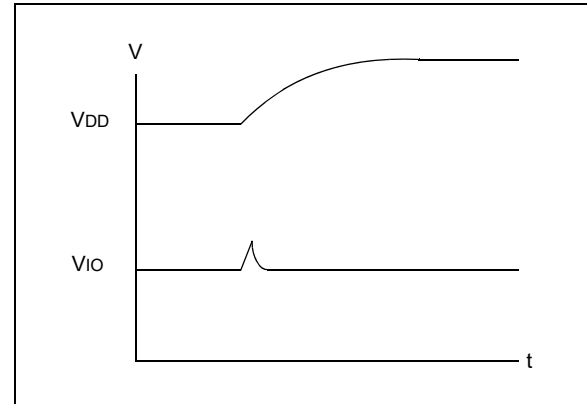

Work around

1. Slow down the V_{DD} ramp time (greater than 4 mS for V_{DD} to ramp 0V to 3.3V).
2. Ensure the circuitry that is connected to the pins can endure this pulse.

Example applications affected may include complementary power switches, where a transient current shoot-through might occur.

High-voltage applications with complementary switches should power the high-voltage 200 μ Sec later than powering the dsPIC[®] device to avoid the current shoot-through. This behavior is specific to each device and not affected by aging.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

dsPIC33CH128MP508

27. Module: CPU

When operating on signed operands of different sign values, the output for `MAXAB`, `MINAB` and `MINZAB` instructions may be incorrect. If the operands are either all negative or all positive, the output is correct.

Work around

None.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

28. Module: CPU

When using the Signed 32-by-16-Bit Division instruction, `div.sd`, the Overflow bit may not always get set when an overflow occurs. This erratum only affects operations in which at least one of the following conditions is true:

- Dividend and divisor differ in sign,
- Dividend > 0x3FFFFFFF or
- Dividend < 0xC0000000

Work around

The application software must perform both of the following actions to handle possible undetected overflow conditions:

- a) The value of the dividend must always be constrained to be in the following range:
 $0xC0000000 \leq \text{Dividend} \leq 0x3FFFFFFF$.
- b) If the dividend and divisor differ in sign (e.g., dividend is negative and divisor is positive), then after executing the `div.sd` instruction or the compiler built-in function, `__builtin_divsd()`, inspect the sign of the resultant quotient. If the quotient is found to be a positive number, then treat it as an overflow condition.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

29. Module: DMA

The DMA receives multiple continuous triggers from the ADC until the trigger event from ADC is cleared. The `OVRUNIF` flag (`DMAINTn[3]`) will be set. When the `OVRUNIF` bit changes state, from '0' to '1', a DMA interrupt is generated.

Work around

Ignore the `OVRUNIF` bit and the first DMA interrupt. Clear the ADC trigger source, `ANxRDY`, with a DMA read of the ADC buffer, `ADCBUFx`, for the corresponding ADC channel.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

30. Module: PWM

When using a PWM Control Input (PCI) to trigger a time base capture, the Capture Status flag, `CAP` (`PGxSTAT[5]`), may not set again under certain conditions. When a subsequent PWM capture event occurs while, or just after, reading the current capture value from the `PGxCAP` register, the Capture Status flag, `CAP`, will not set again.

Work around

Read the PWM Generator Capture (`PGxCAP`, $x = 1$ to 8) register at a known time to avoid the condition. The timing of the `PGxCAP` read operation can be scheduled by using the PWM Generator (1-8) interrupt, or any of the six PWM Event (A-F) interrupts, corresponding to the PCI event which triggered the time base capture. Read the `PGxCAP` value after the `CAP` bit has been set within the interrupt.

Affected Silicon Revisions

| Core | A2 | | |
|--------|----|--|--|
| Master | X | | |
| Slave | X | | |

31. Module: I²C

All instances of I²C/SMBus may exhibit errors and should not be used. When operating I²C/SMBus in a noisy environment, the I²C module may exhibit various errors. These errors may include, but are not limited to, corrupted data, unintended interrupts or the I²C bus getting hung up due to injected noise. Examples of system noise include, but are not limited to, PWM outputs or other pins toggled at high speed adjacent to the I²C pins. Both Master and Slave I²C/SMBus modes may exhibit this issue.

Work around

If I²C is required, use a software I²C implementation. An example I²C software library is available from Microchip:

www.microchip.com/dsPIC33C_I2C_SoftwareLibrary

dsPIC33CH128MP508

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70005319D):

| |
|---|
| <p>Note: Corrections are shown in bold. Where possible, the original bold text formatting has been removed for clarity.</p> |
|---|

None.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (5/2018)

Initial release of this document; issued for revision A2.

Rev B Document (11/2018)

Adds silicon issue 23 (CPU), 24 (SCCP/MCCP), 25 (I²C) and 26 (I/O).

Rev C Document (10/2019)

Adds silicon issue 27 (CPU), 28 (CPU), 29 (DMA) and 30 (PWM).

Updates silicon issue 26 (I/O).

Updates device data sheet reference to the current revision D.

Rev D Document (2/2020)

Adds silicon issue 31 (I²C).

dsPIC33CH128MP508

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTracker, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2018-2020, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-5606-3

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820