



Product Change Notification / SYST-17RBJH959

Date:

19-Nov-2020

Product Category:

8-bit Microcontrollers

PCN Type:

Silicon Die Revision

Notification Subject:

ERRATA - PIC18F24/25Q10 Silicon Errata and Data Sheet Clarification

Affected CPNs:

[SYST-17RBJH959_Affected_CPN_11192020.pdf](#)

[SYST-17RBJH959_Affected_CPN_11192020.csv](#)

Notification Text:

SYST-17RBJH959

Microchip has released a new Product Documents for the PIC18F24/25Q10 Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [PIC18F24/ 25Q10 Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: 1) Adding silicon revision B2 2) Minor editorial corrections.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Estimated First Ship Date: 20 Dec 2020

NOTE: Please be advised that after the estimated first ship date customers may receive pre and post change parts.

Markings to Distinguish Revised from Unrevised Devices: Traceability Code

Attachments:

[PIC18F24/25Q10 Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC18F24Q10-I/ML
PIC18F24Q10-I/SO
PIC18F24Q10-I/SP
PIC18F24Q10-I/SS
PIC18F24Q10-I/STX
PIC18F24Q10T-I/ML
PIC18F24Q10T-I/SO
PIC18F24Q10T-I/SS
PIC18F24Q10T-I/STX
PIC18F25Q10-I/ML
PIC18F25Q10-I/SO
PIC18F25Q10-I/SP
PIC18F25Q10-I/SS
PIC18F25Q10-I/STX
PIC18F25Q10T-I/ML
PIC18F25Q10T-I/SO
PIC18F25Q10T-I/SS
PIC18F25Q10T-I/SSC01
PIC18F25Q10T-I/STX

PIC18F24/25Q10 Silicon Errata and Data Sheet Clarifications

The PIC18F24/25Q10 devices that you have received conform functionally to the current device data sheet (DS40001945D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the table below.

The errata described in this document will be addressed in future revisions of the PIC18F24/25Q10 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Table 1. Silicon Device Identification

Part Number	Device ID	Revision ID	
		A8	B2
PIC18F24Q10	0x71C0	0xA008	0xA082
PIC18F25Q10	0x71A0	0xA008	0xA082



Important: Refer to the **Device/Revision ID** section in the current “**PIC18F2x/4xQ10 Memory Programming Specification**” (DS40001874) for a detailed information on Device Identification and Revision IDs for your specific device.

Table 2. Silicon Issue Summary

Module	Feature	Item No.	Issue Summary	Affected Revisions	
				A8	B2
Electrical Specifications	Temperature range	1.1.1	Industrial temperature range only	X	
I/O Ports	Ext MCLR	1.2.1	Internal pull-up enabled late	X	X
Resets	LPBOR	1.3.1	Trip point rises with temperature	X	
Resets	RMCLR flag	1.3.2	POR may clear the RMCLR bit by mistake	X	X
Oscillator	HFINTOSC	1.4.1	5% variation over temperature range	X	
Oscillator	XT mode	1.4.2	Maximum clock frequency limited to 2 MHz for XT mode	X	
ADCC	CVD	1.5.1	Unreliable high/low conversion results with small Sample-and-Hold capacitor selections	X	X
ADCC	FVR reference	1.5.2	Missing codes when FVR is used as reference	X	X
Windowed Watchdog Timer	Window operation	1.6.1	Window feature of the WWDT does not operate correctly in DOZE mode	X	
NVM	NVMERR	1.7.1	The NVMERR bit is set by device Reset after being cleared by software	X	
MSSP	SPI	1.8.1	SSPBUF may be corrupted by writes to other GPR/SFRs	X	

Note: Only those issues indicated in the last column apply to the current silicon revision.

1. Silicon Errata Issues



Notice: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the bold font in the following tables apply to the current silicon revision.

1.1 Module: Electrical Specifications

1.1.1 Industrial Temperature Range Only

Extended temperature range devices are not released.

Work around

Operate at temperatures below 85 degrees C.

Affected Silicon Revisions

A8	B2
X	

1.2 Module: I/O Ports

1.2.1 Internal Pull-up on $\overline{\text{MCLR}}$ Pin Enabled Late

When the external master clear is selected, an internal pull-up feature is enabled. Because the internal pull-up feature happens later in the initialization sequence than expected, it can cause the device to become stuck in an initialization-Reset loop.

Work around

Use an external pull-up resistor on the $\overline{\text{MCLR}}$ pin when the external master clear configuration is selected.

Affected Silicon Revisions

A8	B2
X	X

1.3 Module: Resets

1.3.1 Low-Power Brown-out Reset (LPBOR) Mode

The Brown-out Reset trip level increases proportionally with temperature to a level where BOR is never released. LPBOR cannot be used reliably because the trip level relative to temperature is indeterminate.

Work around

Use the normal-power BOR mode.

Affected Silicon Revisions

A8	B2
X	

1.3.2 The $\overline{\text{RMCLR}}$ Flag in the PCON0 Register Cleared by Mistake

On an initial power-up of the device, or when executing a software Reset, the $\overline{\text{RMCLR}}$ flag in the PCON0 register may be improperly cleared by a Power-On Reset ($\overline{\text{POR}}$) or software Reset ($\overline{\text{RI}}$), thereby indicating a false MCLR event.

Work around

None.

Affected Silicon Revisions

A8	B2
X	x

1.4 Module: Oscillator

1.4.1 Internal HFINTOSC Oscillator Varies up to 5%

The internal HFINTOSC oscillator varies in frequency up to 5% over the voltage and temperature range.

Work around

For systems requiring more precision, use an external crystal or ceramic resonator in one of the external oscillator modes.

Affected Silicon Revisions

A8	B2
X	

1.4.2 Maximum Clock Frequency Limited to 2 MHz for XT Mode

The maximum clock frequency for the intermediate gain setting that supports quartz crystal and ceramic resonator operation (XT mode) is being reduced from 4 MHz to 2 MHz.

Work around

For crystal or resonator frequencies above 2 MHz, use HS mode.

Affected Silicon Revisions

A8	B2
X	

1.5 Module: Analog-to-Digital Converter with Computation (ADCC)

1.5.1 Unreliable High/Low CVD Conversion Results with Small Sample-and-Hold Capacitor Selections

When the Sample-and-Hold capacitor selection is less than half the available maximum, the apparent low precharge appears to fail, resulting in a low conversion result greater than the high conversion result.

Work around

Select Sample-and-Hold values greater than half the available maximum when using the CVD feature.

Affected Silicon Revisions

A8	B2
X	X

1.5.2 Missing Codes with FVR Reference

Using the FVR as the positive voltage reference for the ADC can cause an increase in missing codes.

Work around

Method 1:

Increase the bit conversion time, known as T_{AD} , to 8 μ s or higher.

Method 2:

Use V_{DD} as the positive voltage reference to the ADC.

Affected Silicon Revisions

A8	B2
X	X

1.6 Module: Windowed Watchdog Timer (WWDT)

1.6.1 Window Operation in Doze Mode

When the windowed mode of operation is enabled in Doze mode, a window violation error is issued even though the window is open and has been armed. This condition occurs only when the window size is set to a value other than 100% open.

Work around

Method 1:

Use the windowed mode of operation in any other than Doze mode. If disabling the Doze mode is not an option, use the WWDT module without the window being enabled.

Method 2:

If the device is in Doze mode, perform the arming process for the window in Normal mode and return to the Doze mode.

Method 3:

If there is an Interrupt Service Routine (ISR) in the application code, the arming within the window can be done inside the ISR with the ROI bit of the CPUDOZE register being set.

Affected Silicon Revisions

A8	B2
X	

1.7 Module: Nonvolatile Memory (NVM)**1.7.1 NVMERR**

When a Reset is issued while an NVM high-voltage operation is in progress, the NVMERR bit in the NVMCON0 register is set as expected. After clearing the NVMERR bit, if a Reset reoccurs, the NVMERR bit is set again regardless of whether an NVM operation is in progress or not. A successful write operation will clear the NVMERR condition.

Work around

None.

Affected Silicon Revisions

A8	B2
X	

1.8 Module: Master Synchronous Serial Port (MSSP)**1.8.1 MSSP SPI Client Mode**

When operating in SPI Client mode, if the incoming SCK clock signal arrives during any of the conditions below, the SSPBUF Transmit Shift Register (TSR) may become corrupted. The byte transmitted to the client cannot be ensured to be correct, and the state of the WCOL bit may or may not indicate a write collision.

These conditions include:

- A write to an SFR
- A write to RAM following an SFR read
- A write to RAM prior to an SFR read

Work around**Method 1 (Interrupt based using \overline{SS}):**

1. Connect the \overline{SS} line to both the \overline{SS} input and either an INT or IOC input pin.
2. Enable INT or IOC interrupts (interrupt on falling edge if available, otherwise check that $\overline{SS} == 0$ when the interrupt occurs).
3. Load SSPBUF with the data to be transmitted.
4. Continue program execution.
5. When the Interrupt Service Routine (ISR) is invoked, do either of the following:
 - 5.1. Add a delay that ensures the first SCK clock will be complete, or
 - 5.2. Poll SSPSTAT.BF (while(BF == 0)), and wait for the transmission/reception to complete.

Method 2 (Bit polling based using \overline{SS}):

1. Load SSPBUF with the data to be transmitted.
2. Poll the \overline{SS} line and wait for the \overline{SS} to go active (while(!PORTx. \overline{SS} == 0)).
3. When \overline{SS} is active ($\overline{SS} == 0$), do either of the following:
 - 3.1. Add a delay that ensures the first SCK clock will be complete, or
 - 3.2. Poll SSPSTAT.BF (while(BF == 0)), and wait for the transmission/reception to complete.

Once one of these two methods are complete, it is safe to return to program execution.

Method 3 ($\overline{\text{SS}}$ not available):

1. Load SSPBUF with the data to be transmitted.
2. Poll SSPSTAT.BF (`while(BF == 0)`), and wait for the transmission/reception to complete.

Affected Silicon Revisions

A8	B2
X	

2. Data Sheet Clarifications

2.1 None

There are no known data sheet clarifications as of this publication date.

3. **Appendix A: Revision History**

Doc Rev.	Date	Comments
C	11/2020	Adding silicon revision B2. Minor editorial corrections.
B	08/2020	Updated Table 1. Added silicon errata items 1.3.2 and 1.4.2. Minor editorial corrections.
A	05/2018	Initial document release.

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Legal Notice

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-7127-1

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Tel: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p>	<p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p>	<p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p>	<p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p>