# Keysight 16048G/H Test Leads

# 

Operation and Service Manual



NOTICE: This document contains references to Agilent Technologies. Agilent's former Test and Measurement business has become Keysight Technologies. For more information, go to **www.keysight.com.** 



### Notices

The information contained in this document is subject to change without notice.

This document contains proprietary information that is protected by copyright.All rights are reserved. No part of this document may be photocopied, reproduced, or translated to another language without the prior written consent of the Keysight Technologies.

Keysight Technologies Japan, Ltd.

Component Test PGU-Kobe

1-3-3 Higashikawasaki-cho, Chuo-Ku Kobe-shi, Hyogo, 650-0044 Japan

© Copyright Keysight Technologies Japan, Ltd. 1999, 2001, 2015

### **Manual Printing History**

The manual's printing date and part number indicate its current edition. The printing date changes when a new edition is printed. (Minor corrections and updates that are incorporated at reprint do not cause the date to change.) The manual part number changes when extensive technical changes are incorporated.

April 1999	Edition 1 (part number: 16048-90050)
December 1999	Edition 2 (part number: 16048-90050)
January 2001	Edition 3 (part number: 16048-90050)
March 2015	Edition 4 (part number: 16048-90050)

### Safety Summary

The following general safety precautions must be observed during all phases of operation, service, and repair of this instrument. Failure to comply with these precautions or with specific WARNINGS elsewhere in this manual may impair the protection provided by the equipment. In addition it violates safety standards of design, manufacture, and intended use of the instrument.

The Keysight Technologies assumes no liability for the customer's failure to comply with these requirements.

**NOTE** 16048G/H comply with INSTALLATION CATEGORY I and POLLUTION DEGREE 2 in IEC61010-1. 16048G/H are INDOOR USE product.

• DO NOT Operate In An Explosive Atmosphere

Do not operate the instrument in the presence of flammable gasses or fumes. Operation of any electrical instrument in such an environment constitutes a definite safety hazard.

Keep Away From Live Circuits

Operating personnel must not remove instrument covers. Component replacement and internal adjustments must be made by qualified maintenance personnel. Do not replace components with the power cable connected. Under certain conditions, dangerous voltages may exist even with the power cable removed. To avoid injuries, always disconnect power and discharge circuits before touching them.

• DO NOT Service Or Adjust Alone

Do not attempt internal service or adjustment unless another person, capable of rendering first aid and resuscitation, is present.

• DO NOT Substitute Parts Or Modify Instrument

Because of the danger of introducing additional hazards, do not install substitute parts or perform unauthorized modifications to the instrument. Return the instrument to a Keysight Technologies Sales and Service Office for service and repair to ensure that safety features are maintained.

Dangerous Procedure Warnings

Warnings, such as the example below, precede potentially dangerous procedures throughout this manual. Instructions contained in the warnings must be followed.

WARNING Dangerous voltages, capable of causing death, are presenting this instrument. Use extreme caution when handling, testing, and adjusting this instrument.

# Certification

Keysight Technologies certifies that this product met its published specifications at the time of shipment from the factory. Keysight Technologies further certifies that its calibration measurements are traceable to the United States National Institute of Standards and Technology, to the extent allowed by the Institution's calibration facility, or to the calibration facilities of other International Standards Organization members.

### Warranty

This Keysight Technologies instrument product is warranted against defects in material and workmanship for a period corresponding to the individual warranty periods of its component products. Instruments are warranted for a period of one year. Fixtures and adapters are warranted for a period of 90 days. During the warranty period, Keysight Technologies will, at its option, either repair or replace products that prove to be defective.

For warranty service or repair, this product must be returned to a service facility designated by Keysight Technologies. Buyer shall prepay shipping charges to Keysight Technologies and Keysight Technologies shall pay shipping charges to return the product to Buyer. However, Buyer shall pay all shipping charges, duties, and taxes for products returned to Keysight Technologies from another country.

Keysight Technologies warrants that its software and firmware designated by Keysight Technologies for use with an instrument will execute its programming instruction when property installed on that instrument. Keysight Technologies does not warrant that the operation of the instrument, or software, or firmware will be uninterrupted or error free.

### **Limitation Of Warranty**

The foregoing warranty shall not apply to defects resulting from improper or inadequate maintenance by Buyer, Buyer-supplied software or interfacing, unauthorized modification or misuse, operation outside the environmental specifications for the product, or improper site preparation or maintenance.

**IMPORTANT** No other warranty is expressed or implied. Keysight Technologies specifically disclaims the implied warranties of merchantability and fitness for a particular purpose.

### **Exclusive Remedies**

The remedies provided herein are buyer's sole and exclusive remedies. Keysight Technologies shall not be liable for any direct, indirect, special, incidental, or consequential damages, whether based on contract, tort, or any other legal theory.

 
### Assistance

Product maintenance agreements and other customer assistance agreements are available for Keysight Technologies products.

For any assistance, contact your nearest Keysight Technologies Sales and Service Office. Addresses are provided at the back of this manual.

### Safety Symbol

General definitions of safety symbols used on the instrument or in manuals are listed below.



- ~ Alternating current.
- === Direct current.
- On (Supply).
- **O** Off (Supply).
- **I**n position of push-button switch.
  - Out position of push-button switch.
- Frame (or chassis) terminal. A connection to the frame (chassis) of the equipment which normally include all exposed metal structure.

WARNING This warning sign denotes a hazard. It calls attention to a procedure, practice, condition or the like, which, if not correctly performed or adhered to, could result in injury or death to personnel.

- CAUTION This Caution sign denotes a hazard. It calls attention to a procedure, practice, condition or the like, which, if not correctly performed or adhered to, could result in damage to or destruction of part or all of the product.
- **NOTE** Note denotes important information. It calls attention to a procedure, practice, condition or the like, which is essential to highlight.

# Contents

1.	Installation Guide Incoming Inspection Connecting the 16048G/H	. 10 . 11
2.	Overview Product Overview	. 14 . 15
3.	Operation 4294A Setting Adapter Setup Performing Fixture Compensation	. 18 . 18 . 20
4.	Specifications	. 22
5.	Service Maintenance	. 24

# Contents

# 1 Installation Guide



### **Incoming Inspection**

Inspect the shipping container for damage. If the shipping container or cushioning material is damaged, it should be kept until the contents of the shipment have been checked for completeness and the 16048G/H has been checked mechanically and electrically. The contents of the shipment should be as listed in Table 1-1. If the contents are incomplete, if there is mechanical damage or defect, notify the nearest Keysight Technologies office. If the shipping container is damaged, or the cushioning material shows signs of unusual stress, notify the carrier as well as the Keysight Technologies office. Keep the shipping materials for the carrier's inspection.

Table 1-1

#### Contents


Description	Part Number	Qty.
Test Lead (16048G or 16048H)	-	1
Mounting Plate	-	1
BNC Bracket <sup>a</sup>	16048-60003	1
Operation and Service Manual	16048-90050	1

a. Only furnished with option 001.

### Connecting the 16048G/H

Follow these steps below to connect the 16048G or 16048H to the 4294A.

- **Step 1.** Set the 16048G/H to the test connectors on the front panel of the HP 4294A by gradually coupling the four BNC connectors and fastening screws of the fixture with the test connectors and accessory mounting holes of the instrument until they come to complete contact.
- **Step 2.** Fasten two of the four BNC connectors to the mating test connectors by gradually turning the BNC connectors' rotation levers until each pair of connectors are securely connected. Be sure to align the grooves on both sides.
- **Step 3.** Turn clockwise the fixture's two fastening screws together, so that the fixture is secured to the instrument.
- **Step 4.** Finally, secure the remaining two BNC connectors of the fixture by turning clockwise their rotation levers.

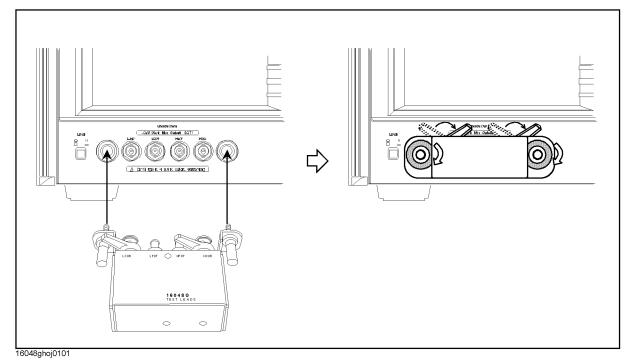

#### Figure 1-1 Connecting the fixture to the instrument

NOTE

Using the connection block securing screws enables the 16048G/H to connect the GND of the 4294A.

Installation Guide Connecting the 16048G/H


# 2 Overview



### **Product Overview**

The 16048G/H consists of a direct attachment, 4-terminal pair interface which is equipped with four BNC (f) connectors. These test leads are used to attach user-fabricated test fixtures. Cable length of the 16048G is 1 meter, the 16048H is 2 meter.

Figure 2-1 Product Overview

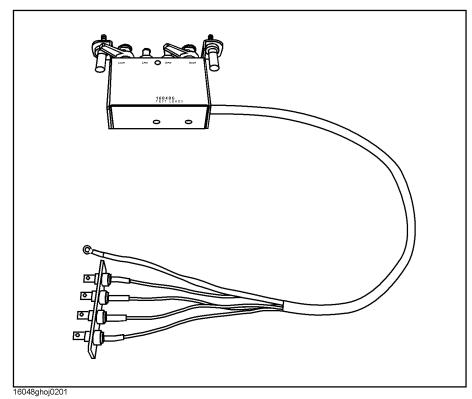

Chapter 2

### Functions

Figure 2-2 shows name of each part of the 16048G/H and Table 2-2 shows their function.




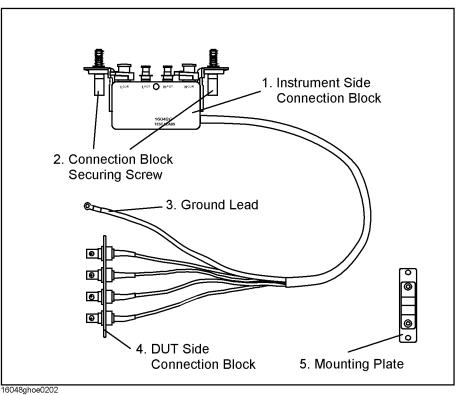



Table 2-1

16048G/H Function

No.	NAME	FUNCTION
1	Instrument Side Connection Block	Connect to the instrument's UNKNOWN terminal.
2	Connection Block Securing Screw	Secures the connection block to the 4294A.
3	Ground Lead	Connect to the chassis or grounded part of the measurement target.
4	DUT Side Connection Block	Used to attach BNC Bracket or user-fabricated test fixtures.
5	Mounting Plate	Mounts on the measurement target to stabilize the cable.

 Overview Functions



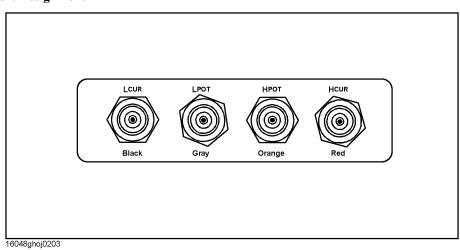

# 3 Operation

This chapter describes the proper methods for setting the 4294A, fixture compensation with the 16048G/H.



### 4294A Setting

Before you begin your measurement, you should perform the adapter setup in the 4294A. Also refer to the operation manual of the 4294A about the adapter setup.


### **Adapter Setup**

Connect the 16048G/H to the 4294A and perform the adapter setup described below.

**NOTE** For adapter setup, use the 100  $\Omega$  Resistor furnished with the 4294A (Keysight P/N 04294-61001).


- 1. More than 30 minutes warm-up time is required after turning on the 4294A.
- 2. Press [Cal] key to bring up the Calibration Menu.
- 3. Press ADAPTER [] key to bring up the adapter setup Menu. [] shows current settings.
- 4. Select **4TP 1M** in the case of 16048G, **4TP 2M** in the 16048H. When the selection is completed, the softkey label will be underlined.
- 5. Press **SETUP** key to bring up the Adapter Setup Menu.
- 6. Connect the Lcur terminal and Lpot terminal on the 16048G or 16048H to the Hpot terminal and Hcur terminal of the 100  $\Omega$  Resistor furnished with the 4294A. The Hcur and Hpot terminal on the 16048G/H should remain open (nothing should be connected).

#### Figure 3-1 Connecting 100 Ω Resister (Phase Compensation Data Measurement)

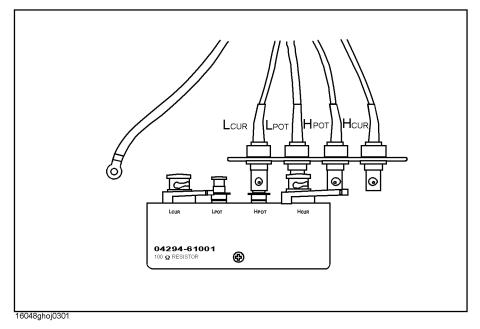

- 7. Press **PHASE COMP** [-] key to start the phase compensation data measurement. About 1 minutes later, phase compensation data measurement is completed and the softkey label changes to **PHASE COMP** [DONE].
- 8. Connect the Lcur, Lpot, Hcur, Hpot terminal on the 16048G or 16048H to the Lcur, Lpot, Hcur, Hpot terminal of the 100  $\Omega$  Resistor respectively.

Figure 3-2 Connecting 100 Ω Resister (Load Data Measurement)

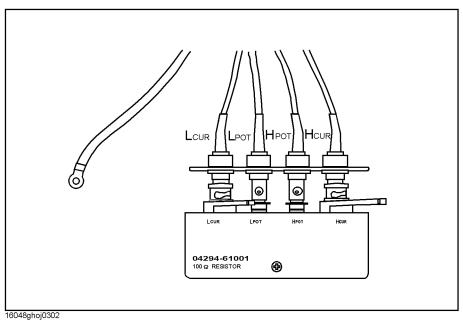

- 9. Press LOAD [-] key to start the load data measurement. When the load data measurement is completed, the softkey label changes to LOAD [DONE].
- 10. Press done key.

# **Performing Fixture Compensation**

To compensate stray capacitance and residual impedance, fixture compensation should be performed. When you use the optional BNC Bracket (Keysight P/N 16048-60003) or an user fabricated test fixture, fixture compensation is required. Refer to the 4294A Operation Manual for the fixture compensation procedure.

4 Specifications

This chapter provides specifications of the 16048G/H Test Leads.



# Specifications

Applicable Instruments		4294A		
Maximum Voltage		± 42V peak max. (AC+DC)		
Operating temp. Environment		-20°C to +150°C (Exclude up to 20 cm from four terminal pair connection block)		
	humidity	15% to 95%RH( @ wet bulb temp. < 40°C)		
Non Operating	temp.	-40°C to +70°C		
Environment. humidity		$\leq$ 90 % RH ( @ wet bulb temp. <65°C)		
Cable length (Nominal	)	1 m (16048G) / 2 m (16048H)		
Weight		Approximately 460 g (16048G) Approximately 690 g (16048H)		
Safety Standards		EN61010-1:1993 +A2:1995 IEC61010-1:1990 +A1:1992 +A2:1995 CSA C22.2 No.1010.1:1992		
		INSTALLATION CATEGORY I POLLUTION DEGREE 2 INDOOR USE		



This chapter provides information on servicing and proper maintenance.




### Maintenance

An exploded view of the 16048G/H for parts identification is shown in Figure 5-1 to Figure 5-4. Do not disassemble any further than shown. Maintenance consists principally of cleaning contacts and replacing worn or damaged parts. Take special care when cleaning contacts.

To order parts, use the Keysight part numbers listed in Table 5-1 to Table 5-4. If a faulty part is located in an assembly that cannot be disassembled, order the next higher assembly or return the fixture to the nearest Keysight Technologies Sales/Service Office for repair or replacement.

Figure 5-1Replacable Parts (part 1 of 4)

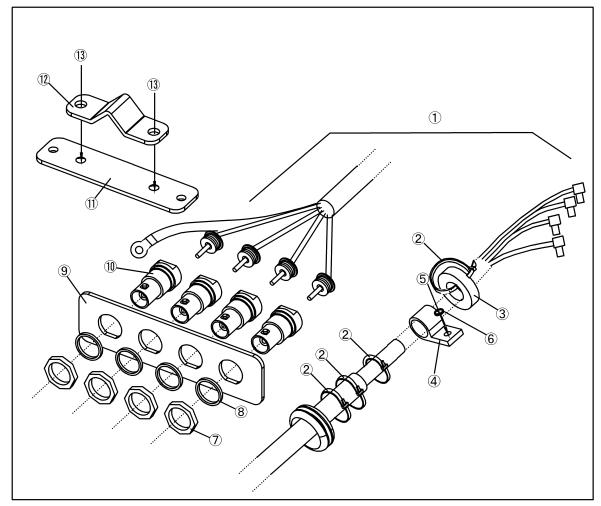


### Table 5-1Replacable Parts (part 1 of 4)

Reference Designator	Keysight Part No.	Qty.	Description
1	16048-61620	1	CBL ASSY 16048G (Excludes 2,3,4,5,6)
	16048-61623	1	CBL ASSY 16048H (Excludes 2,3,4,5,6)
2	1400-0493	4	CABLE TIE
3	9170-1465	1	CORE
4	-	1	CBL CLANP
5	0515-1550	1	SCR M3-L 8 P-H
6	3050-0891	1	WASHER M3
7	2950-0035	4	NUT-HEX-DBL-CHAM
8	2190-0102	4	WASHER
9	16048-00623	1	GUIDE
10	1250-0252	4	CONN-RF BNC
11	16048-00626	1	PLATE
12	16048-00627	1	ANGLE
13	0515-1012	2	SCR FL M4L8

### Service Maintenance

Figure 5-2Replacable Parts (part 2 of 4)

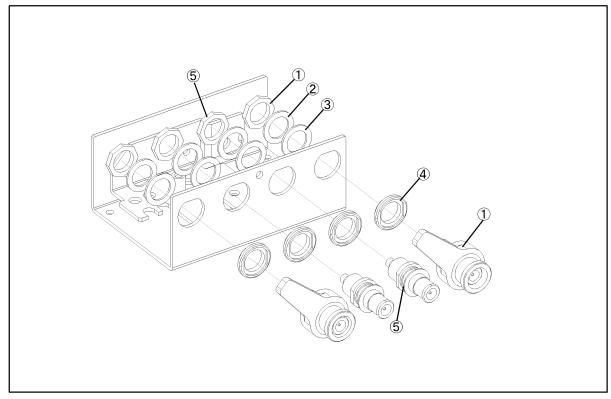



Replacable Parts (part 2 of 4)

Reference Designator	Keysight Part No.	Qty.	Description
1	16044-60001	2	CONN BNC-SMB
2	3050-0067	4	WSHR-FL MTLC
3	3050-0789	4	WSHR-FL NM
4	16047-40002	4	INSULATOR
5	1253-0476	2	ADPT BNC-SMB

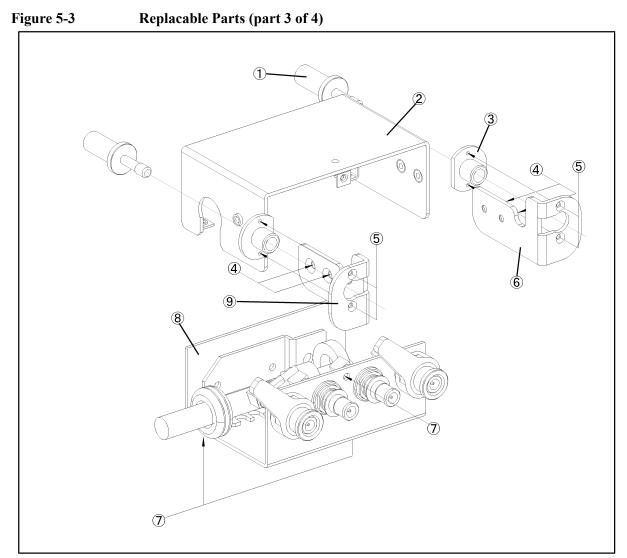


Table 5-3

**Replacable Parts (part 3 of 4)** 


Reference Designator	Keysight Part No.	Qty.	Description
1	16047-24021	2	KNOB
2	16048-04021	1	COVER TOP (16048G)
	16048-04025	1	COVER TOP (16048H)
3	16047-24026	2	FLANGE
4	0515-0914	4	SCR-MACH M3X0.5
5	0515-0952	4	SCR-MACH M2X0.4
6	16048-00624	1	ANGLE
7	0515-0914	3	SCR-MACH M3X0.5

### Service **Maintenance**

### Table 5-3Replacable Parts (part 3 of 4)

Reference Designator	Keysight Part No.	Qty.	Description
8	16048-04022	1	COVER BOTTOM
9	16048-00625	1	ANGLE

### Figure 5-4Replacable Parts (part 4 of 4)

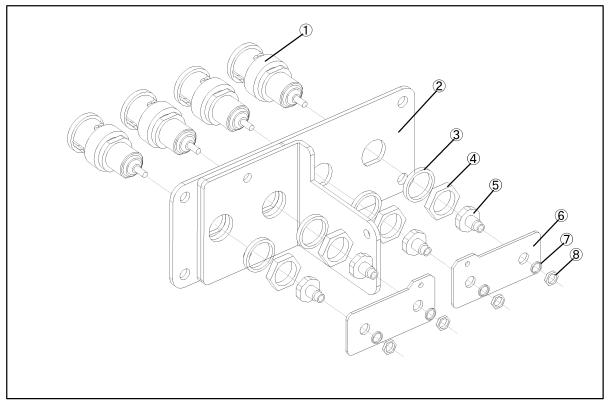



### **Replacable Parts (part 4 of 4)**

Reference Designator	Keysight Part No.	Qty.	Description
1	1250-1985	4	CONNECTOR-BNC
2	16048-00621	1	PLATE
3	2190-0016	4	WASHER
4	2950-0043	4	NUT-HEX-DBL-CHAM
5	16380-24001	4	TERMINAL
6	42036-00601	2	PLATE
7	3050-0893	4	WASHER
8	0535-0043	4	NUT

This information is subject to change without notice. © Keysight Technologies 1999, 2001, 2015 Edition 4, March 2015



16048-90050 www.keysight.com

