


Instruction Manual

JACK PIN DESIGNATIONS	TIA / EIA T568A	TIA / EIA T568B	INDUSTRIAL
	1 White/Green	White/Orange	Yellow Orange
	2 Green	Orange	Orange
	3 White/Orange	White/Green	White Blue
	6 Orange	Green	Blue
	4 Blue	Blue	
	5 White/Blue	White/Blue	
	7 White/Brown	White/Brown	
	8 Brown	Brown	


①

Remove the stopper before installation.

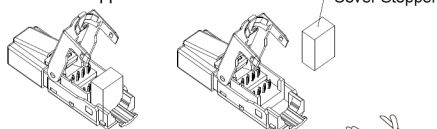


②

Insert cable into strain relief boot, strip off 1.2 inch of cable jacket, fold back the drain wire.

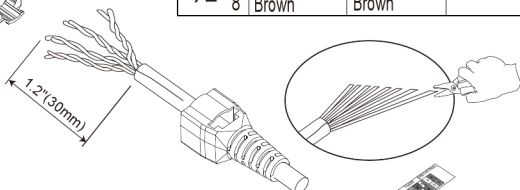


③

Fan out all four twisted pairs, following the color coding label and allocate each conductors into proper slots on wiring cap. Trim the ends of conductors.

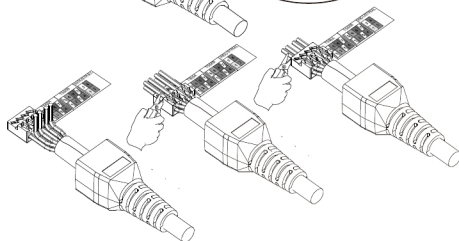


④

Remove the wiring label before place wiring cap on plug.

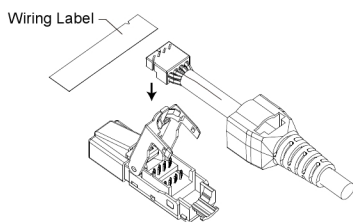


⑤

Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.

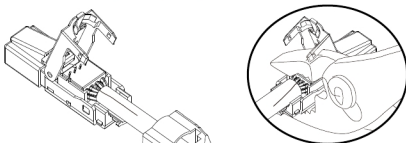


⑥

Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.

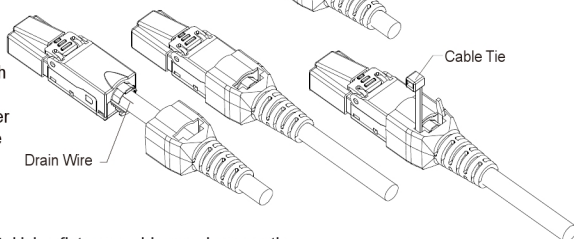


Unload the cable

Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.

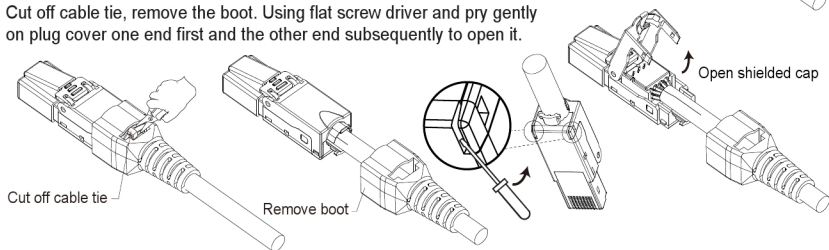

Boot adjustment

Cut the end of boot to fit your cable OD.

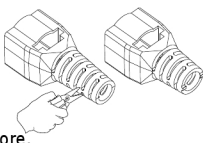

NB. Designed for lengths of 4m or more. Shorter lengths may not have full Category 6A performance



PGSmc CE