Product / Process Change Notification



Page 1 of 3

N° 2020-057-A

Dear Customer,

Please find attached our INFINEON Technologies PCN:

DC offset level reduction of MERUS™ products and Introduction of MERUS™ trademark

Important information for your attention:

- Please respond to this PCN by indicating your decision on the approval form, sign it and return to your sales partner before 12th August 2020.
- Infineon aligns with the widely-recognized JEDEC STANDARD "JESD46", which stipulates: "Lack of acknowledgement of the PCN within 30 days constitutes acceptance of the change."

Your prompt reply will help Infineon Technologies to assure a smooth and well executed transition. If Infineon does not hear from your side by the due date, we will assume your full acceptance to this proposed change and its implementation.

restricted

Your attention and response to this matter is greatly appreciated.

Commercial Register: München HRB 126492

2020-07-01

Product / Process Change Notification



2020-057-A

Products affected:

Please refer to attached affected product list 1_cip20057_a



Detailed Change Information:

Subject:

- Reduction of DC offset for digital input parts
- Introduction of MERUS™ trademark

Reason:

- Main reason for this revision update is to reduce the DC offset for digital input parts (MA12040P and MA12070P) in order to elimate click/pop noise during start-up. Other limitations and known issues have been resolved with this update as well.
- Integration of MERUS products into Infineon Technologies AG

Description (applies to): Old

DC offset • MA12040P, MA12070P

- High output voltage offset leading to potential audible click/pop noise during startup.
 - BTL/PBTL = +/-200mV
 - SE = not specified

New

- DC offset is trimmed in production giving inaudible click/pop nosie during start-up.
 - BTL/PBTL = +/-35mV
 - SE = +/-90mV

Note that is only valid for the follwoing output configurations: BTL, PBTL, BTL+2xSE (2.1), i.e. not for 4xSE output configuration (OUT0A and OUT0B not trimmed).

MA12040P, MA12070P

- Active on default potentially causing unwanted limiter behaviour
- Functionality has been turned off on default

Limiter active flag MA12040P, MA12070P

- flag errounously set with low volume settings
- not set with low volume settings

Output polarity MA12040P, MA12070P

- reversed for BTL and PBTL output configurations.
- Datasheet now reflects the correct polarity sign for BTL and PBTL output configuration

/CLIP pin

MA12040P. MA12070P. MA12040, MA12070

- always active for PBTL output configuration.
- now only active when clipping occurs for all output configurations.

Marking on device

eximo®







rotating the top marking by 90°C without changing the pin1 location

Product / Process Change Notification



N° 2020-057-A

Product Identification: External traceability via marking on device and Trademark on the label



Internal traceability via Baunumber, Lotnumber, date code

▶ Impact of Change: NO change in quality and reliability verified within product qualification

NO changes in bill of material

NO change in fit, form and function

► Attachments: Affected product list 1_cip20057_a

► Time Schedule:

Final qualification report: on request

First samples available: 30-July-2020

Intended start of delivery: 30-September-2020 or earlier pending on customer approval

If you have any questions, please do not hesitate to contact your local Sales office.