



Product Change Notification / SYST-24FWSJ823

Date:

26-Nov-2020

Product Category:

8-bit Microcontrollers

PCN Type:

Document Change

Notification Subject:

ERRATA - PIC16(L)F15356/75/76/85/86 Family Silicon Errata and Data Sheet Clarification

Affected CPNs:

[SYST-24FWSJ823_Affected_CPN_11262020.pdf](#)

[SYST-24FWSJ823_Affected_CPN_11262020.csv](#)

Notification Text:

SYST-24FWSJ823

Microchip has released a new Product Documents for the PIC16(L)F15356/75/76/85/86 Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [PIC16\(L\)F15356/75/76/85/86 Family Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change:

This revision includes the following updates to Data Sheet Clarifications:

- 1) Added Table 37-1 and Section 4.3 ADC Offset Error
- 2) Updated Table 2 and Section 4.1.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 26 Nov 2020

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N

Attachments:

[PIC16\(L\)F15356/75/76/85/86 Family Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC16F15356-E/ML
PIC16F15356-E/MV
PIC16F15356-E/SO
PIC16F15356-E/SP
PIC16F15356-E/SS
PIC16F15356-E/SSVAO
PIC16F15356-I/ML
PIC16F15356-I/MV
PIC16F15356-I/SO
PIC16F15356-I/SP
PIC16F15356-I/SS
PIC16F15356T-E/5NVAO
PIC16F15356T-E/MV
PIC16F15356T-E/SS
PIC16F15356T-E/SSV03
PIC16F15356T-E/SSVAO
PIC16F15356T-I/ML
PIC16F15356T-I/MV
PIC16F15356T-I/SO
PIC16F15356T-I/SS
PIC16F15356T-I/SSV01
PIC16F15356T-I/SSVAO
PIC16F15375-E/ML
PIC16F15375-E/MV
PIC16F15375-E/MVVAO
PIC16F15375-E/P
PIC16F15375-E/PT
PIC16F15375-I/ML
PIC16F15375-I/MV
PIC16F15375-I/P
PIC16F15375-I/PT
PIC16F15375T-E/PT
PIC16F15375T-E/PTVAO
PIC16F15375T-I/ML
PIC16F15375T-I/MV
PIC16F15375T-I/PT
PIC16F15376-E/ML
PIC16F15376-E/MV
PIC16F15376-E/P
PIC16F15376-E/PT
PIC16F15376-I/ML
PIC16F15376-I/MV
PIC16F15376-I/P
PIC16F15376-I/PT
PIC16F15376T-I/ML
PIC16F15376T-I/MV

PIC16F15376T-I/PT
PIC16F15376T-I/PTVAO
PIC16F15385-E/MV
PIC16F15385-E/PT
PIC16F15385-E/PTVAO
PIC16F15385-I/MV
PIC16F15385-I/PT
PIC16F15385-I/PTVAO
PIC16F15385T-E/MV
PIC16F15385T-I/MV
PIC16F15385T-I/PT
PIC16F15385T-I/PTVAO
PIC16F15386-E/MV
PIC16F15386-E/PT
PIC16F15386-E/PTVAO
PIC16F15386-I/MV
PIC16F15386-I/PT
PIC16F15386T-I/MV
PIC16F15386T-I/PT
PIC16LF15356-E/ML
PIC16LF15356-E/MV
PIC16LF15356-E/MVVAO
PIC16LF15356-E/SO
PIC16LF15356-E/SP
PIC16LF15356-E/SS
PIC16LF15356-I/ML
PIC16LF15356-I/MV
PIC16LF15356-I/SO
PIC16LF15356-I/SP
PIC16LF15356-I/SS
PIC16LF15356T-E/MVV02
PIC16LF15356T-E/MVVAO
PIC16LF15356T-E/SS
PIC16LF15356T-I/ML
PIC16LF15356T-I/MV
PIC16LF15356T-I/SO
PIC16LF15356T-I/SS
PIC16LF15375-E/ML
PIC16LF15375-E/MV
PIC16LF15375-E/P
PIC16LF15375-E/PT
PIC16LF15375-I/ML
PIC16LF15375-I/MV
PIC16LF15375-I/P
PIC16LF15375-I/PT
PIC16LF15375T-I/ML
PIC16LF15375T-I/MV
PIC16LF15375T-I/PT
PIC16LF15376-E/ML

PIC16LF15376-E/MV
PIC16LF15376-E/P
PIC16LF15376-E/PT
PIC16LF15376-I/ML
PIC16LF15376-I/MV
PIC16LF15376-I/P
PIC16LF15376-I/PT
PIC16LF15376T-E/NHXVAO
PIC16LF15376T-I/ML
PIC16LF15376T-I/MV
PIC16LF15376T-I/PT
PIC16LF15385-E/MV
PIC16LF15385-E/PT
PIC16LF15385-I/MV
PIC16LF15385-I/PT
PIC16LF15385T-E/MV
PIC16LF15385T-I/MV
PIC16LF15385T-I/PT
PIC16LF15386-E/MV
PIC16LF15386-E/PT
PIC16LF15386-E/PTVAO
PIC16LF15386-I/MV
PIC16LF15386-I/PT
PIC16LF15386T-I/MV
PIC16LF15386T-I/PT

PIC16(L)F15356/75/76/85/86 Family Silicon Errata and Data Sheet Clarification

The PIC16(L)F15356/75/76/85/86 family devices that you have received conform functionally to the current Device Data Sheet (DS40001866B), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).


The errata described in this document will be addressed in future revisions of the PIC16(L)F15356/75/76/85/86 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A2**).

Data Sheet clarifications and corrections start on [page 5](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers, and emulation tools, which are available at the Microchip corporate website (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon ().
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC16(L)F15356/75/76/85/86 silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾	
		A1	A2
PIC16F15356	30B0h	2001h	2002h
PIC16LF15356	30B1h	2001h	2002h
PIC16F15375	30B2h	2001h	2002h
PIC16LF15375	30B3h	2001h	2002h
PIC16F15376	30B4h	2001h	2002h
PIC16LF15376	30B5h	2001h	2002h
PIC16F15385	30B6h	2001h	2002h
PIC16LF15385	30B7h	2001h	2002h
PIC16F15386	30B8h	2001h	2002h
PIC16LF15386	30B9h	2001h	2002h

- Note 1:** The Device IDs (DEVID and DEVREV) are located at addresses 8006h and 8005h, respectively. They are shown in hexadecimal in the format "DEVID DEVREV".
- 2:** Refer to the "PIC16(L)F153XX Memory Programming Specification" (DS40001838) for detailed information on Device and Revision IDs for your specific device.

PIC16(L)F15356/75/76/85/86

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions	
				A1	A2
Analog-to-Digital Converter (ADC)	ADC Positive Voltage Reference	1.1	Using FVR as the positive voltage reference to the ADC can cause missing codes in the conversion result.	X	X
Development Support	Data Breakpoints	2.1	Data breakpoints are not available on Banks 32 through 63.	X	X
Windowed Watchdog Timer (WWDT)	Watchdog Timer Clock Source	3.1	WWDT does not work with SOSC as the clock source.	X	X
Electrical Specifications	Min. VDD Specification	4.1	VDDMIN specifications are changed for LF devices only.	X	X
	Fixed Voltage Reference (FVR) Accuracy	4.2	Fixed Voltage Reference (FVR) output tolerance may be higher than specified at temperatures below -20°C.	X	X
	ADC Offset Error	4.3	ADC Offset Error specification changed.	X	X

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (A2).

1. Module: Analog-to-Digital Converter (ADC)

1.1 ADC Positive Voltage Reference

Using the FVR as the positive voltage reference to the ADC can cause an increase in missing codes.

Work around

1. Increase the bit conversion time, known as TAD, to 8 us.
2. Use VDD as the positive voltage reference to the ADC.

Affected Silicon Revisions

A1	A2						
X	X						

2. Module: Development Support

2.1 Data Breakpoints

Data breakpoints are not available on Banks 32 through 63. Any breakpoints that are placed in Banks 32 through 63 will fail to be recognized.

Work around

None.

Affected Silicon Revisions

A1	A2						
X	X						

3. Module: Windowed Watchdog Timer (WWDT)

3.1 WWDT Clock Source Selection

When the WDTCS <2:0> bits of the WDTCON1 register are set to 'b010', selecting the Secondary Oscillator SOSC 32 kHz as the clock source, the WWDT does not operate.

Work around

Use the LFINTOSC or MFINTOSC clock sources for the WWDT.

Affected Silicon Revisions

A1	A2						
X	X						

4. Module: Electrical Specifications

4.1 Min VDD Specification

VDDMIN at -40°C to +25°C = 2.3V. (See **Table 37-1: Supply Voltage** on the following page for reference.)

Work around

None.

Affected Silicon Revisions

A1	A2						
X	X						

4.2 Fixed Voltage References (FVR) Accuracy

At temperatures below -20°C, the output voltage for the FVR may be greater than the levels specified in the data sheet. This will apply to all three gain amplifier settings, (1X, 2X, 4X). The affected parameter numbers found in the data sheet are: FVR01 (1X gain setting), FVR02 (2X gain setting), and FVR03 (4X gain setting).

Work around

None.

Affected Silicon Revisions

A1	A2						
X	X						

4.3 ADC Offset Error

The table containing the Offset Error specification (AD04: EOFF) for the Analog-to-Digital Converter is modified. The updated value for Offset Error specification is +/- 3.0 LSB.

Work around

None.

Affected Silicon Revisions

A1	A2						
X	X						

PIC16(L)F15356/75/76/85/86

TABLE 37-1: SUPPLY VOLTAGE

PIC16LF15356/75/76/85/86			Standard Operating Conditions (Unless Otherwise Stated)				
Param. No.	Sym.	Characteristic	Min.	Typ.†	Max.	Units	Conditions
D002	VDD		1.8	—	3.6	V	FOSC ≤ 16 MHz, +25°C < TA ≤ +125°C
D002	VDD		2.3	—	3.6	V	FOSC ≤ 16 MHz, -40°C ≤ TA ≤ +25°C
			2.5	—	3.6	V	FOSC > 16 MHz

PIC16(L)F15356/75/76/85/86

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40001866B):

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

1. Module: Interrupt-On-Change (PORTE)

Bits <2:0> are unimplemented in registers IOCEP, IOCEN, and IOCEF, as indicated in the following register tables.

REGISTER 17-10: IOCEP: INTERRUPT-ON-CHANGE PORTE POSITIVE EDGE REGISTER

U-0	U-0	U-0	U-0	R/W/HS-0/0	U-0	U-0	U-0
—	—	—	—	IOCEP3 ⁽¹⁾	—	—	—
bit 7				bit 0			

Legend:

R = Readable bit	W = Writable bit	U = Unimplemented bit, read as '0'
u = Bit is unchanged	x = Bit is unknown	-n/n = Value at POR and BOR/Value at all other Resets
'1' = Bit is set	'0' = Bit is cleared	HS - Bit is set in hardware

bit 7-4 **Unimplemented:** Read as '0'

bit 3 **IOCEP3:** Interrupt-on-Change PORTE Positive Edge Enable bit
 1 = Interrupt-on-Change enabled on the pin for a positive-going edge. IOCCFx bit and IOCIF flag will be set upon detecting an edge.
 0 = Interrupt-on-Change disabled for the associated pin

bit 2-0 **Unimplemented:** Read as '0'

Note 1: IF MCLRE = 1 or LVP = 1, port functionality is disabled and IOC on that pin is not available.

REGISTER 17-11: IOCEN: INTERRUPT-ON-CHANGE PORTE NEGATIVE EDGE REGISTER

U-0	U-0	U-0	U-0	R/W/HS-0/0	U-0	U-0	U-0
—	—	—	—	IOCEN3 ⁽¹⁾	—	—	—
bit 7				bit 0			

Legend:

R = Readable bit	W = Writable bit	U = Unimplemented bit, read as '0'
u = Bit is unchanged	x = Bit is unknown	-n/n = Value at POR and BOR/Value at all other Resets
'1' = Bit is set	'0' = Bit is cleared	HS - Bit is set in hardware

bit 7-4 **Unimplemented:** Read as '0'

bit 3 **IOCEN:** Interrupt-on-Change PORTE Negative Edge Enable bit
 1 = Interrupt-on-Change enabled on the pin for a negative-going edge. IOCCFx bit and IOCIF flag will be set upon detecting an edge.
 0 = Interrupt-on-Change disabled for the associated pin

bit 2-0 **Unimplemented:** Read as '0'

Note 1: IF MCLRE = 1 or LVP = 1, port functionality is disabled and IOC on that pin is not available.

PIC16(L)F15356/75/76/85/86

REGISTER 17-12: IOCEF: INTERRUPT-ON-CHANGE PORTE FLAG REGISTER

U-0	U-0	U-0	U-0	R/W/HS-0/0	U-0	U-0	U-0
—	—	—	—	IOCEP3 ⁽¹⁾	—	—	—
bit 7							bit 0

Legend:

R = Readable bit

W = Writable bit

U = Unimplemented bit, read as '0'

u = Bit is unchanged

x = Bit is unknown

-n/n = Value at POR and BOR/Value at all other Resets

'1' = Bit is set

'0' = Bit is cleared

HS - Bit is set in hardware

bit 7-4 **Unimplemented:** Read as '0'

bit 3 **IOCEF:** Interrupt-on-Change PORTE Flag bit

1 = An enabled change was detected on the associated pin

Set when IOCCPx = 1 and a rising edge was detected on RCx, or when IOCCNx = 1 and a falling edge was detected on RCx.

0 = No change was detected, or the user cleared the detected change

bit 2-0 **Unimplemented:** Read as '0'

Note 1: IF MCLRE = 1 or LVP = 1, port functionality is disabled and IOC on that pin is not available.

2. Module: Section 4.2.3 Boot Block

If $\overline{\text{BBEN}} = 0$, the Boot Block is enabled and a specific address range is allotted as the Boot Block based on the value of the BBSIZE bits of Configuration Word ([Register 5-4](#)) and the sizes provided in [Table 5-1](#).

APPENDIX A: DOCUMENT REVISION HISTORY

Rev C Document (11/2020)

Added Table 37-1 and Section 4.3 ADC Offset Error;
Updated Table 2 and Section 4.1.

Rev B Document (11/2018)

Added Module 4: Electrical Specifications, 4.1 and 4.2.
Data Sheet Clarifications: Removed Modules 1 and 2.
Added Module 1: Interrupt-on-Change (PORTE); Added
Module 2: Section 4.2.3 Boot Block.

Rev A Document (1/2017)

Initial release of this document.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGL00, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-7085-4

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4485-5910
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820