



## PART CHANGE NOTIFICATION

Part Number	CLB-JL73	Issue Date	27.05.2021
Original Design Image	 <p><b>COMMENTS</b> Original design features 4 incisions in centre ring</p>		
New Design Image	 <p><b>COMMENTS</b> New design has solid centre ring</p>		
<p><b>REASONS FOR DESIGN CHANGE</b></p> <p>1) The centre ring with the 4 splits used to be made by hand which was difficult to put together, it can now be done by machine with the solid centre ring. This is an update of the production of the part, it does not affect the use.</p> <p>2) The centre ring with the 4 splits is formed by melting and moulding the metal, then the 4 incisions are made afterwards. Unfortunately this process can lead to residual metal slag inside the connector, which when electroplated can then become stuck inside and therefore cannot be removed. This introduces an obstruction which can cause a short circuit when the product is in use.</p>			