



Product Change Notification / SYST-10KUPG445

Date:

22-Jun-2021

Product Category:

32-bit Microcontrollers

PCN Type:

Silicon Die Revision

Notification Subject:

ERRATA - PIC32CM MC00 Family Data Sheet Clarifications and Silicon Errata

Affected CPNs:

[SYST-10KUPG445_Affected_CPN_06222021.pdf](#)

[SYST-10KUPG445_Affected_CPN_06222021.csv](#)

Notification Text:

SYST-10KUPG445

Microchip has released a new Product Documents for the PIC32CM MC00 Family Data Sheet Clarifications and Silicon Errata of devices. If you are using one of these devices please read the document located at [PIC32CM MC00 Family Data Sheet Clarifications and Silicon Errata](#).

Notification Status: Final

Description of Change:

Add silicon die revision A2

This revision contains numerous typographical updates throughout the document along with the updates listed here.

The I2C, SPI and I2S standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively.

- The following Errata were added in this revision:
 - 1.2.4 RXNACK – PDEC: STATUS 1.5.1
 - PDEC: STATUS 1.5.2 – PDEC: HALL MODE 1.5.3

– PDEC: HALL MODE 1.5.4

• The following Data Sheet Clarifications were added:

- Absolute Maximum Ratings
- Internal 48MHz RC Oscillator (OSC48M) – I/O Pin Electrical Characteristics – SERCOM SPI Host/Client

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 21 Jun 2021

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Revision History: June 11, 2021. Issued Errata document change.

June 21, 2021. Reissued this notification to indicate that this Errata document adds silicon die revision A2.

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to [receive Microchip PCNs via email](#) please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to [change your PCN profile, including opt out](#), please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC32CM1216MC00032-I/PT
PIC32CM1216MC00032-I/RTB
PIC32CM1216MC00032T-I/PT
PIC32CM1216MC00032T-I/RTB
PIC32CM1216MC00048-I/U5B
PIC32CM1216MC00048-I/Y8X
PIC32CM1216MC00048T-I/U5B
PIC32CM1216MC00048T-I/Y8X
PIC32CM6408MC00032-I/PT
PIC32CM6408MC00032-I/RTB
PIC32CM6408MC00032T-I/PT
PIC32CM6408MC00032T-I/RTB
PIC32CM6408MC00048-I/U5B
PIC32CM6408MC00048-I/Y8X
PIC32CM6408MC00048T-I/U5B
PIC32CM6408MC00048T-I/Y8X

SYST-10KUPG445 - ERRATA - PIC32CM MC00 Family Data Sheet Clarifications and Silicon Errata

Affected Catalog Part Numbers(CPN)

PIC32CM1216MC00032-I/PT
PIC32CM1216MC00032-I/RTB
PIC32CM1216MC00032T-I/PT
PIC32CM1216MC00032T-I/RTB
PIC32CM1216MC00048-I/U5B
PIC32CM1216MC00048-I/Y8X
PIC32CM1216MC00048T-I/U5B
PIC32CM1216MC00048T-I/Y8X
PIC32CM6408MC00032-I/PT
PIC32CM6408MC00032-I/RTB
PIC32CM6408MC00032T-I/PT
PIC32CM6408MC00032T-I/RTB
PIC32CM6408MC00048-I/U5B
PIC32CM6408MC00048-I/Y8X
PIC32CM6408MC00048T-I/U5B
PIC32CM6408MC00048T-I/Y8X

PIC32CM MC00 Family Data Sheet Clarifications and Silicon Errata

PIC32CM MC00 Family

The PIC32CM MC00 family of devices that you have received conforms functionally to the current Device Data Sheet (DS60001638E), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the following table.

The errata described in this document will be addressed in future revisions of the PIC32CM MC00 family of devices.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Data Sheet clarifications and corrections (if applicable) are located in [Data Sheet Clarifications](#), following the discussion of silicon issues.

Table 1. PIC32CM MC00 Family Silicon Device Identification

Devices	Device ID (DID[31:0])	Silicon Revision ID (DID.REVISION[3:0])	
		A1	A2
PIC32CM1216MC00032	0x11070x00	0x0	0x1
PIC32CM6408MC00032	0x11070x01	0x0	0x1
PIC32CM1216MC00048	0x11070x06	0x0	0x1
PIC32CM6408MC00048	0x11070x07	0x0	0x1

Note:

1. Refer to the “*Device Service Unit*” chapter in the current Device Data Sheet (DS60001638E) for a detailed information on Device Identification and Revision IDs for a specific device.

Silicon Errata Summary

Module	Feature	Errata Number	Issue Summary	Affected Revisions	
				A1	A2
NVMCTRL	DATA FLASH	1.1.1	CPU writes to any memory or register while a write or erase operation is ongoing in the Data Flash address space will stall the AHB bus for the duration of the write or erase operation. CPU reads are not impacted.	X	
NVMCTRL	CEHL	1.1.2	The CEHL feature is not functional.	X	
SERCOM I ² C	Repeated Start	1.2.1	For Host Write operations (excluding High-Speed mode) in 10-bit addressing mode, writing CTRLB.CMD = 0x1 does not correctly issue a Repeated Start command.	X	X
SERCOM I ² C	Repeated Start	1.2.2	For High-Speed Host Write operations, writing CTRLB.CMD = 0x1 issues a STOP command instead of a Repeated Start, making repeated start not possible in that mode.	X	X
SERCOM I ² C	NACK and Repeated Start	1.2.3	For High-Speed Host Read operations, sending a NACK (CTRLB.CMD = 0x2) forces a STOP to be issued, making repeated start not possible in that mode.	X	X
SERCOM I ² C	RXNACK	1.2.4	The RXNACK status bit is invalid during the first DRDY interrupt.	X	X
OSCCTRL	FDPLL Unlock	1.3.1	Spurious DPLL unlocks may be detected during operation.	X	X
OSCCTRL	FDPLL ONDEMAND	1.3.2	The FDPLL96M On Demand mode (DPLLCTRLA.ONDEMAND = 1) is not functional in Standby Sleep mode.	X	X
AC	INTREF	1.4.1	For AC reference voltage do not use the INTREF.	X	X
PDEC	STATUS	1.5.1	When the INTFLAG.ERR is rising the associated STATUS.xERR is set after a delay.	X	X
PDEC	STATUS	1.5.2	When the INTFLAG.DIR is rising the associated STATUS.DIR is set after a delay.	X	X
PDEC	HALL MODE	1.5.3	In Hall mode, a spurious WINERR can be reported at start command or when leaving standby.	X	X
PDEC	HALL MODE	1.5.4	In Hall mode, when rotation is very slow or stopped then several WINERR interrupts can occur.	X	X

Table of Contents

PIC32CM MC00 Family..... 1

 1. Silicon Errata Summary..... 2

1. PIC32CM MC00 Errata Issues..... 4

 1.1. Non-Volatile Memory Controller (NVMCTRL)..... 4

 1.2. SERCOM I²C..... 4

 1.3. OSCCTRL..... 5

 1.4. AC..... 6

 1.5. PDEC..... 6

2. Data Sheet Clarifications..... 8

 2.1. Absolute Maximum Ratings..... 8

 2.2. Internal 48MHz RC Oscillator (OSC48M)..... 8

 2.3. I/O Pin Electrical Characteristics..... 8

 2.4. SERCOM SPI Host/Client..... 9

3. Appendix A: Revision History..... 10

The Microchip Website..... 11

Product Change Notification Service..... 11

Customer Support..... 11

Microchip Devices Code Protection Feature..... 11

Legal Notice..... 12

Trademarks..... 12

Quality Management System..... 13

Worldwide Sales and Service..... 14

1. PIC32CM MC00 Errata Issues

The following issues apply to the PIC32CM MC00 family of devices.

1.1 Non-Volatile Memory Controller (NVMCTRL)

1.1.1 DATA FLASH

CPU writes to any memory or register while a write or erase operation is ongoing in the Data Flash address space will stall the AHB bus for the duration of the write or erase operation. CPU reads are not impacted.

The stall duration will be up to the maximum time of the Flash write or erase operation:

Page Write time: 2.5 ms

Row Erase time: 6 ms

Sector Erase time: 8 ms

Workaround

Perform Data Flash modify operations in a safe region of the application where CPU writes are not required.

Affected Silicon Revisions

A1	A2			
X				

1.1.2 CEHL

The Chip Erase Hard Lock (CEHL) feature is not functional and will not provide any code protection capabilities. The Secure Bit (SB) is not affected and can be used for code protection.

Workaround

None.

Affected Silicon Revisions

A1	A2			
X				

1.2 SERCOM I²C

1.2.1 Repeated Start

For Host Write operations (excluding High-Speed mode) in 10-bit Addressing mode, writing CTRLB.CMD = 0x1 does not correctly issue a Repeated Start command.

Workaround

Write the same 10-bit address with the same direction bit to the ADDR.ADDR register to generate a Repeated Start.

Affected Silicon Revisions

A1	A2			
X	X			

1.2.2 Repeated Start

For High-Speed Host Write operations, writing CTRLB.CMD = 0x1 issues a STOP command instead of a Repeated Start, making repeated start not possible in that mode.

Workaround
None.

Affected Silicon Revisions

A1	A2			
X	X			

1.2.3 NACK and Repeated Start

For High-Speed Host Read operations, sending a NACK (CTRLB.CMD = 0x2) forces a STOP to be issued, making repeated start not possible in that mode.

Workaround
None.

Affected Silicon Revisions

A1	A2			
X	X			

1.2.4 RXNACK

The RXNACK status bit is invalid during the first DRDY interrupt.

Workaround
Use a software flag to track when to ignore RXNACK and reset this flag in the I2CS_AMATCH interrupt handler (workaround not applicable when AACKEN = 1).

Affected Silicon Revisions

A1	A2			
X	X			

1.3 OSCCTRL

1.3.1 FDPLL Unlock

When using FDPLL at temperatures below 25°C, spurious DPLL unlocks (OSCCTRL.DPLLSTATUS.LOCK = 0) may be detected while the FDPLL still adheres to the electrical characteristics metrics defined in section 43.16 of the data sheet. During these unlock periods, the DPLL output clock is halted and then restarts.

Workaround
When using FDPLL at temperatures below 25°C, enable the lock bypass (OSCCTRL.DPLLCTRLB.LBYPASS = 1) to avoid losing FDPLL clock output during a false unlock status. The workaround does not avoid false unlock indications, but it disables the gating of the FDPLL clock output by the lock status; therefore, the clock is issued even if the FDPLL status shows unlocked.

Pseudo Code

Set OSCCTRL.DPLLCTRLB.LBYPASS = 1

Set DPLLCTRLA.ENABLE = 1
 Wait (OSCCTRL.DPLLSTATUS.CLKRDY = 1)
 Set Source for GCLK with DPLL

Affected Silicon Revisions

A1	A2			
X	X			

1.3.2 FDPLL ONDEMAND

The FDPLL96M On Demand mode (DPLLCTRLA.ONDEMAND = 1) is not functional in Standby Sleep mode.

Workaround

Set the DPLLCTRLA.ONDEMAND = 0 which makes the FDPLL96M always run in Standby Sleep mode.

Affected Silicon Revisions

A1	A2			
X	X			

1.4 AC

1.4.1 INTREF

When using the AC module, do not use the INTREF (AC.COMPCTRLx.MUXNEG = INTREF) as an internal reference voltage.

Workaround

Use the DAC (AC.COMPCTRLx.MUXNEG = DAC) for the internal reference of the AC module.

Affected Silicon Revisions

A1	A2			
X	X			

1.5 PDEC

1.5.1 STATUS

When the INTFLAG.ERR is rising the associated STATUS.xERR is set after a delay.

Workaround

Poll the STATUS register until the ERR bit is set.

Affected Silicon Revisions

A1	A2			
X	X			

1.5.2 STATUS

When the INTFLAG.DIR is rising the associated STATUS.DIR is set after a delay. It is not recommended to use the INTFLAG.DIR and STATUS.DIR in conjunction with each other.

Workaround
None.

Affected Silicon Revisions

A1	A2			
X	X			

1.5.3 HALL MODE

In Hall mode, a spurious WINERR can be reported at the Start command or when leaving standby.

Workaround
Ignore WINERR in Hall mode at the Start command or when leaving standby.

Affected Silicon Revisions

A1	A2			
X	X			

1.5.4 HALL MODE

In Hall mode, when rotation is very slow or stopped several WINERR interrupts can occur.

Workaround
When a stop or low speed is indicated by the WINERR interrupt, disable the Hall error interrupts until the error condition has disappeared.

Affected Silicon Revisions

A1	A2			
X	X			

2. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS60001638E):

Note: Corrections in tables, registers, and text are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

2.1 Absolute Maximum Ratings

The Absolute Maximum Ratings for VDD, VDDIO, and voltage on any pin with respect to ground have been reduced to +/- 0.3V beyond the operating voltage range.

Table 43-1. Absolute Maximum Ratings	
Voltage on VDD with respect to GND	-0.3V to +5.8V
Voltage on VDDIO with respect to GND	-0.3V to +5.8V
Voltage on any pin with respect to GND	-0.3V to (VDD/VDDIO+0.3V)

2.2 Internal 48MHz RC Oscillator (OSC48M)

The Internal 48 MHz RC Oscillator will only display the accuracy specification for the full temperature range of -40°C to 85°C.

43-14 Internal 48 MHz RC Oscillator							
Param. No.	Symbol	Characteristics	Min.	Typ.	Max.	Units	Conditions
OSC48M_1	FOSC48M	OSC48M Oscillator Frequency	46.6	-	49.5	MHz	-40 to 85C

2.3 I/O Pin Electrical Characteristics

The internal pull-up and pull-down resistor has been reduced. The TRISE and TFALL times have been updated to reflect capacitive loading for 30 pF.

43-11 I/O Pin Electrical Specifications							
Param. No.	Symbol	Characteristics	Min.	Typ.	Max.	Units	Conditions
DI_15	RPDWN	Internal Pull-Dwn	-	-	52	kΩ	2.7V ≤ VDD/VDDIO ≤ 5.5V
DI_17	RPUP	Internal Pull-Up	-	-	52	kΩ	
DI_25	TRISE	I/O pin Rise Time (Standard pins, Low Drv Strength, DRVSTR = 0)	-	-	22.5	ns	VDDIO(min), CLOAD = 30 pF (MAX)
		I/O pin Rise Time (High Sink, Low Drv Strength, DRVSTR = 0)	-	-	16		
		I/O pin Rise Time (Standard pins, High Drv Strength, DRVSTR = 1)	-	-	13.1		
		I/O pin Rise Time (High Sink, High Drv Strength, DRVSTR = 1)	-	-	10.1		
DI_27	TFALL	I/O pin Rise Time (Standard pins, Low Drv Strength, DRVSTR = 0)	-	-	22.4	ns	
		I/O pin Rise Time (High Sink, Low Drv Strength, DRVSTR = 0)	-	-	18.1		
		I/O pin Rise Time (Standard pins, High Drv Strength, DRVSTR = 1)	-	-	12.9		
		I/O pin Rise Time (High Sink, High Drv Strength, DRVSTR = 1)	-	-	11.3		

2.4 SERCOM SPI Host/Client

Host and Client SCK Frequency have been reduced.

43-31 SPIx Module Host Mode Electrical Specifications							
Param. No.	Symbol	Characteristics	Min.	Typ.	Max.	Units	Conditions
MSP_1	FCK	SCK Frequency	-	-	3.7	MHz	VDDIO = 3.3V, CLOAD=30pF(MIN)
			-	-	3.7		VDDIO = 5.0V, CLOAD=30pF(MIN)

43-32 SPIx Module Client Mode Electrical Specifications							
Param. No.	Symbol	Characteristics	Min.	Typ.	Max.	Units	Conditions
SSP_1	FCK	SCK Frequency	-	-	3.7	MHz	VDDIO = 3.3V, CLOAD=30pF(MIN)
			-	-	3.7		VDDIO = 5.0V, CLOAD=30pF(MIN)

3. Appendix A: Revision History

Revision E - 06/2021

This revision contains numerous typographical updates throughout the document along with the updates listed here.

The I²C, SPI and I²S standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively.

- The following Errata were added in this revision:
 - [1.2.4 RXNACK](#)
 - [PDEC: STATUS 1.5.1](#)
 - [PDEC: STATUS 1.5.2](#)
 - [PDEC: HALL MODE 1.5.3](#)
 - [PDEC: HALL MODE 1.5.4](#)
- The following Data Sheet Clarifications were added:
 - [Absolute Maximum Ratings](#)
 - [Internal 48MHz RC Oscillator \(OSC48M\)](#)
 - [I/O Pin Electrical Characteristics](#)
 - [SERCOM SPI Host/Client](#)

Revision D - 04/2021

This revision contains numerous typographical updates throughout the document along with the updates listed here.

The I²C, SPI and I²S standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively.

- The following Errata were added in this revision:
 - [AC: INTREF 1.4.1](#)
 - [OSCCTRL: FDPLL ONDEMAND 1.3.2](#)

Revision C - 02/2021

The following update was performed for this revision:

- Added Silicon Issue [OSCCTRL FDPLL Unlock 1.3.1](#)

Revision B - 11/2020

The following updates were performed for this revision:

- Updated Silicon Die Revision from A0 to A1
- Updated the errata numbering schema

Revision A - 07/2020

This is the initial released version of this document.

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Legal Notice

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2021, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-8344-1

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Tel: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p>	<p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p>	<p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p>	<p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Druen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p>