



Product Change Notification / SYST-13BGTQ047

Date:

14-Oct-2021

Product Category:

Sensor Interface

PCN Type:

Document Change

Notification Subject:

ERRATA - MCP9600 Rev. A Silicon Errata and Data Sheet Clarification Document Revision

Affected CPNs:

[SYST-13BGTQ047_Affected_CPN_10142021.pdf](#)

[SYST-13BGTQ047_Affected_CPN_10142021.csv](#)

Notification Text:

SYST-13BGTQ047

Microchip has released a new Product Documents for the MCP9600 Rev. A Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [MCP9600 Rev. A Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: Updated Module 7. date code for the MCP9600/L00/RL00.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 14 Oct 2021

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

[MCP9600 Rev. A Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

MCP9600-E/MX

MCP9600-E/MX-1

MCP9600-I/MX

MCP9600T-E/MX

MCP9600T-E/MX-1

MCP9600T-I/MX

MCP9601-E/MX

MCP9601T-E/MX

Silicon Errata and Data Sheet Clarification

The MCP9600/01 parts you have received conform functionally to the Device Data Sheet (DS20005426), except for the anomalies described below.

All of the issues listed here will be addressed in future revisions of the MCP9600/01 silicon.

Contact Microchip for the latest silicon fix.

1. Module: T_{H_ACY} , or the T_H Hot-Junction Temperature Accuracy - MCP9600 Only

The Hot-Junction (T_H) Temperature Accuracy T_{H_ACY} of the MCP9600 devices before Date Code 1723 or Device ID/Revision value of 0x4011, may not meet the specified accuracy in the data sheet, starting from revision C data sheet (DS20005426C) to the latest data sheet. This issue affects the T_H temperature register only.

The Cold-Junction (T_C) and the Junctions Delta (T_{Δ}) Temperature registers are not affected by this issue. These registers meet the accuracy performance as specified in the data sheet.

Work around

Convert the T_C and the T_{Δ} temperature data from the units of Degree Celsius ($^{\circ}C$) to millivolt (mV) using the NIST ITS-90 conversion look-up table or polynomial equation. Then sum the two voltages, and convert the summed value from millivolt to Degree Celsius using the NIST ITS-90 conversion table or polynomial equation.

Date Codes that pertain to this issue:

All production devices before Date Code 1723 and with Device ID/Revision register value of 0x4011 are affected, as shown in [Table 1](#).

Fix

Devices with Date Code of 1723 or later are not affected. These devices have a Device ID/Revision value of 0x4012.

2. Module: Intermittent I²C Read Command Clock Stretching Failure - MCP9600 Only

During I²C Sequential Read communication for two or more bytes, the MCP9600/L00/RL00 may intermittently fail to Clock Stretch, $t_{STRETCH}$, as described in the data sheet, for bus frequencies greater than 85 kHz (typical). When this failure occurs, the MCP9600/L00/RL00 continues to output the previously transmitted data. For example, when reading the two byte T_H temperature register, if the device fails to clock stretch for the Least Significant Byte, then the device will output the Most Significant Byte.

Work around

Since this issue is intermittent, repeat the Sequential Read instruction until the second byte read is different from the Most Significant Byte.

Date Codes that pertain to this issue:

All production devices before Data Code 1845 and with Device ID/Revision register value of 0x4012 or lower are affected, as shown in [Table 1](#).

Fix

Devices with Date Code of 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

3. Module: Input Range bit (Bit 4 of the Status Register) - MCP9600 Only

When the MCP9600/L00/RL00's Bit 4 of the Status Register, Input Range bit, is set to '1', the T_H , T_C and T_Δ registers are not updated as indicated in the Rev E data sheet bit description (DS20005426E). This characteristic may result in what appears to be unpredictable temperature data, if the temperature register is not updated when the thermocouple temperature is near the upper or the lower temperatures limits for the specified thermocouple range. For example, if the thermocouple EMF is within the specified range, but the sum with the Cold Junction EMF exceeds the specified thermocouple range, then the Input Range bit is set to '1' and the temperature registers are not updated.

Work around

None.

Date Codes that pertain to this issue:

All production devices before Date Code 1845 and with Device ID/Revision register value of 0x4012 or lower are affected, as shown in [Table 1](#).

Fix

Devices with Date Code 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

Devices with the Device ID/Revision value of 0x4013 update the temperature registers as follows, when the Bit 4 of the Status Register, Input Range bit, is set to '1':

- If the thermocouple EMF exceeds the specified range, then T_H and T_Δ Registers are not updated, but T_C Register is updated with a valid temperature data at the specified interval, or t_{CONV} .
- If the thermocouple EMF is within the specified range, but the sum with the Cold-Junction EMF exceeds the specified range, then T_H Register is not updated, but T_Δ and T_C Registers are updated with valid temperature data at the specified interval, or t_{CONV} . The value of T_Δ and T_C Registers can be used to calculate valid Hot-Junction temperature data using the NIST ITS-90 conversion look-up table or polynomial equation.

4. Module: Outputs Extra 0x00 data during Sequential Read - MCP9600 Only

When the MCP9600/L00/RL00 Registers are Sequentially Read, the device outputs 0x00 between the Least Significant Byte of the Alert 4 Register and the Most Significant Byte of the Device ID/Revision Register values.

Work around

Ignore the byte.

Date Codes that pertain to this issue:

All production devices before Date Code 1845 and with Device ID/Revision register value of 0x4012 are affected, as shown in [Table 1](#).

Fix

Devices with Date Code 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

5. Module: Open Circuit Detection - MCP9601 Only

The MCP9601/L01/RL01 Open Circuit detection Alert feature may not correctly assert. And, if it asserts, then OC Alert output may not remain asserted while the Thermocouple is disconnected; OC Alert output may chatter. This characteristic is primarily due to the minor shift in characteristics of the thermocouple inputs Common-mode typical impedance.

For proper operation, the three external resistors in Figure 1-1 of the data sheet need to be changed from the recommended values in data sheet Revision F (DS20005426F). The following specifications will be changed from the values specified in Revision F of the data sheet V_{SiOC} , V_{SiNOR} , and R_A , R_B , and R_C from Figure 1-1.

Work around

None.

Date Codes that pertain to this issue:

All production devices before Date Code 2107 and with Device ID/Revision register value of 0x4110 are affected, as shown in [Table 2](#).

Fix

Devices with Date Code 2107 or later are not affected. These devices have a Device ID/Revision value of 0x4111.

6. Module: Unimplemented byte on Device Configuration Register

The MCP960X/L0X/RL0X Configuration Register is 8 bits wide followed by an unimplemented byte which outputs 0x00 during sequential Read command. This byte is shown in Table 5-1 "Summary of Registers and Bit Assignment" of Revision G of the data sheet.

Work around

Ignore the byte.

Date Codes that pertain to this issue:

All production devices.

Fix

None.

7. Module: Receive Protocol or Repeat Read Command

On some devices of the MCP960X/L0X/RL0X, the Repeat Read command or the receive protocol may not function properly. During Repeat Read command, the device is expected to retain the previously set register pointer and continue to output data from the selected register. However, on some devices, the device may continue to output data from the following register, just as a Sequential Read command.

Work around

Always set the register pointer prior to each Read Command as shown on Figure 4-3 of the data sheet.

Date Codes that pertain to this issue:

- MCP9600/L00/RL00: All production devices before Date Code 2121 and with Device ID/Revision register value of 0x4113 are affected, as shown on [Table 1](#).

- MCP9601/L01/RL01: All production devices before Date Code 2107 and with Device ID/Revision register value of 0x4110 are affected, as shown on [Table 2](#).

MCP9600/01

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet:

1. The MCP9600/L00/RL00 Input Range Bit of the Status Register (Bit 4) will be clarified (from current description, Revision E Data Sheet DS20005426E) on the next data sheet revision, as described in [Module 3](#).
2. The MCP9601/L01/RL01 Open Circuit detection threshold V_{SiOC} and V_{SiNOR} will be clarified (from current description, Revision F Data Sheet DS20005426F) on the next data sheet revision, as described in [Module 5](#).

TABLE 1: SILICON ISSUE SUMMARY MCP9600/L00/RL00

Module	Feature	Issue Summary	Affected Device ID/Revision ⁽¹⁾				Fixed Date Code
			0x4011	0x4012	0x4013	0x4014	
1	T _H _ACY	This parameter may not meet data specification starting from Rev C data sheet DS20005426C (MCP9600 only)	X	—	—	—	1723
2	t _{STRETCH}	This parameter may not meet data specification (MCP9600/L00/RL00)	X	X	—	—	1845
3	Input Range	Device Characteristics changed from the data sheet description (MCP9600/L00/RL00)	X	X	—	—	1845
4	Extra Byte	Correction to the Device Characteristics (MCP9600/L00/RL00)	X	X	—	—	1845
6	I ² C Read	Unimplemented byte on Device Configuration Register (MCP9600/L00/RL00) Affected	X	X	X	X	—
7	Receive Protocol	The Repeat Read command or the Receive Protocol may not function properly (MCP9600/L00/RL00) Affected.	X	X	X	—	2121

Note 1: The Device ID/Revision Register is found in the user register pointer 0x20.

TABLE 2: SILICON ISSUE SUMMARY MCP9601/L01/RL01

Module	Feature	Issue Summary	Affected Device ID/Revision ⁽¹⁾		Fixed Date Code
			0x4110	0x4111	
5	Open Circuit Detection	Open Circuit detection mechanism may not correctly assert (MCP9601/L01/RL01)	X	—	2107
6	I ² C Read	Unimplemented byte on Device Configuration Register (MCP9601/L01/RL01) Affected	X	X	—
7	Receive Protocol	The Repeat Read command or the Receive Protocol may not function properly (MCP9601/L01/RL01).	X	—	2107

Note 1: The Device ID/Revision Register is found in the user register pointer 0x20.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev. E Document (10/2021)

Updated [Module 7](#), date code for the MCP9600/L00/RL00.

Rev. D Document (04/2021)

- Added Errata [Module 5](#).
- Added Errata [Module 6](#).
- Added Errata [Module 7](#).
- Updated [Table 1](#) and [Table 2](#).
- Updated minor typographic corrections throughout the document.

Rev. C Document (5/2019)

- Added Errata Modules 2, 3 and 4.

Rev. B Document (9/2017)

- Added Fix regarding the devices with Date Code of 1723.
- Added [Note 1](#) to [Table 1](#).

Rev. A Document (5/2017)

- Initial release of this document.

MCP9600/01

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGL00, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2017-2021, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-8855-2

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4485-5910
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820