



Product Change Notification / SYST-05 KGNS389

Date:

20-Jan-2022

Product Category:

8-bit Microcontrollers

PCN Type:

Document Change

Notification Subject:

ERRATA - ATtiny1624/1626/1627 Silicon Errata and Data Sheet Clarification

Affected CPNs:

[SYST-05KGNS389_Affected_CPN_01202022.pdf](#)

[SYST-05KGNS389_Affected_CPN_01202022.csv](#)

Notification Text:

SYST-05KGNS389

Microchip has released a new Product Documents for the ATtiny1624/1626/1627 Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [ATtiny1624/ 1626/ 1627 Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: • Added erratum:

- ADC: 2.3.1. ADC Stays Active in Sleep Modes for Low Latency Mode and Free Running Mode

• Updated erratum:

- Device: 2.2.1. IDD Power-Down Current Consumption

• Updated data sheet clarification:

- Removed Fuses - Correct Factory Default Value for Reserved Fuse Bits is '1'

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 20 January 2022

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

[ATtiny1624/ 1626/ 1627 Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

ATTINY1624-SSF
ATTINY1624-XF
ATTINY1626-XF
ATTINY1626-SF
ATTINY1626-MF
ATTINY1627-MF
ATTINY1624-SSU
ATTINY1624-XU
ATTINY1626-XU
ATTINY1626-SU
ATTINY1626-MU
ATTINY1627-MU
ATTINY1624-SSUR
ATTINY1624-XUR
ATTINY1626-XUR
ATTINY1626-SUR
ATTINY1626-MUR
ATTINY1627-MUR
ATTINY1624-SSFR
ATTINY1624-XFR
ATTINY1626-XFR
ATTINY1626-SFR
ATTINY1626-MFR
ATTINY1627-MFR



ATtiny1624/1626/1627

Silicon Errata and Data Sheet Clarifications

The ATtiny1624/1626/1627 devices you have received conform functionally to the current device data sheet (www.microchip.com/DS40002234), except for the anomalies described in this document. The errata described in this document will likely be addressed in future revisions of the ATtiny1624/1626/1627 devices.

Notes:

- This document summarizes all the silicon errata issues from all the silicon revisions, previous as well as current
- Refer to the Device/Revision ID section in the current device data sheet (www.microchip.com/DS40002234) for more detailed information on Device Identification and Revision IDs for your specific device, or contact your local Microchip sales office for assistance

1. Silicon Issue Summary

Legend

- Erratum is not applicable.
- X Erratum is applicable.

Peripheral	Short Description	Valid for Silicon Revision
		Rev. E ⁽¹⁾
Device	2.2.1. IDD Power-Down Current Consumption	X
ADC	2.3.1. ADC Stays Active in Sleep Modes for Low Latency Mode and Free Running Mode	X
CCL	2.4.1. The CCL Must be Disabled to Change the Configuration of a Single LUT	X
TCA	2.5.1. Restart Will Reset Counter Direction in NORMAL and FRQ Mode	X
TCB	2.6.1. CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode	X
USART	2.7.1. Open-Drain Mode Does not Work When TXD Is Configured as Output	X
	2.7.2. Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode	X

Note:

1. This revision is the initial release of the silicon.

2. Silicon Errata Issues

2.1 Errata Details

- Erratum is not applicable.
- X Erratum is applicable.

2.2 Device

2.2.1 IDD Power-Down Current Consumption

For material with date code 2045 (manufactured in the year 2020, week 45) or older, the IDD power-down leakage can exceed the targeted maximum value of 1.5 μ A.

Work Around

None.

Affected Silicon Revisions

Rev. E
X

2.3 ADC - Analog-to-Digital Converter

2.3.1 ADC Stays Active in Sleep Modes for Low Latency Mode and Free Running Mode

If the Low Latency bit (LOWLAT in ADCn.CTRLA) is '1', the ADC stays active when the device enters Power-Down or Standby sleep modes. If the Free-Running bit (FREERUN in ADCn.CTRLF) is '1', the ADC continues to run in Standby sleep mode even if the Run in Standby bit (RUNSTDBY in ADCn.CTRLA) is '0'. In both cases, the interrupts will not trigger when the device enters Power-Down or Standby sleep mode.

Work Around

None.

Affected Silicon Revisions

Rev. E
X

2.4 CCL - Configurable Custom Logic

2.4.1 The CCL Must be Disabled to Change the Configuration of a Single LUT

To reconfigure an LUT, the CCL peripheral must first be disabled (write ENABLE in CCL.CTRLA to '0'). Writing ENABLE to '0' will disable all the LUTs, and affects the LUTs not under reconfiguration.

Work Around

None

Affected Silicon Revisions

Rev. E
X

2.5 TCA - 16-Bit Timer/Counter Type A

2.5.1 Restart Will Reset Counter Direction in NORMAL and FRQ Mode

When the TCA is configured to a NORMAL or FRQ mode (WGMode in TCAn.CTRLB is '0x0' or '0x1'), a RESTART command or Restart event will reset the count direction to default. The default is counting upwards.

Work Around

None.

Affected Silicon Revisions

Rev. E
X

2.6 TCB - 16-Bit Timer/Counter Type B

2.6.1 CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode

When the TCB is operating in 8-bit PWM mode (CNTMODE in TCBn.CTRLB is '0x7'), the low and high bytes for the CNT and CCMP registers operate as 16-bit registers for read and write. They cannot be read or written independently.

Work Around

Use 16-bit register access. Refer to the data sheet for further information.

Affected Silicon Revisions

Rev. E
X

2.7 USART - Universal Synchronous and Asynchronous Receiver and Transmitter

2.7.1 Open-Drain Mode Does not Work When TXD Is Configured as Output

When configured as an output, the USART TXD pin can drive the pin high regardless of whether the Open-Drain mode is enabled or not.

Work Around

Configure the TXD pin as an input by writing the corresponding bit in PORTx.DIR to '0' when using Open-Drain mode.

Affected Silicon Revisions

Rev. E

X

2.7.2 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode

The Start-of-Frame Detection feature enables the USART to wake up from Standby sleep mode upon data reception. The Start-of-Frame Detector can unintentionally be triggered when the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register is set, and the device is in Active mode. If the Receive Data (RXDATA) registers are read while receiving new data, the Receive Complete Interrupt Flag (RXCIF) in the USARTn.STATUS register is cleared. This triggers the Start-of-Frame Detector and falsely detects the following falling edge as a start bit. When the Start-of-Frame Detector detects a start condition, the frame reception is restarted, resulting in corrupt received data. Note that the USART Receive Start Interrupt Flag (RXSIF) always is '0' when in Active mode. No interrupt will be triggered.

Work Around

Disable Start-of-Frame Detection by writing '0' to the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register when the device is in Active mode. Re-enable it by writing the bit to '1' before transitioning to Standby sleep mode. This work around depends on a protocol preventing a new incoming frame when re-enabling Start-of-Frame Detection. Re-enabling Start-of-Frame Detection, while a new frame is already incoming, will result in corrupted received data.

Affected Silicon Revisions

Rev. E

X

3. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (www.microchip.com/DS40002234).

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

3.1 None

There are no known data sheet clarifications as of this publication date.

4. Document Revision History

Note: The document revision is independent of the silicon revision.

4.1 Revision History

Doc. Rev.	Date	Comments
D	01/2022	<ul style="list-style-type: none"> Added erratum: <ul style="list-style-type: none"> ADC: 2.3.1. ADC Stays Active in Sleep Modes for Low Latency Mode and Free Running Mode Updated erratum: <ul style="list-style-type: none"> Device: 2.2.1. IDD Power-Down Current Consumption Updated data sheet clarification: <ul style="list-style-type: none"> Removed <i>Fuses - Correct Factory Default Value for Reserved Fuse Bits is '1'</i>
C	06/2021	Updated errata: <ul style="list-style-type: none"> Device: 2.2.1. IDD Power-Down Current Consumption USART: 2.7.2. Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode
B	12/2020	<ul style="list-style-type: none"> Silicon revision D not released to production. Silicon revision E is the initial release: <ul style="list-style-type: none"> Removed silicon revision D from <i>Silicon Issues Summary</i> and all <i>Affected Versions</i> tables Removed all errata only applicable to silicon revision D Added errata: <ul style="list-style-type: none"> Device: <i>IDD Power-Down Current Consumption</i> CCL: <i>The CCL Must be Disabled to Change the Configuration of a Single LUT</i> TCA: <i>Restart Will Reset Counter Direction in NORMAL and FRQ Mode</i> TCB: <i>CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode</i> USART: <i>Open-Drain Mode Does Not Work When TXD is Configured as Output</i> Added data sheet clarification: <ul style="list-style-type: none"> Fuses: <i>Correct Factory Default Value for Reserved Fuse Bits is '1'</i>
A	07/2020	Initial document release

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable". Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet- Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, NVM Express, NVMe, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, Symmcom, and Trusted Time are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2022, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-5224-9543-7

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com	Australia - Sydney Tel: 61-2-9868-6733 China - Beijing Tel: 86-10-8569-7000 China - Chengdu Tel: 86-28-8665-5511 China - Chongqing Tel: 86-23-8980-9588 China - Dongguan Tel: 86-769-8702-9880 China - Guangzhou Tel: 86-20-8755-8029 China - Hangzhou Tel: 86-571-8792-8115 China - Hong Kong SAR Tel: 852-2943-5100 China - Nanjing Tel: 86-25-8473-2460 China - Qingdao Tel: 86-532-8502-7355 China - Shanghai Tel: 86-21-3326-8000 China - Shenyang Tel: 86-24-2334-2829 China - Shenzhen Tel: 86-755-8864-2200 China - Suzhou Tel: 86-186-6233-1526 China - Wuhan Tel: 86-27-5980-5300 China - Xian Tel: 86-29-8833-7252 China - Xiamen Tel: 86-592-2388138 China - Zhuhai Tel: 86-756-3210040	India - Bangalore Tel: 91-80-3090-4444 India - New Delhi Tel: 91-11-4160-8631 India - Pune Tel: 91-20-4121-0141 Japan - Osaka Tel: 81-6-6152-7160 Japan - Tokyo Tel: 81-3-6880-3770 Korea - Daegu Tel: 82-53-744-4301 Korea - Seoul Tel: 82-2-554-7200 Malaysia - Kuala Lumpur Tel: 60-3-7651-7906 Malaysia - Penang Tel: 60-4-227-8870 Philippines - Manila Tel: 63-2-634-9065 Singapore Tel: 65-6334-8870 Taiwan - Hsin Chu Tel: 886-3-577-8366 Taiwan - Kaohsiung Tel: 886-7-213-7830 Taiwan - Taipei Tel: 886-2-2508-8600 Thailand - Bangkok Tel: 66-2-694-1351 Vietnam - Ho Chi Minh Tel: 84-28-5448-2100	Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393 Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829 Finland - Espoo Tel: 358-9-4520-820 France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 Germany - Garching Tel: 49-8931-9700 Germany - Haan Tel: 49-2129-3766400 Germany - Heilbronn Tel: 49-7131-72400 Germany - Karlsruhe Tel: 49-721-625370 Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44 Germany - Rosenheim Tel: 49-8031-354-560 Israel - Ra'anana Tel: 972-9-744-7705 Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781 Italy - Padova Tel: 39-049-7625286 Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340 Norway - Trondheim Tel: 47-72884388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820