



Product Change Notification / SYST-22PIGS506

Date:

23-Aug-2022

Product Category:

32-bit Microcontrollers

PCN Type:

Document Change

Notification Subject:

ERRATA - PIC32MK GPK/MCM Family Silicon Errata

Affected CPNs:

[SYST-22PIGS506_Affected_CPN_08232022.pdf](#)

[SYST-22PIGS506_Affected_CPN_08232022.csv](#)

Notification Text:

SYST-22PIGS506

Microchip has released a new Errata for the PIC32MK GPK/MCM Family Silicon Errata of devices. If you are using one of these devices please read the document located at [PIC32MK GPK/MCM Family Silicon Errata](#).

Notification Status: Final

Description of Change:

The SPI, I2S, and I2C standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively. These terms have been updated throughout this document for this revision.

The following silicon errata issues were added: • FLASH: 2.4.1 RTSP

Impacts to Data Sheet: None

Change Implementation Status: Complete

Date Document Changes Effective: 23 Aug 2022

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

[PIC32MK GPK/MCM Family Silicon Errata](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC32MK1024MCM064-E/MR
PIC32MK0512MCM064-E/MR
PIC32MK1024GPK064-E/MR
PIC32MK0512GPK064-E/MR
PIC32MK1024MCM064-E/PT
PIC32MK0512MCM064-E/PT
PIC32MK1024GPK064-E/PT
PIC32MK0512GPK064-E/PT
PIC32MK1024MCM100-E/PT
PIC32MK0512MCM100-E/PT
PIC32MK1024GPK100-E/PT
PIC32MK0512GPK100-E/PT
PIC32MK1024MCM064-I/MR
PIC32MK0512MCM064-I/MR
PIC32MK1024GPK064-I/MR
PIC32MK0512GPK064-I/MR
PIC32MK1024MCM064-I/PT
PIC32MK0512MCM064-I/PT
PIC32MK1024GPK064-I/PT
PIC32MK0512GPK064-I/PT
PIC32MK1024MCM100-I/PT
PIC32MK0512MCM100-I/PT
PIC32MK1024GPK100-I/PT
PIC32MK0512GPK100-I/PT
PIC32MK1024MCM064T-I/MR
PIC32MK0512MCM064T-I/MR
PIC32MK1024GPK064T-I/MR
PIC32MK0512GPK064T-I/MR
PIC32MK1024MCM064T-I/PT
PIC32MK0512MCM064T-I/PT
PIC32MK1024GPK064T-I/PT
PIC32MK0512GPK064T-I/PT
PIC32MK1024MCM100T-I/PT
PIC32MK0512MCM100T-I/PT
PIC32MK1024GPK100T-I/PT
PIC32MK0512GPK100T-I/PT
PIC32MK1024MCM064T-E/MR
PIC32MK0512MCM064T-E/MR
PIC32MK1024GPK064T-E/MR
PIC32MK0512GPK064T-E/MR
PIC32MK1024MCM064T-E/PT
PIC32MK0512MCM064T-E/PT
PIC32MK1024GPK064T-E/PT
PIC32MK0512GPK064T-E/PT
PIC32MK1024MCM100T-E/PT
PIC32MK0512MCM100T-E/PT

PIC32MK1024GPK100T-E/PT

PIC32MK0512GPK100T-E/PT



PIC32MK GPK/MCM Family

PIC32MK General Purpose and Motor Control (GPK/MCM) with CAN FD Family Silicon Errata and Data Sheet Clarifications

PIC32MK GPK/MCM with CAN FD Family Errata

The PIC32MK family of devices that you have received conform functionally to the current Device Data Sheet (DS60001519E), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. PIC32MK Family Silicon Device Identification. The silicon issues are summarized in the Table of Contents following this section.

The errata described in this document will be addressed in future revisions of the PIC32MK family silicon.

Note:

This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Table 1. PIC32MK Family Silicon Device Identification

Devices	Device ID (DEVID[27:0])	Silicon Revision ID (DEVID[31:28])	
		B2	B3
PIC32MK1024MCM100	0x8B01053	0x3	0x3
PIC32MK1024MCM064	0x8B02053		
PIC32MK0512MCM100	0x8B04053		
PIC32MK0512MCM064	0x8B05053		
PIC32MK1024GPK100	0x8B0D053		
PIC32MK1024GPK064	0x8B0E053		
PIC32MK0512GPK100	0x8B10053		
PIC32MK0512GPK064	0x8B11053		

Data Sheet clarifications and corrections (if applicable) are located in the section [Data Sheet Clarifications](#), following the discussion of silicon issues.

Table of Contents

PIC32MK GPK/MCM with CAN FD Family Errata.....	1
1. Silicon Errata Summary.....	3
2. Silicon Errata Issues.....	4
2.1. Oscillator.....	4
2.2. USB.....	4
2.3. ADC.....	5
2.4. I ² C.....	6
2.5. FLASH.....	6
3. Data Sheet Clarifications.....	7
4. Revision History.....	8
The Microchip Website.....	9
Product Change Notification Service.....	9
Customer Support.....	9
Microchip Devices Code Protection Feature.....	9
Legal Notice.....	9
Trademarks.....	10
Quality Management System.....	10
Worldwide Sales and Service.....	11

PIC32MK GPK/MCM Family

Silicon Errata Summary

1. Silicon Errata Summary

Table 1-1. Errata Summary

Module	Feature	Item #	Issue Summary	Affected Revisions	
				B2	B3
Oscillator	Hardware Clock Source Selection	2.1.1	Clock source selection in hardware, that is, using the Fuse Configuration bits (FNOSC<2:0> bits (DEVCFG1 <2:0>)) does not work.	X	
USB	Low-speed mode	2.2.1	The USB operation in Low-Speed mode is not supported.	X	
USB	VBUS pin	2.2.2	The VBUS pin is not 5V tolerant.	X	
USB	VBUS	2.2.3	B-Device Session End threshold does not meet USB specification.	X	
ADC	Scan Mode	2.3.1	Shared ADC7 has high Offset and Gain Error in Scan mode.	X	
I ² C	Speed	2.4.1	I ² C Host module does not meet low period of the SCL clock (t _{LOW}) parameter from I ² C specification for clock frequency >= 400 kHz.	X	
I ² C	Client	2.4.2	The 7-bit address that matches the 10-bit upper address value (111_10xx) is not accepted regardless of the STRICT bit setting.	X	
FLASH	RTSP	2.5.1	RTSP of Configuration Words is not functional.	X	X

2. Silicon Errata Issues

The following errata issues apply to the PIC32MK GPK/MCM family of devices.

Notes:

- An 'X' indicates the issue is present in this revision of silicon.
- Cells with a dash ('-') indicate that this silicon revision does not exist for this issue.
- Blank cells indicate an issue has been corrected or does not exist in this revision of silicon.

2.1 Oscillator

2.1.1 Hardware Clock Source Selection

Clock source selection in hardware, that is, using the Fuse Configuration bits (FNOSC<2:0> bits (DEVCFG1 <2:0>)) or two speed start up IESO bit (DEVCFG1<7>) may not work, and the clock source would default to FRC.

Workaround:

Follow these steps to switch to desired clock source in software:

1. Ensure Clock Switching is enabled by setting the fuse configuration bits:

```
- #pragma config FCKSM = CSECME //(enables software
    clock switch and fail safe clock monitor)
```

Or

```
- #pragma config FCKSM = CSECMD //(enables software clock switch
    but disables fail safe clock monitor)
```

2. Disable interrupts and DMA prior to the system unlock sequence.
3. Execute the system unlock sequence by writing the key values of 0xAA996655 and 0x556699AA to the SYSKEY register in two back-to-back Assembly or 'C' instructions.
4. Write the new oscillator source value to the NOSC <2:0> control bits.
5. Set the OSWEN bit in the OSCCON<0> register to initiate the clock switch.
6. Write a non-key value such as, 0x33333333 to the SYSKEY register to perform a lock. Continue to execute code that is not clock-sensitive (optional).
7. Check if the OSWEN bit is '0'. If it is, the switch was successful. Loop until the bit is '0'.
8. Re-enable interrupts and DMA.

Affected Revisions:

B2	B3						
X							

2.2 USB

2.2.1 Low-Speed Mode

The USB operation in Low-Speed mode is not supported.

Workaround:

None.

Affected Revisions:


B2	B3						
X							

2.2.2 VBUS pin

The VBUS pin is not 5V tolerant.

Workaround:

Connect an external voltage divider as shown in the following figure:

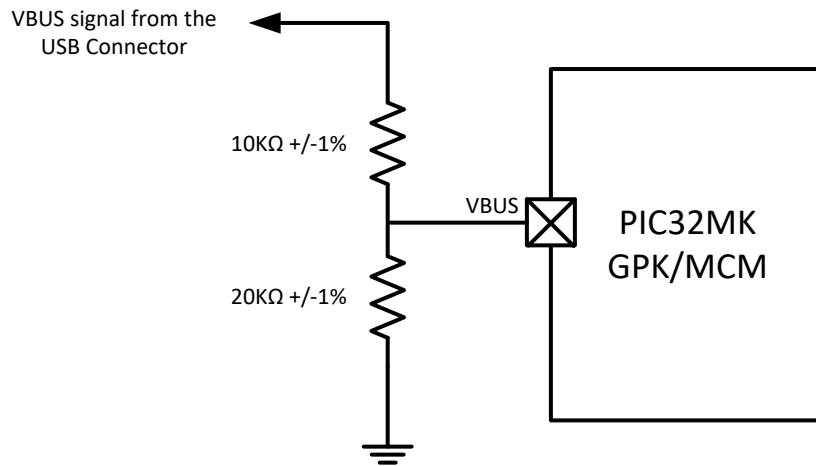

Affected Revisions:

B2	B3						
X							

2.2.3 VBUS

The B-Device Session End threshold indicated by SESEND (UxOTGSTAT<2>) does not meet USB specification of being set at $VBUS < 0.8V$ (maximum); instead, it is set at $VBUS < 1.05V$ (maximum).

Workaround:

None.

Affected Revisions:

B2	B3						
X							

2.3 ADC

2.3.1 Scan Mode

Shared ADC7 has high offset and gain error up to 38 LSB in ADC7 Scan mode, as defined in the ADCCSS1/ADCCSS2 registers.

Workaround:

Increase the user-defined (SAMC<9:0> bits (ADCCON2<25:16>)) sample time register value by $4 T_{AD}$. This will reduce the ADC7 throughput that the user must consider, but it will reduce the gain and offset to less than 4 LSB in 12-bit mode.

Affected Revisions:

B2	B3						
X							

2.4 I²C

2.4.1 Speed

The I²C Host module does not meet low period of the SCL clock (t_{LOW}) parameter from I²C specification for clock frequency ≥ 400 kHz.

Workaround:

None.

Affected Revisions:

B2	B3						
X							

2.4.2 Client

The 7-bit address that matches the 10-bit upper address value (111_10xx) is not accepted regardless of the STRICT bit setting.

Workaround:

None.

Affected Revisions:

B2	B3						
X							

2.5 FLASH

2.5.1 RTSP

Run Time Self Programming (RTSP) of Configuration Words is not functional.

Workaround:

None.

Affected Revisions:

B2	B3						
X	X						

3. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the device data sheet (DS60001519E), and are showed in **BOLD** type.

There are currently no Data Sheet clarifications to report.

4. Revision History

Revision B - August 2022

The SPI, I²S, and I²C standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively. These terms have been updated throughout this document for this revision.

The following silicon errata issues were added:

- [FLASH: 2.4.1 RTSP](#)

Revision A - June 2020

This is the initial released version of this document.

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Legal Notice

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with

your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQL, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-6683-1117-2

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Tel: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p>	<p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p>	<p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p>	<p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4450-2828 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p>