

### **Product Change Notification / SYST-22SBRX397**

Date:

24-Nov-2022

### **Product Category:**

16-Bit - Microcontrollers and Digital Signal Controllers

## **PCN Type:**

Document Change

### **Notification Subject:**

ERRATA - PIC24FG128GC010 Family Silicon Errata and Data Sheet Clarification

### **Affected CPNs:**

SYST-22SBRX397\_Affected\_CPN\_11242022.pdf SYST-22SBRX397\_Affected\_CPN\_11242022.csv

### **Notification Text:**

SYST-22SBRX397

Microchip has released a new Errata for the PIC24FG128GC010 Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at PIC24FG128GC010 Family Silicon Errata and Data Sheet Clarification.

**Notification Status: Final** 

**Description of Change:** Added silicon errata issue 8 (CTMU).

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 24 Nov 2022

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:
PIC24FG128GC010 Family Silicon Errata and Data Sheet Clarification
Disease contact your local Microschip color office with questions or concerns regarding this potification
Please contact your local Microchip sales office with questions or concerns regarding this notification.
Terms and Conditions:
If you wish to <u>receive Microchip PCNs via email</u> please register for our PCN email service at our <u>PCN</u> home page select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the <u>PCN FAQ</u> section.
If you wish to <u>change your PCN profile</u> , <u>including opt out</u> , please go to the <u>PCN home page</u> select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

### $SYST-22SBRX397-ERRATA-PIC24FG128GC010\ Family\ Silicon\ Errata\ and\ Data\ Sheet\ Clarification$

### Affected Catalog Part Numbers (CPN)

PIC24FJ128GC010-I/BG

PIC24FJ128GC010-I/PT

PIC24FJ128GC010T-I/BG

PIC24FJ128GC010T-I/PT

PIC24FJ128GC006-I/MR

PIC24FJ128GC006-I/PT

PIC24FJ128GC006T-I/MR

PIC24FJ64GC010-I/BG

PIC24FJ64GC010-I/PT

PIC24FJ64GC010T-I/BG

PIC24FJ64GC006-I/MR

PIC24FJ64GC006-I/PT

PIC24FJ64GC006T-I/PT



# PIC24FJ128GC010 Family Silicon Errata and Data Sheet Clarification

The PIC24FJ128GC010 family devices that you have received conform functionally to the current Device Data Sheet (DS30009312**D**), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the PIC24FJ128GC010 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (B3).

Data Sheet clarifications and corrections start on Page 6, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB<sup>®</sup> IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 3 or PICkit<sup>™</sup> 3:

- Using the appropriate interface, connect the device to the MPLAB ICD 3 programmer/debugger or PICkit 3.
- From the main menu in MPLAB IDE, select <u>Configure>Select Device</u>, and then select the target part number in the dialog box.
- 3. Select the MPLAB hardware tool (*Debugger>Select Tool*).
- Perform a "Connect" operation to the device (<u>Debugger>Connect</u>). Depending on the development tool used, the part number and Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various PIC24FJ128GC010 silicon revisions are shown in Table 1.

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision
		В3
PIC24FJ128GC010	85H	
PIC24FJ128GC006	89H	04H
PIC24FJ64GC010	84H	U4FI
PIC24FJ64GC006	88H	

**Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>
		Number		В3
12-Bit Pipeline A/D	Sample Lists	1.	When multiple sample lists are configured to perform auto-scan, A/D errors may occur.	Х
12-Bit Pipeline A/D	Sample Lists	2.	The A/D may not consistently generate sample list interrupt flag events when the FRC is used to derive the A/D clock.	Х
12-Bit Pipeline A/D	Calibration	3.	The A/D does not hardware self-calibrate correctly when the A/D module is first powered on.	Х
12-Bit Pipeline A/D	Accumulation	4.	The A/D accumulation feature with the ACCIF interrupt generation enabled.	Х
12-Bit Pipeline A/D	Accuracy	5.	Unexpected A/D results under specific conditions.	Х
Output Compare	Accuracy	6.	Very low speed or frequency output compare operations relying on an external timer.	Х
CTMU	Edge Enable	7.	Enabling edges (EDGEN = 1) can generate a glitch.	Х
CTMU	Pulse or Delay Generation	8.	Pulse or Delay Generation mode is not functional.	Х

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

#### Silicon Errata Issues

Note:

This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**B3**).

#### 1. Module: 12-Bit Pipeline A/D

When multiple sample lists are configured to perform auto-scan operations, and are triggered simultaneously (or close enough that the first sample list is still busy when the subsequent one is triggered), unexpected A/D result values may be generated.

#### Work around

If using auto-scan operations, only enable and trigger one sample list at a time.

#### **Affected Silicon Revisions**

В3			
Х			

#### 2. Module: 12-Bit Pipeline A/D

The A/D may not consistently generate sample list-specific interrupt flag events, SLxIF (ADSTATL<3:0>), when the FRC is used to derive the A/D clock (e.g., by setting the ADRC bit (ADCON3<15>)).

#### Work around

Sample list interrupts are generated normally when using the system clock to derive the A/D clock (e.g., ADRC = 0), even if the system clock is derived from the FRC. Alternatively, if the ADRC bit is set, the firmware may still use the top level A/D interrupt, AD1IF (IFS0<13>), as the AD1IF flag event and the A/D result data is still generated normally.

#### **Affected Silicon Revisions**

ВЗ	}			
Х				

#### 3. Module: 12-Bit Pipeline A/D

The A/D does not hardware self-calibrate correctly when the A/D module is first powered on.

#### Work around

In order to reliably initiate a hardware self-calibration of the A/D, the firmware needs to turn on the A/D, wait until ADREADY = 1 and then write '1' to the ADCAL bit to initiate a new calibration operation. The A/D will then perform the self-calibration in the background. Once it is done, it will set the ADREADY bit to '1' and the A/D will be ready to use.

#### **Affected Silicon Revisions**

В3			
Χ			

#### 4. Module: 12-Bit Pipeline A/D

When using the A/D accumulation feature with the ACCIF interrupt generation enabled (ACIE = 1), the ACCIF (ADSTATL<4>) interrupt flag is not set if the accumulation operation was started with a COUNT<7:0> (ACCONL<7:0>) value of '1'.

#### Work around

The ACCIF interrupt works normally for all other accumulation count values (other than '1'). If only one A/D measurement is planned, it is suggested not to use the accumulation feature. Perform a normal A/D measurement instead.

#### **Affected Silicon Revisions**

В3			
Χ			

#### 5. Module: 12-Bit Pipeline A/D

Unexpected A/D result data may occur when the ADC is operated in Single-Ended Input mode and the analog input voltage is within the upper 1/3 of the ADC input voltage range.

#### Work around

A normal result is obtained when operating in Differential Input mode. If the application uses Single-Ended Input mode, a normal result can be obtained if the application simultaneously does all of the following:

- The positive ADC reference voltage is maintained lower than (AVDD 0.5V). This can be implemented either with an external reference or by using the internal BGBUF1 source (e.g., configured for 2.048V or 2.560V).
- The ADC is operated with the REFPUMP bit (ADCON2<1>) = 1.
- The ADC is maintained continuously converting at a high rate (e.g., ≥ 4 Msps). This can be implemented by using a low-priority list with a continuous trigger option to keep the ADC busy. The conversions required by the application should be done by using higher priority lists. The code in Example 1 shows the settings for the low priority list to maintain the high conversion rate.

#### EXAMPLE 1: LOW-PRIORITY LIST CONFIGURATION TO MAINTAIN A HIGH CONVERSION RATE

```
//Configure Sample List 3 (SL3, which has lowest priority) to continuously use all free
//ADC clock cycles by performing dummy conversion operations on an internal channel VREF-.
ADL3CONL = 0;
ADL3CONH = 0;
ADL3CONLbits.SLSIZE = 1-1; //1 channel is scanned.
ADL3CONLbits.SLTSRC = 2; //Trigger is generated every clock when SAMP = 0.
ADTBLx = 124; //124 = VREF-. Replace ADTBLx with real value after allocating SLO-SL2.
ADL3CONLbits.SLEN = 1; //Enable SL3.
ADL3CONLbits.SAMP = 0; //Trigger SL3 on every ADC clock period.
//Use Sample Lists 0-2 for sampling the actual application ADC channel(s) of interest.
//The SLO-SL2 have higher priority than SL3 trigger events, so having SL3 free running
//at speed doesn't decrease the useful ADC bandwidth/sample rate achievable on SLO-SL2.
//Note: Avoid auto-scan when using multiple sample lists (see errata #1).
```

#### **Affected Silicon Revisions**

В3			
Χ			

#### 6. Module: Output Compare

Certain very low-speed or frequency output compare operations, relying on an external timer (e.g.,Timer2), may not work correctly if the external timer is configured for a prescalar setting other than 1:1.

#### Work around

If using output compare operations with an external timer, configure the timer to operate in the 1:1 Prescaler mode.

#### **Affected Silicon Revisions**

В3			
Х			

#### 7. Module: CTMU

Enabling edges (EDGEN = 1) generates a glitch (edge) if the CTEDx pin is set for a falling edge and the level on this pin is low, or if the CTEDx pin is set for a rising edge and the level on this pin is high.

#### Work around

External AND logic can be used for each CTEDx pin to gate these control signals. EDGEN should not be changed (always set to '1').

#### **Affected Silicon Revisions**

В3			
Χ			

#### 8. Module: CTMU

When the CTMU is configured in Pulse or Delay Generation mode with the TGEN bit = 1 (CTMUCON1[12] = 1), the EDG1STAT and EDG2STAT bits (CTMUCON2[9:8]) do not get set. The CTMU current source is always disabled.

#### Work around

None.

#### **Affected Silicon Revisions**

В3			
Х			

#### **Data Sheet Clarifications**

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS30009312**D**):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

#### 1. Module: Electrical Characteristics

In Table 37-28, the test conditions for A/D Accuracy Parameters AD21, AD22, AD23 and AD24 have changed. The Minimum and Maximum values for AD21 (Integral Nonlinearity) are modified. The changes are shown below in bold.

#### TABLE 37-28: 12-BIT PIPELINE A/D MODULE SPECIFICATIONS

AC CHARACTERISTICS				Standard Operating Conditions: Operating temperature			2.0V to 3.6V (unless otherwise stated) -40°C $\leq$ TA $\leq$ +85°C for Industrial		
Param No.	Symbol	Characteristic	Min.	Min. Typ Max.		Units	Conditions		
AD21	INL	Integral Nonlinearity	-9	_	+9	LSb	AVSS = VREFL = 0V, AVDD = 3.3V, VREFH = 2.56V		
AD22	DNL	Differential Nonlinearity	-3	_	+3	LSb	AVSS = VREFL = 0V, AVDD = 3.3V, VREFH = 2.56V		
AD23	GERR	Gain Error	-8	_	+8	LSb	AVSS = VREFL = 0V, AVDD = 3.3V, VREFH = 2.56V		
AD24	EOFF	Offset Error	-12	_	+12	LSb	AVSS = VREFL = 0V, AVDD = 3.3V, VREFH = 2.56V		

#### APPENDIX A: REVISION HISTORY

#### Rev A Document (5/2013)

Initial release of this document.

#### Rev B Document (9/2013)

Added data sheet clarifications 1 (Device Overview), 2-3 (Electrical Characteristics), 4 (CMxCON Register), 5 (DOZE<2:0> and DOZEN Bits), 6 (Decoupling Capacitors) and 7 (DACxCON Register).

#### Rev C Document (4/2014)

Corrects device family to "PIC24FJ128GC010 family", to be consistent with the family name provided on all other literature.

Corrects the module titles for data sheet clarifications 4 though 7, to be consistent with existing practice. The clarifications themselves are unaffected.

Added data sheet clarifications 8 (Power-Saving Features) and 9 (12-Bit High-Speed, Pipeline A/D Converter).

#### Rev D Document (10/2014)

Removes all data sheet clarifications as they were addressed in the new revision of the data sheet.

#### Rev E Document (12/2016)

Updated existing silicon errata issue 5 (12-Bit Pipeline A/D).

#### Rev F Document (4/2017)

Added data sheet clarification 1 (Electrical Characteristics).

#### Rev G Document (11/2022)

Added silicon errata issue 8 (CTMU).

PIC24FJ 126GCU IU FAMILI					
NOTES:					

#### Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not
  mean that we are guaranteeing the product is "unbreakable" Code protection is constantly evolving. Microchip is committed to
  continuously improving the code protection features of our products.

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at <a href="https://www.microchip.com/en-us/support/design-help/client-support-services">https://www.microchip.com/en-us/support/design-help/client-support-services</a>.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

For information regarding Microchip's Quality Management Systems,

#### **Trademarks**

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, KoD, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach. Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2013-2022, Microchip Technology Incorporated and its subsidiaries.

All Rights Reserved.

ISBN: 978-1-6683-1522-4

please visit www.microchip.com/quality



### Worldwide Sales and Service

#### **AMERICAS**

**Corporate Office** 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200

Fax: 480-792-7277 **Technical Support:** 

http://www.microchip.com/ support

Web Address:

www.microchip.com Atlanta

Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455

Austin, TX Tel: 512-257-3370

**Boston** 

Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088

Chicago Itasca, IL

Tel: 630-285-0071 Fax: 630-285-0075

**Dallas** Addison, TX Tel: 972-818-7423 Fax: 972-818-2924

**Detroit** Novi, MI

Tel: 248-848-4000

Houston, TX Tel: 281-894-5983

Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453

Tel: 317-536-2380 Los Angeles

Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800

Raleigh, NC Tel: 919-844-7510

New York, NY Tel: 631-435-6000

San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto

Tel: 905-695-1980 Fax: 905-695-2078

#### ASIA/PACIFIC

Australia - Sydney Tel: 61-2-9868-6733

China - Beijing Tel: 86-10-8569-7000

China - Chengdu Tel: 86-28-8665-5511

China - Chongqing Tel: 86-23-8980-9588

China - Dongguan Tel: 86-769-8702-9880

China - Guangzhou Tel: 86-20-8755-8029

China - Hangzhou Tel: 86-571-8792-8115

China - Hong Kong SAR Tel: 852-2943-5100

China - Nanjing Tel: 86-25-8473-2460

China - Qingdao Tel: 86-532-8502-7355

China - Shanghai Tel: 86-21-3326-8000

China - Shenyang Tel: 86-24-2334-2829

China - Shenzhen Tel: 86-755-8864-2200

China - Suzhou Tel: 86-186-6233-1526

China - Wuhan Tel: 86-27-5980-5300

China - Xian Tel: 86-29-8833-7252

China - Xiamen Tel: 86-592-2388138

China - Zhuhai Tel: 86-756-3210040

#### ASIA/PACIFIC

India - Bangalore Tel: 91-80-3090-4444

India - New Delhi Tel: 91-11-4160-8631

India - Pune Tel: 91-20-4121-0141

Japan - Osaka Tel: 81-6-6152-7160

Japan - Tokyo Tel: 81-3-6880- 3770

Korea - Daegu

Tel: 82-53-744-4301 Korea - Seoul

Tel: 82-2-554-7200 Malaysia - Kuala Lumpur Tel: 60-3-7651-7906

Malaysia - Penang Tel: 60-4-227-8870

Philippines - Manila Tel: 63-2-634-9065

Singapore Tel: 65-6334-8870

Taiwan - Hsin Chu Tel: 886-3-577-8366

Taiwan - Kaohsiung Tel: 886-7-213-7830

Taiwan - Taipei Tel: 886-2-2508-8600

Thailand - Bangkok Tel: 66-2-694-1351

Vietnam - Ho Chi Minh Tel: 84-28-5448-2100

#### **EUROPE**

Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393

Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829

Finland - Espoo Tel: 358-9-4520-820

France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany - Garching Tel: 49-8931-9700

Germany - Haan Tel: 49-2129-3766400

Germany - Heilbronn Tel: 49-7131-72400

Germany - Karlsruhe Tel: 49-721-625370

Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44

Germany - Rosenheim Tel: 49-8031-354-560

Israel - Ra'anana Tel: 972-9-744-7705

Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781

Italy - Padova Tel: 39-049-7625286

Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340

Norway - Trondheim Tel: 47-7288-4388

Poland - Warsaw Tel: 48-22-3325737

Romania - Bucharest Tel: 40-21-407-87-50

Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91

Sweden - Gothenberg Tel: 46-31-704-60-40

Sweden - Stockholm Tel: 46-8-5090-4654

**UK - Wokingham** Tel: 44-118-921-5800 Fax: 44-118-921-5820