



OMEGA" User's Guide

Shop online at omega.com

e-mail: info@omega.com For latest product manuals: www.omega.com/enus/pdf-manuals

HANI[™] Tank Temperature Sensor

High Accuracy Non-Invasive Tank Temperature Sensor



○ OMEGA[™]

omega.com info@omega.com

Omega Engineering, Inc:

800 Connecticut Ave. Suite 5N01, Norwalk, CT 06854, USA

Toll-Free: 1-800-826-6342 (USA & Canada only)

Customer Service: 1-800-622-2378 (USA & Canada only) Engineering Service: 1-800-872-9436 (USA & Canada only)

Tel: (203) 359-1660 Fax: (203) 359-7700

e-mail: info@omega.com

Omega Engineering, Limited:

1 Omega Drive, Northbank, Irlam Manchester M44 5BD United Kingdom

Omega Engineering, GmbH:

Daimlerstrasse 26 75392 Deckenpfronn Germany

The information contained in this document is believed to be correct, but OMEGA accepts no liability for any errors it contains and reserves the right to alter specifications without notice.



Table of Contents

| 1. Notes | s, Warnings, and Cautions | 5 |
|----------|---|------------|
| 2. Getti | ng Started | 6 |
| | IANI™ Tank Temperature Sensor Weld Mounting | |
| | IANI™ Tank Temperature Sensor Epoxy Putty Mounting | |
| | | |
| | ng Diagram | |
| | 112 8-Pin Connector | |
| 3.1.1 | 4-20 mA Process Signals | 13 |
| 4. 4-20 | mA Plug and Play | 14 |
| 5. SYNC | C Configuration | 15 |
| 5.1 C | Configuring Inputs | |
| 5.1.1 | Calibration | 17 |
| 5.1.2 | Setting Alarms | 19 |
| 5.2 C | Configuring Device Settings | |
| 5.2.1 | Transmit Interval | |
| 5.2.2 | Setting/Changing Passwords | 20 |
| 5.3 D | Pata Logging | 22 |
| 6. 4-20r | mA Loop-Powered Output | 2 3 |
| | Sensor Mapping | |
| 6.1.1 | 4-20 mA Outputs Sensor Mapping | |
| 7 Deinis | | |
| | ng to an Omega Link Gateway | |
| | Vireless Pairing | |
| | Vired Pairing | |
| 8. Spec | ifications | 28 |
| 9. Appe | endix: HANI™ Tank Temperature Sensor Input Interface | 29 |
| | Register Base Addresses | |
| 9.2 H | IANI™ Tank Temperature Sensor Temperature Input Interface | 29 |
| 9.2.1 | Sensor Input Descriptor | |
| 9.2.2 | Sensor Temperature Parameters | 31 |
| 9.2.3 | Sensor User Calibration Parameters | 32 |
| 9.2.4 | Sensor IPSO Definition | 32 |
| 9.3 D | PIO Interface | 34 |
| 9.3.1 | DIO Descriptor | 34 |
| 9.3.2 | DIO IPSO Definition | 36 |
| 9.4 O | Output Configuration Registers | 37 |
| 9.4.1 | Scaling Minimum / Maximum Values | 37 |
| 9.4.2 | Output Values | 37 |
| 9.4.3 | Output Names | 38 |
| 9.5 4 | -20 mA Output Configuration | |
| 9.5.1 | High Range / Low Range | |
| 9.5.2 | System Error | 39 |



| 9.5.3 | Output Type | 39 |
|---------|--------------------------------|----|
| 9.5.4 | Mapping Enabled | 39 |
| 9.5.5 | Output Mapping | 40 |
| 9.5.6 | Scaling Minimum/Maximum Values | 40 |
| 9.5.7 | 4-20 mA Loop Powered Error | 40 |
| 9.6 Dig | gital Output Configuration | 40 |
| 9.6.1 | Rate | 41 |
| 9.6.2 | Output Type | 42 |
| 9.6.3 | Active State | 42 |
| 9.6.4 | Mapping Enabled | 42 |
| 9.6.5 | Output Mapping | 42 |
| | | |



1. Notes, Warnings, and Cautions

If the equipment is used in a manner not specified in this manual, the protection by the equipment may be impaired.

Do not operate the equipment in flammable or explosive environments.

It is important to read and follow all precautions and instructions in this manual before operating or commissioning this device as it contains important information relating to safety and EMC. Failure to follow all the safety precautions may result in injury and/or damage to your equipment.

The following labels identify information that is especially important to note:



Note: Provides you with information that is important to successfully setup and use the device.



Caution or Warning: Tells you about the risk of electrical shock.



Caution, Warning, or Important: Tells you of circumstances that can affect the functionality of the instrument and must refer to accompanying documents.



2. Getting Started

The Omega Engineering innovative technology for non-invasive temperature sensing delivers high accuracy and fast response times without the costs of installation, damage, replacement, and calibration that occur with an immersion sensor. The HANI™ Tank Temperature Sensor makes measuring the temperature of a fluid in a metal tank easier than ever. There is no cutting or drilling necessary. Simply weld or epoxy the stud mounts to the outside of the tank. This sensor is much easier to install and maintain, at a lower total cost.

The HANI™ Tank Temperature sensor is designed to be used in conjunction with a 4-20 mA connection for plug-and-play analog output, or with an Omega Link Smart Interface to utilize customizable features using Omega's SYNC configuration software through an integrated M12 connector.

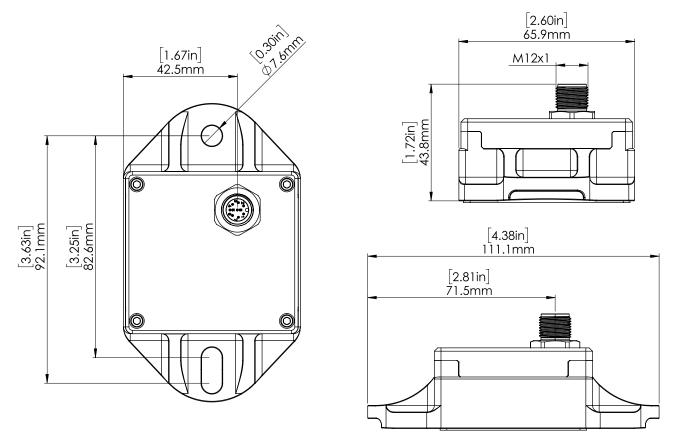


Figure 1: HANI™ Tank Sensor Mechanical Dimensions in Inches



2.1 HANI™ Tank Temperature Sensor Weld Mounting

Setting up a HANI™ Tank Temperature Sensor in the field is quick and easy. Follow the instructions below:

Step 1: Measure out stud mounting points, 3.5" spaced vertically on the tank wall. Vertical mounting is important on curved surfaces to keep the studs parallel.



Figure 2: Measure out mounting stud points at 3.5"

Step 2: Weld studs at measured points on the tank wall. Perform any necessary cleaning.



Figure 3: Secure the HANI™ Sensor



Step 3: Firmly press the HANI™ Tank Sensor over the studs against the tank wall, tighten the hardware nuts. Torque to hand tight plus 90° turn, no more than 5 in-lbs.

Once the hardware nuts secure the HANI™ Tank Sensor to the tank wall, the mounting process is complete.



Figure 4: Secure the hardware nuts to properly mount the HANI™ Tank Sensor



2.2 HANI™ Tank Temperature Sensor Epoxy Putty Mounting

Setting up a HANI™ Tank Temperature Sensor in the field is quick and easy. Follow the instructions below:

Step 1: Measure out stud mounting points, 3.5" spaced vertically on the tank wall. Vertical mounting is important on curved surfaces to keep the studs parallel.



Figure 5: Measure out mounting stud points at 3.5"

Step 2: Clean the surface of the tank wall that the HANI™ Tank Sensor will be mounted on. Use the appropriate sandpaper to sand the tank wall surface to improve adhesion.

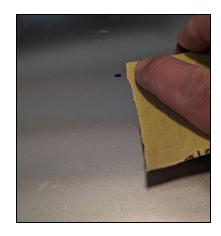


Figure 6: Clean and sand the surface the device will be mounted on

Step 3: Sand the lower side of the adhesive studs to improve adhesion.



Figure 7: Sand the adhesive studs



Step 4: Use the appropriate epoxy (Omega recommends JB Weld Waterweld or JB Weld Original). Mix per manufacturer's instructions. When using Waterweld, Omega recommends about ¼" of the stick for two studs.



Figure 8: Use appropriate epoxy

Step 5: Mix thoroughly using proper PPE according to the manufacturer's instructions.



Figure 9: Thoroughly mix the epoxy

Step 6: Apply the mixed epoxy to the bottom of the stud, coating the bottom surface completely.



Figure 10: Completely cover bottom surface of stud with mixed epoxy







Figure 11: Evenly distribute the epoxy across the top of the stud base

Step 7: Firmly press the bottom surface of the stud onto the tank surface. Reform the epoxy around the top of the base for a uniform coating. Make sure to keep the epoxy approximately even with the top bosses on the base.





Figure 12: Clean off excess epoxy, test fit, and let cure

Step 8: Carefully clean off any excess epoxy that has expanded beyond the base footprint of the stud. Repeat this procedure for the 2nd stud. Temporarily test fit the HANI™ to make sure it freely fits over the studs and that the applied epoxy does not interfere with the installation. Allow the epoxy to fully cure to the manufacturer's instructions (Omega recommends at least a 24-hour cure time).



Step 9: Firmly press the HANI™ Tank Sensor over the studs against the tank wall, tighten the hardware nuts. Torque to hand tight plus 90° turn, no more than 5 in-lbs.

Once the hardware nuts secure the HANI™ Tank Sensor to the tank wall, the mounting process is complete.



Figure 13: Secure the hardware nuts to properly mount the HANI™ Tank Sensor



3. Wiring Diagram

3.1 M12 8-Pin Connector

The HANI™ Tank Temperature Sensor connects to a 4-20 mA connection or Omega Link Smart Interface through an M12 8-pin female mating connector. The connector supports the required I2C + INTR signal lines and the Smart Probe power signals.



Note: The image below is a view of the open end of the Female Mating M12 8-Pin Connector and **not** the integrated male connector on the HANI™ Tank Temperature Sensor.


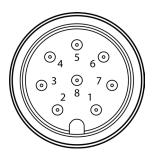


Figure 14: Female Mating M12 8-Pin Connector

| Pin | Name | Function | Wiring | |
|-------|--------------------------------|-----------------------|------------|--|
| Pin 1 | Loop - | 4-20mA Return | 4-20 mA | |
| Pin 2 | INTR | Interrupt Signal | Omega Link | |
| Pin 3 | SCL | I2C Clock Signal | Omega Link | |
| Pin 4 | SDA | I2C Data Signal Omega | | |
| Pin 5 | Pin 5 Shield Shield Ground | | Omega Link | |
| Pin 6 | Loop + | 4-20mA Source | 4-20 mA | |
| Pin 7 | GND | Power Ground | Omega Link | |
| Pin 8 | Pin 8 VCC Power Supply | | Omega Link | |

3.1.1 4-20 mA Process Signals

Refer to the following wiring diagram of the HANI™ Tank Sensor itself in this section to setup 4-20 mA process signals.

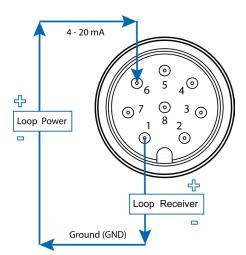

| Name | Description |
|----------|--|
| Loop | Provides "excitation" voltage to the sensor, |
| Power | typically 12-24 V _{DC} . |
| Sensor | Controls the current that flows through the |
| Sensor | circuit based on the measured value. |
| | Converts the 4-20 mA signal and displays |
| Loop | or transmits the measured value. This |
| Receiver | includes PID controllers and |
| | programmable logic controllers. |

Figure 15: 4-20 mA Process diagram of the Integrated male HANI™ Connector



4. 4-20 mA Plug and Play

The HANI™ Tank Temperature Sensor can easily be integrated into your existing analog system in a few steps. To immediately make use of the 4-20 mA plug and play feature, follow these instructions:

- Step 1: Mount and strap the HANI™ Tank Temperature Sensor on the tank you will be measuring.
- Step 2: Attach an 8-pin female M12 connector to your 4-20 mA analog cable (see the HANI™ Tank Temperature Sensor wiring diagram in section 3 Wiring Diagram only pins 1 & 6 are needed).

The HANI™ Tank Temperature Sensor will immediately begin reporting temperature readings.



5. SYNC Configuration



Important: SYNC configuration is only necessary if you will be changing the following: Tank Material, Tank Wall Thickness, Tank Material Thermal Conductivity, or to scale Output Readings. Ensure Omega's SYNC configuration software is downloaded, setup, and running before continuing. Ensure you have an Omega Link Smart Interface, such as an IF-001 or IF-006, compatible with your HANI™ Tank Temperature Sensor.



Important: If the HANI™ Tank Temperature Sensor is being powered with a 4-20 mA connection and will be configured using SYNC simultaneously, a **USB Isolator** must be used between the user PC and the HANI™ Tank Temperature Sensor to avoid false readings and potential damage to the unit.

The HANI™ Tank Temperature Sensor can be configured using Omega's SYNC configuration software when the HANI™ Tank Temperature Sensor is connected through an Omega Link Smart Interface to a computer running SYNC. Depending on the Omega Link Smart Interface being used, the connection process may vary slightly. Refer to the User Documentation of the Omega Link Smart Interface you are using.

Once your HANI™ Tank Temperature Sensor is connected to SYNC, you will immediately see readings appear on the SYNC interface.

5.1 Configuring Inputs

Omega's SYNC configuration software can be used to configure the HANITM Tank Temperature Sensor to suit your application parameters. To configure a HANITM Tank Temperature Sensor that is connected to an Omega Link Smart interface using SYNC, navigate to the *Inputs* configuration tab of the SYNC interface.

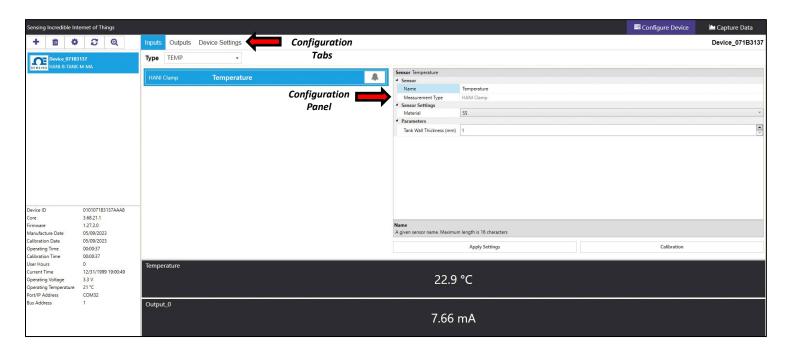


Figure 16: SYNC Configuration Software – HANI™ User Interface



Once in the **Inputs** configuration tab, you will be presented with all the configuration options for the HANI™ Tank Temperature Sensor Inputs. HANI™ Tank Temperature Sensors come preconfigured for stainless steel tank materials with 3-mm wall thickness. If your tank material is something other than stainless steel and/or has a different wall thickness, follow the calibration instructions below. To ensure accurate measurements are being reported by the HANI™ Tank Temperature Sensor, all parameters should be correctly set for accurate measurements.

Step 1: To configure your tank wall material, go to the **Sensor Settings** section of the SYNC user interface and change the **Material** dropdown to the appropriate tank wall material according to the table below:

| Type Material | |
|-----------------|------------------|
| SS | Stainless Steel |
| CS Carbon Steel | |
| GS | Galvanized Steel |
| CU | Copper |
| BR | Brass |
| AL | Aluminum |

- **Step 3:** To configure your tank wall thickness, go to the **Parameters** section and change the **Thickness (mm)** to the appropriate wall thickness, entered in **millimeters**.
- Step 4: Once you have completed configuring the HANI™ Tank Temperature Sensor inputs, click Apply Settings to finalize your changes.



5.1.1 Calibration

The HANI™ Tank Temperature Sensor has a standard 2-point calibration from the factory, but sometimes, to optimize the accuracy in the user's application, a **User Calibration** is necessary. A **Single-Point** or **Dual-Point User Calibration** can be performed through Omega's SYNC configuration software. To perform a successful calibration, the temperature inside the tank must be known or measurable with an immersion sensor. This immersion sensor temperature value will be used to calibrate the HANI™ Tank Temperature Sensor based on one of the two procedures below:

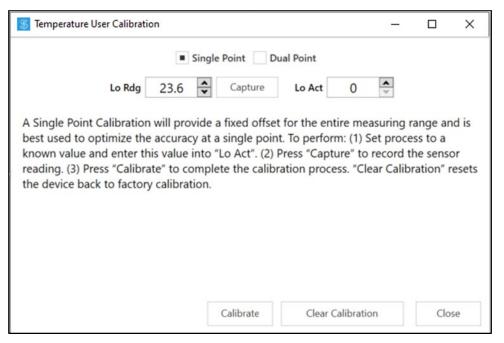


Figure 17: SYNC Configuration Software - Single Point Calibration

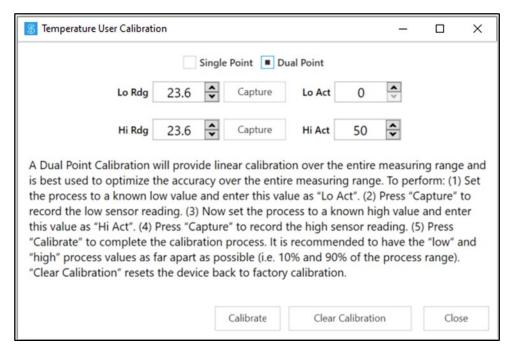


Figure 18: SYNC Configuration Software - Dual Point Calibration



| Low Actual: | The real low-temperature process value, as measured by the reference immersion sensor in the process line. For Single-Point Calibrations , you may choose any temperature in the sensor's process range. For Dual-Point Calibrations , it is recommended to choose a temperature on the low-end of the sensor's process range (i.e. 20°C). |
|-----------------------|--|
| Low Reading: | The low process value read by the HANI™ Tank Temperature Sensor. |
| Capture: | The Capture button will take a live reading from the HANI™ Tank Temperature Sensor and input the value into the Low Reading or High Reading , as directed. |
| High Actual: | The real high-temperature process value, as measured by the reference immersion sensor in the process line. Not applicable for Single-Point Calibrations . For Dual-Point Calibrations , it is recommended to choose a temperature on the high-end of the sensor's process range (i.e. 80°C). |
| High Reading: | The high process value read by the HANI™ Tank Temperature Sensor. |
| Calibrate: | The Calibrate button calculates and calibrates the new slope and offset based on the Readings and Actuals entered above. |
| Clear Calibration: | This button will clear the previously entered User Calibration values and as a result, returns the HANI™ Tank Temperature Sensor to its factory calibration. |



5.1.2 Setting Alarms

Alarms are set by clicking the icon in SYNC on the highlighted input signal found in the Inputs configuration tab.



Note: Alarm Outputs are only available on Digital Output models currently; analog output products do not support alarm outputs at this time but can still transmit notifications to the Omega Link Cloud.

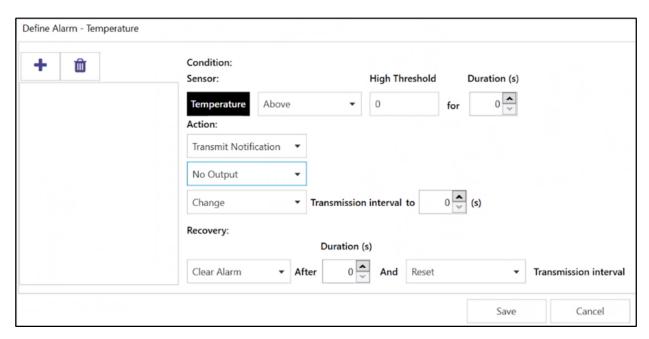


Figure 19: SYNC Configuration Software - Setting Alarms

Configure the **Condition** that triggers the alarm by selecting an option from the drop down such as Above or Below. The **Threshold** field(s) will change to display whatever is appropriate for the option chosen such as a High Threshold for an Above condition or a Low Threshold for a Below condition. A **Duration** can be set for the trigger as well where the condition must be met for a certain amount of time before the alarm flags.

Under the **Action** menu, the option to transmit or not transmit a notification can be set. The option to enable an output can also be set. The output chosen must not be currently used in a sensor mapping or ON/OFF control module. The data transmission interval may also be changed upon triggering an alarm, e.g. increase the rate of transmission if an excessive value is detected.

The **Recovery** menu allows the option to clear the alarm after a certain **Duration** once the trigger condition is no longer met. The transmission interval can also be reset to the normal system setting once the alarm is cleared.

To create a new alarm, click the plus icon and a new alarm will be added. To remove an alarm once it is created, select the alarm in question on the left side of the alarm panel and click the delete icon.



5.2 Configuring Device Settings

Omega's SYNC configuration software can be used to configure the device settings of your HANI™ Tank Temperature Sensor. To configure your device settings, navigate to the **Device Settings** configuration tab of the SYNC interface.

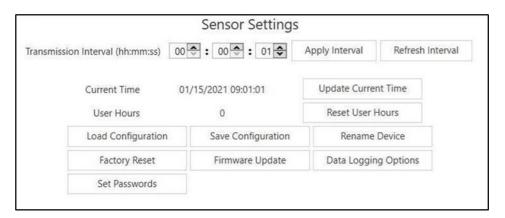


Figure 20: SYNC Configuration Software - Sensor Settings

5.2.1 Transmit Interval

The transmit interval can be adjusted by navigating to the Device Settings tab in the SYNC interface and will appear beneath the Sensor Settings section. The Transmit Interval determines the time between readings for the HANI™ Tank Temperature Sensor. The transmit interval will also be reset to your minimum interval based on your Omega Link Cloud account once your device is paired to the Omega Link Cloud.

 


Figure 21: SYNC Configuration Software – Transmit Interval

5.2.2 Setting/Changing Passwords

HANI™ Tank Temperature Sensor data can be password protected through SYNC. Password protecting your HANI™ Tank Temperature Sensor prevents data in the device from being extracted without authorization. If your Smart Probe is password-protected, the password must also be stored in the Omega Link Smart Interface so it can transmit data to the Omega Link Cloud. To assign a password to your HANI™ Tank Temperature Sensor, follow these instructions:

- **Step 1:** Navigate to the Device Settings tab in the SYNC interface and click Set Passwords under the **Sensor Settings** section.
- **Step 2:** Create a Configuration Password. Upon saving your password, you will be prompted to update the Interface Password as well to ensure your data is transmitted to the Omega Link Cloud.





Figure 22: SYNC Configuration Software - Password Update



Important: If the interface password does not match the configuration password, data from your HANI™ Tank Temperature Sensor will not be sent to the Omega Link Cloud.

5.2.2.1 Save Password

Password protects the SYNC configurable features of your HANI™ Tank Temperature

Sensor and saves the newly entered password if it is successfully entered and confirmed in both text fields.

5.2.2.2 Clear Password

The Clear Password button removes the password protection from the probe.

5.2.2.3 Login

Click the Login button after entering your device password to access the configurable features.

5.2.2.4 Reset

The Reset Password button deletes the current password on the device.

This will cause all logged data to be erased.



Figure 23: SYNC Configuration Software – Device Login

After 3 failed login attempts, it is required to power cycle the device before trying to login again.

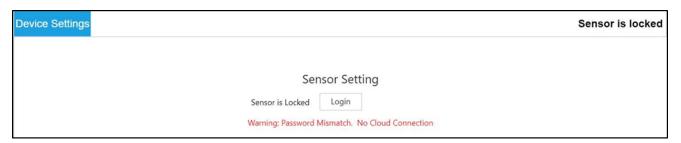


Figure 24: SYNC Configuration Software - Password Locked Device



5.3 Data Logging

The Capture Data interface provides a chart that displays real-time data from your connected HANI™ Tank Temperature Sensor devices. The Capture Data interface contains the following features:

| Extract Data | Extracts data from the device data logger. |
|-------------------------|--|
| Start/Stop Recording | Toggles the real-time data displays to on/off. |
| Export Data to CSV | Gathers the data that has been recorded or extracted and saves it in a CSV file. |

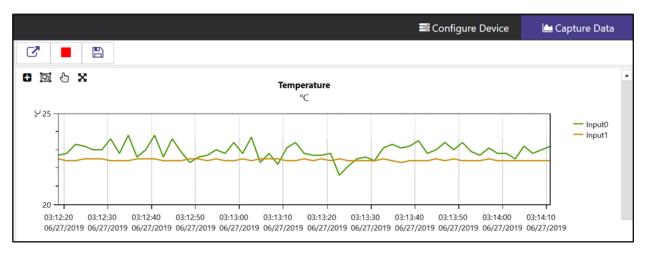


Figure 25: SYNC Configuration Software - Data Logging



Note: Data will be reset if the user switches to the Configure Device interface. The SYNC Data Capture feature is for short-term data logging.

SYNC provides four ways to navigate the Capture Data Interface:

| Zoom by Rectangle | 0 | Allows the user to left-click and drag the mouse across the graphed data to create a rectangle that will be zoomed in on. | |
|-------------------------------|---|--|--|
| Zoom by Middle Mouse Wheel | | Allows the user to zoom in and out of the graphed data using the middle mouse wheel. This only applies to users who have a mouse with the necessary mouse wheel feature. | |
| Pan by Left Mouse Button | 6 | Allows the user to left-click and drag on the graphed data to navigate in the direction of the mouse. | |
| Reset | × | Resets the graphed data to the original position. | |



6. 4-20mA Loop-Powered Output

Devices configured for 4-20 mA Loop Power disable the DIO Inputs and the Digital Outputs. 4-20mA Outputs are widely used due to several advantages' over-voltage outputs:

- Higher noise immunity
- Ability to power the sensing device using the measurement current provided total power is less than 2.5mA * minimum loop voltage
- Automatic wire break detection if the signal wires are shorted the current will exceed the control system to detect the fault
- Automatic wire short detection if the signal wires are shorted the current will exceed the specified 20mA, allowing the control system to detect the fault.

The HANI™ Tank Temperature Sensor 4-20mA Loop Powered device requires a minimum loop voltage of 8.0 volts, allowing the device to be powered using conventional 4-20mA control signals. The factory default configuration connects the measured temperature to the 4-20mA output signal.

6.1 Sensor Mapping

The HANI™ Tank Temperature Sensor defaults to mapping the measured Temperature to the 4-20mA output. Two user-defined values (*Scaling Minimum, Scaling Maximum*) define the Temperature range that is mapped to the 4-20mA. A measured value outside of the specified range results in an Over-Range or Under-Range condition. A Factory Reset sets the Scaling Minimum to 0°C and the Scaling Maximum to 100°C.

If the Measured Value exceeds the user-defined Scaling Maximum an Over-Range condition exists and the 4-20mA output may be configured to generate either a Fault High (21.5 mA) current or a Fault Low (3.8 mA) current. The default setting is to generate a Fault High (21.5 mA) current.



Similarly, if the measured value is less than the user-defined Scaling Minimum an Under-Range condition exists, and the output may be configured to generate either a Fault High or Fault Low output. The default setting is to generate a Fault Low (3.8mA) current.

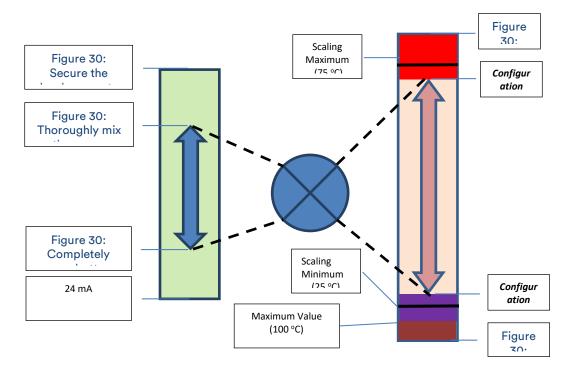


Figure 26: SYNC Configuration Software - Sensor Mapping

A Loop Error occurs if the applied voltage of the 4-20mA loop drops below the specified minimum loop voltage and the output will be driven to a Low Error level of $_{\rm -}$ 3.8 mA.



6.1.1 4-20 mA Outputs Sensor Mapping

The HANI™ Tank Temperature Sensor offers 4-20 mA output sensor mapping. Navigate to the Outputs Configuration Tab on SYNC.

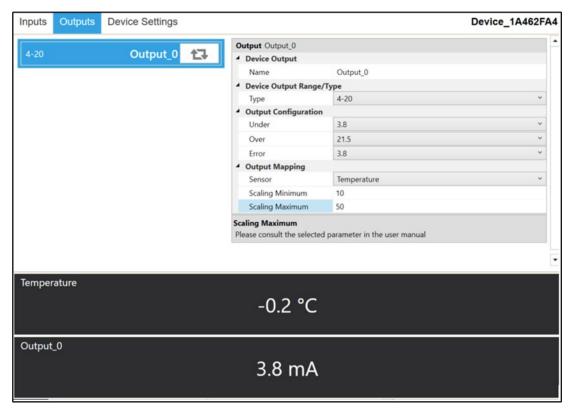


Figure 27: SYNC Configuration Software - 4-20 mA Output Sensor Mapping

Under the **Output Configuration** section, you can set the under/over and error conditions of the 4-20 mA analog output.

Under: Any temperature value below the Scaling Minimum will generate an Under fault

value.

Over: Any temperature value above the Scaling Maximum will generate an Over fault

value.

Under the Output Mapping section, you can set the desired 4-20 mA analog output scaling range. The HANI™ Tank Temperature Sensor comes standard with a 0-100°C temperature scaling range.

Scaling Minimum: Set the Scaling Minimum Temperature value that will result in a 4

mA output. In this example, a temperature of 10°C will result in a 4

mA analog output.

Scaling Maximum: Set the Scaling Maximum Temperature value that will result in a 20

mA output. In this example, a temperature of 50°C will result in a 20

mA analog output.



7. Pairing to an Omega Link Gateway

Refer to either the Wireless Pairing or Wired Pairing instructions to pair a HANI™ Tank Temperature Sensor to an Omega Link Gateway. Before continuing to the pairing instructions, ensure the following prerequisites are met:

- Ensure that the Omega Link Gateway has been properly setup, powered on, and is in close physical proximity.
- (For Wired pairing) Ensure the user has access to a PC and the internal Gateway UI (refer to the Omega Link Gateway manual for instructions on how to access the internal Gateway UI).

7.1 Wireless Pairing

Pairing a wireless Smart Interface (IF-006) and attached HANI™ Tank Temperature Sensor is made easy with a one-button pairing system between the IF-006 and the Omega Link Gateway.

- Step 1: When the HANI™ Tank Temperature Sensor and relevant accessories have been securely connected to the IF-006, push the pairing button once on the IF-006. The LED status indicator will blink green indicating the device is in Pairing Mode.
- **Step 2:** Quickly push the pairing button on the Omega Link Gateway. The LED on the Gateway will blink green indicating the Gateway is in Pairing Mode.

When the IF-006 has been successfully paired to the Omega Link Gateway, the LED will stop blinking on both devices. Readings for the newly added sensor will then appear on the Omega Link Cloud or Omega Enterprise Gateway interface associated with the registered Gateway.



7.2 Wired Pairing

A wired HANI™ Tank Temperature Sensor connected directly to an Omega Link Gateway with an IF-001 cable or IF-002 will need to be added to the Gateway Internal User Interface. See the Omega Link Gateway User's Manual for more information. The **Connected Devices** tab is the default page shown once the user has signed in to the internal gateway UI. From here, devices can be added to the gateway to have them appear in a registered Omega Link Cloud or Omega Enterprise Gateway account.

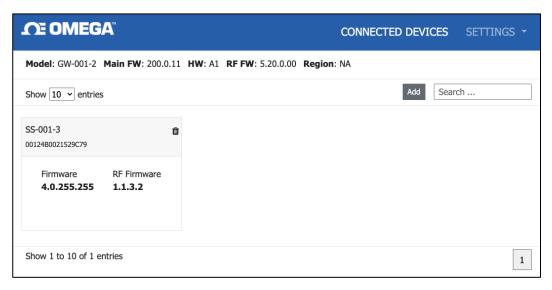


Figure 28: Gateway Internal User Interface

To add a device to your gateway from the internal gateway web UI, begin by clicking the button at the top right of the web page. Fill out the **Add Device** menu with the parameters of the Smart Probe connection.



8. Specifications

INPUT POWER

Voltage: 8V_{DC} – 28 V_{DC} (Loop Powered)

Max Loop Resistance: $R_{MAX}(\Omega) = (V_{SUPPLY} - 8V)/0.024 A$

ANALOG OUTPUT

Current: 4-20 mA

User scalable analog output, default scaling 0-100°C

PROCESS PARAMETERS

Process Medium: Water, water-based fluids (others upon request)

Tank Materials: Stainless Steel (SS), Carbon Steel (CS), Galvanized Steel (GS), Copper (CU), Brass

(BR), Aluminum (AL) (others upon request)

Tank Size: 2 feet in diameter or larger (others upon request)

Process Temperature Range: 0 to 100°C

PERFORMANCE

Accuracy with Agitated Process Media:

Stainless Steel: ±0.5°C

Other Metals: ±1.0°C from factory and improved accuracy is possible with situational 1 or 2-

point calibration

Response Time (t63): 5 seconds Response Time (t90): 10 seconds

ENVIRONMENTAL

Ambient Operating Temperature: 0 to 40°C (32 to 104°F)

Rating: IP65 when mated

MECHANICAL

Dimensions: 65.9 mm W x 111.1 mm L x 43.8 mm H (2.60 in W x 4.38 in L x 1.72 in H)

Materials: PA12, silicone rubber, nickel-plated brass, stainless steel

GENERAL

Agency Approvals: CE, UKCA, EMC 2014/30/EU, LVD 2014/35/EU class II product, (low voltage 8

to 28V_{DC})



9. Appendix: HANI™ Tank Temperature Sensor Input Interface

9.1 Register Base Addresses

Smart Probe devices share a common platform architecture that provides extensive monitoring and control capabilities through a set of platform generic registers. These registers may be accessed using I2C based commands directly to the Smart Probe devices or through a set of Modbus-based registers when using Omega Interface devices.

When powered on or after a device reset each Smart Sensor-based device will enumerate 1 or more sensor instances which are described by the device-specific Sensor Descriptors which include configuration options, measurement type, and units of measure for the corresponding sensor values. Additional sensor information is provided in sensor-specific IPSO object descriptions which include extended measurement type, precision and tracking of minimum/maximum readings.

Each enumerated Sensor has a Descriptor Base address location and a Sensor IPSO / Configuration structure address location based on the sensor mix selected.

| Sensor | Descriptor Base | IPSO/Configuration | Enumerated Sensor Mix | |
|--------|------------------------|--------------------|------------------------------|--|
| | | | Digital Output 4-20 m | |
| 0 | 0x0060 (0xf030) | 0x08a8 (0xf454) | Tank-on Temperature | |
| 1 | 0x0068 (0xf034) | 0x09a8 (0xf4d4) | DIO | |
| 2 | 0x0070 (0xf038) | 0x0aa8 (0xf554) | | |
| 3 | 0x0078 (0xf03c) | 0x0ba8 (0xf5d4) | | |

9.2 HANI™ Tank Temperature Sensor Temperature Input Interface

The HANI™ Tank Temperature Sensor Input interface provides a reading of the calculated temperature based on the measured heat flux and temperature values.



Note: The HANI[™] Tank Temperature Sensor products will use a predefined configuration but will require some customization based on the specific installation. Configuration options will be made available to the end-user.

9.2.1 Sensor Input Descriptor

| Offset | Name | Value | Description |
|----------|------------------|-------|----------------------------|
| 0x00 | Measurement Type | 0x37 | Temperature (°C) |
| 0x01 | Data Type/Format | 0x06 | Float |
| 0x02 | Configuration | 0x4? | Determines Material Type |
| 0x03 | Sensor Device | 0x?? | Determines connection type |
| 0x040x08 | UOMR | "°C" | Units of measure |



9.2.1.1 Sensor Measurement Type

The temperature interface provides a measurement of Temperature in °C.

| Sensor Type | SI Derived Units | Measurement |
|-------------|------------------|-------------|
| 0x37 | °C | Temperature |

9.2.1.2 Sensor Input Data Type/Format

The HANI™ Tank Temperature Sensor supports extended configuration and provides factory calibration. All data values are returned as 32-bit floating-point values.

| | HANI™ Tank Temperature Sensor Input Data Type/Format | | | | | | | |
|-----------------|--|----------------------|----------|-----------|--|--|--|--|
| 7 | 7 6 5 4 3 2 1 0 | | | | | | | |
| Smart Sensor | Writeable | Factory Calibrate | Reserved | Data Type | | | | |
| 0 | 0 0 0 0 0x06 == FLOAT | | | | | | | |

9.2.1.2.1 Data Type

The 4-bit Data Type field determines the type of data of the specific sensor.

9.2.1.2.2 Factory Calibrate

Factory calibration is available for the HANI™ Tank Temperature Sensor process inputs. Clearing this bit will disable the factory calibration values.

9.2.1.2.3 Writeable

The writeable bit is cleared, indicating that the sensor values may not be overwritten.

9.2.1.3 Sensor Configuration Byte

| | HANI™ Tank Temperature Sensor Configuration Byte | | | | | | |
|-----------|--|------------------|------|---|--------------|------------|---|
| 7 | 6 | 5 | 4 | 3 | 2 | 1 | 0 |
| Available | Assigned | Apply Scaling | Lock | | Sensor Rar | ige / Type | |
| 0 | * | ? | ? | | Material (se | ee below) | |

9.2.1.3.1 Sensor Range / Type

The Range / Type field determines the type of tank material, which determines the thermal conductivity.

| Range / Type | Material | Description | Conductivity (W/m-K) |
|--------------|----------|-----------------------------------|-------------------------|
| 0x00 | PVC | Polyvinyl Chloride | 0.190 |
| 0x01 | CPVC | Chlorinated Polyvinyl Chloride | 0.137 |
| 0x02 | PP | Polypropylene | 0.125 |
| 0x03 | PFA | Perfluoroalkoxy Alkanes | 0.209 |



9.2.1.3.2 Lock

If set, the user-specified units of measure string (4 character maximum) will be used in place of the default units of measure.

9.2.1.3.3 Apply Scaling

If set, the user-defined Offset and Gain values will be used to adjust the sensor reading:

Result = (Raw Reading * Gain) + Offset

9.2.1.3.4 Assigned

The Assigned bit will always read as 0.

9.2.1.3.5 Available

The Available bit will always read as 0.

9.2.1.4 Sensor Device Byte

The HANI™ Tank Temperature Sensor device byte is not used.

9.2.2 Sensor Temperature Parameters

The HANI™ Tank Temperature Sensor provides 2 Sensor Parameters that may be updated based on the specific installation. The HANI™ Tank Temperature Sensor Temperature parameters are accessible when the device is in the **normal operating** mode (see IPSO Trigger Function).

| Parameter | I2C Register | Modbus Register | Name | Range | Step Size | Factory Reset | Description |
|-----------|-----------------|--------------------|-----------|-------------|--------------|------------------|-----------------|
| 0 | 0x08c0 | 0xf460 | Diameter | 25.4 – 76.2 | 0.1 | 38.1 | Diameter in mm |
| 1 | 0x08d0 | 0xf468 | Thickness | 1.0 – 10.0 | 0.1 | 1.7 | Thickness in mm |

9.2.2.1 Diameter

The Diameter is used in the calculation of the temperature and is a factor of the specific installation.

9.2.2.2 Thickness

The Thickness is used in the calculation of the temperature and is a factor of the specific installation.



9.2.3 Sensor User Calibration Parameters

The HANI™ Tank Temperature Sensor provides a single or dual-point User Calibration.

The HANI™ Tank Temperature Sensor parameters are accessible when the device is in the **Calibration** mode (see IPSO Trigger Function). The Calibration Value is calculated internally during the User Calibration sequence and is not externally accessible.

| Parameter | I2C Register | Modbus Register | Name | Range | Step Size | Factory Reset | Description |
|-----------|-----------------|--------------------|------------|-------------|--------------|------------------|---------------------------|
| 0 | 0x08c0 | 0xf460 | Low | 0.0 – 100.0 | 0.1 | 0.0 | Value being read by HANI™ |
| | σχοσσο | 0X1 100 | Reading | 0.0 100.0 | 0.1 | 0.0 | sensor |
| 1 | 0x08d0 | 0xf468 | Low Actual | 0.0 - 100.0 | 0.1 | 0.0 | Actual measured value. |
| 2 | 0x08e0 | 0xf470 | High | 0.0 – 100.0 | 0.1 | 100.0 | Value being read by HANI™ |
| 2 | uxuseu | UX147U | Reading | 0.0 – 100.0 | 0.1 | 100.0 | sensor |
| 2 | 0×00f0 | 0v4470 | High | 0.0 100.0 | 0.1 | 1000 | A stud massured value |
| 3 | 0x08f0 | 0xf478 | Actual | 0.0 – 100.0 | 0.1 | 100.0 | Actual measured value. |

9.2.3.1 Low Reading

The temperature value being read by the HANI sensor.

9.2.3.2 Low Actual

The actual low temperature as measured by an external, independent sensor.

9.2.3.3 High Reading

The temperature value being read by the HANI sensor.

9.2.3.4 High Actual

The actual high temperature as measured by an external, independent sensor.

9.2.4 Sensor IPSO Definition

The HANI™ Tank Temperature Sensor IPSO definition provides signal range, measured min/max values, IPSO object type information. The Range information is Temperature Type dependent.

| Offset | Name | Value | Description |
|--------|----------------|-------|--------------------------------------|
| 0xa8 | Sensor Type | 3303 | Temperature (°C) |
| 0xaa | Precision | 1 | Provides reading of xxx.x |
| 0xac | Sensor Trigger | ?? | (see below) |
| 0xb0 | Min Measured | ?? | Minimum reading since the last reset |
| 0xb4 | Max Measured | ?? | Maximum reading since the last reset |
| 0xb8 | Min Range | 0 | Minimum temperature |
| 0xbc | Max Range | 100 | Maximum temperature |

9.2.4.1 Precision

The measured temperature value is rounded to provide ±0.1 degree resolution.



9.2.4.2 Sensor Trigger

The Sensor Trigger function is used to reset the IPSO min/max values as well as controlling the Calibration process.

| | Sensor Trigger | | | | | | |
|----|----------------|-------------|-------------|-------------|---------|---------|-------------|
| 7 | 6 | 5 | 4 | 3 | 2 | 1 | 0 |
| 0 | 0 | 0 | 0 | 0 | 0 | 0 | Reset |
| U | O | U | U | U | O | O | Min/Max |
| 15 | 14 | 13 | 12 | 11 | 10 | 9 | 8 |
| 0 | 0 | Calibration | Calibration | Calibration | Capture | Capture | Calibration |
| U | 0 | Reset | Status | Mode | High | Low | Start |

Setting the Reset Min/Max bit to 1 will reset the Min/Max values recorded by the IPSO process.

9.2.4.2.1 User Calibration Sequence

User Calibration allows the user to adjust out small errors by providing an offset (single-point calibration) or offset and gain (dual point calibration) to the measured temperature value. The following sequence may be used to set the correction value:

1. Write 0x0800 to the Trigger Function register (Calibration Mode bit set). This forces the device into Calibration Mode and the Sensor Parameter register access is replaced with the Sensor Calibration register access.

Dual Point Calibration

- 2. Apply a known fluid temperature near the lower end of the expected temperature range and enter it into the Low Actual register (0x08c4 / 0xf462).
- 3. Record the value being measured by the HANI sensor and enter it into the Low Reading register (0x08c0 / 0xf460). This process can be simplified by writing a value of 0x0a00 to the Trigger Function register which will cause the HANI sensor to capture the current reading and save it as the Low Reading Value.
- 4. Apply a known fluid temperature near the higher end of the expected temperature range and enter it into the High Actual register (0x08cc / 0xf466).
- 5. Record the value being measured by the HANI sensor and enter it into the High Reading register (0x08c8 / 0xf464). This process can be simplified by writing a value of 0x0c00 to the Trigger Function register which will cause the HANI sensor to capture the current reading and save it as the High Reading Value.
- 6. Write 0x0900 to the Trigger Function register (Calibration Mode and Calibration Start). Internally the device will set the Calibration Status bit and calculate the Gain and Offset linearization values. When the calibration calculation is complete the Calibration Status bit is cleared.



7. Write 0x0000 to the Trigger Function register to return the device to the normal operating mode.

Single Point Calibration

- 8. Apply a known fluid temperature near the center of the expected temperature range and enter it into the Low Actual register (0x08c4 / 0xf462).
- 9. Record the value being measured by the HANI sensor and enter it into the Low Reading register (0x08c0 / 0xf460). This process can be simplified by writing a value of 0x0a00 to the Trigger Function register which will cause the HANI sensor to capture the current reading and save it as the Low Reading Value.
- 10. Write the same value from Step 8 into the High Actual register (0x08cc / 0xf466).
- 11. Write 0x0900 to the Trigger Function register (Calibration Mode and Calibration Start). Internally the device will set the Calibration Status bit and calculate the Offset value. When the calibration calculation is complete the Calibration Status bit is cleared.

Write 0x0000 to the Trigger Function register to return the device to the normal operating mode.

The Correction value may be reset to zero by writing 0x2800 (Calibration Reset and Calibration Mode) to the Trigger register.

9.3 DIO Interface

The Digital output option supports a DIO Interface that provides 2 digital inputs that are hardwired to the Digital outputs. These may be used to detect the state of external switches (output off) or to monitor the state of the outputs.



Note: The DIO is not available for units configured with 4-20 mA outputs.

9.3.1 DIO Descriptor

| Offset | Name | Value | Description |
|--------|--------------------|-------|---------------------------------------|
| 0x00 | Sensor Type | 0x18 | Digital Type (Bit mapped) |
| 0x01 | Data | 0x46 | Configurable, Float type |
| 0,01 | Type/Format | 0,40 | |
| 0x02 | Configuration | 0x23 | Scaling applied, Bits 0 and 1 enabled |
| 0x03 | Sensor Device 0x0f | | DIN bits enabled / inverted |
| 0x04 | 0x04 UOMR "DIN" | | Units of measure |



9.3.1.1 DIO Sensor Type

The interface provides a bit mapped input of the 2 digital signal lines.

| Sensor Type | SI Derived Units | Measurement |
|-------------|------------------|---------------------------|
| 0x18 | DIN | Bit mapped digital inputs |

9.3.1.2 DIO Data Type/Format

| | DIO Data Type/Format | | | | | | |
|-----------------|----------------------|----------------------|----------|---|-----------|------------|---|
| 7 | 6 | 5 | 4 | 3 | 2 | 1 | 0 |
| Smart Sensor | Writeable | Factory Calibrate | reserved | | Data | Туре | |
| 0 | 0 | 0 | 0 | | 6 == Floa | ting point | |

9.3.1.2.1 Data Type

The 4-bit Data Type field determines the type of data of the specific sensor.

9.3.1.2.2 Factory Calibrate

The Factory Calibrate bit is not used for DIO types.

9.3.1.2.3 Writeable

This indicates that the sensor value may be overwritten. Not used on DIO inputs.

9.3.1.3 DIO Input Configuration

| DIO Input Configuration | | | | | | | |
|-------------------------|----------|------------------|------|---|-------------|-------------|---|
| 7 | 6 | 5 | 4 | 3 | 2 | 1 | 0 |
| Available | Assigned | Apply Scaling | Lock | , | Sub Channe | l Selection | |
| 0 | 0 | 1 | ? | | 0x03 == bit | s 0 and 1 | |

9.3.1.3.1 Lock

If set, the user-specified units of measure string (4 character maximum) will be used in place of the default **DIN**.

9.3.1.3.2 Apply Scaling

If set, the user-defined Offset and Gain values will be used to adjust the sensor reading:

Result = (Raw Reading * Gain) + Offset

9.3.1.3.3 Assigned

The Assigned bit will always read as 0.

9.3.1.3.4 Available

The Available bit will always read as 0.



9.3.1.4 DIO Device Configuration

The DIO Device Configuration allows enabling each of the 2 input bits and selecting whether the input is active HIGH (reads as 1 when input is not grounded) or active LOW (reads as 1 when input is grounded).

| | DIO Device Configuration | | | | | | |
|---|--------------------------|---|---|--------|--------|--------|------------|
| 7 | 7 6 5 4 | | | | 2 | 1 | 0 |
| | Reserved | | | | N 1 | DII | V 0 |
| 0 | 0 | 0 | 0 | ENABLE | INVERT | ENABLE | INVERT |
| U | U | U | U | 1 | 1 | 1 | 1 |

9.3.1.4.1 Invert

If the Invert bit is set the input is active LOW.

9.3.1.4.2 Enable

If the Enable bit is set the input is enabled.

9.3.2 DIO IPSO Definition

The DIO input IPSO definition provides signal range, measured min/max values, IPSO object type information.

| Offset | Name | Value | Description |
|--------|----------------|-------|---------------------------------------|
| 0xa8 | Sensor Type | 3349 | Bit Mapped Digital |
| 0xaa | Precision | 0 | Provides reading of xxx |
| 0xac | Sensor Trigger | ?? | Write 0x0001 force reset of min / max |
| 0xb0 | Min Measured | ?? | Minimum reading since the last reset |
| 0xb4 | Max Measured | ?? | Maximum reading since the last reset |
| 0xb8 | Min Range | 0 | Minimum reading |
| 0xbc | Max Range | 3 | Maximum reading |

9.3.2.1 Sensor Trigger Function

The Sensor Trigger function is used to reset the IPSO min/max values as well as controlling the Calibration process.

| | Sensor Trigger Function | | | | | | | | |
|----|-------------------------|----|-----------|----|----|---|------------------|--|--|
| 7 | 6 | 5 | 5 4 3 2 1 | | | | | | |
| 0 | 0 | 0 | 0 | 0 | 0 | 0 | Reset Min/Max | | |
| 15 | 14 | 13 | 12 | 11 | 10 | 9 | 8 | | |
| 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | |

Setting the Reset Min/Max bit to 1 will reset the Min/Max values recorded by the IPSO process.

No User Calibration process is supported on the DIO inputs and all Configuration bits should be written as 0.



9.4 Output Configuration Registers

Outputs share a common structure which consists of 3-fields mapped to a 16-bit unsigned integer, accessible in the Smart Sensor register map.

| Output | Name | Modbus Address | I2C Address | Size | Typical Description |
|--------|---------------------|-------------------|----------------|--------|----------------------------|
| 0 | Output 0 Descriptor | 0xf09a | 0x0134 | uint16 | PWM 0 or 4-20 mA |
| 1 | Output 1 Descriptor | 0xf09b | 0x0136 | uint16 | PWM 1 (see below) |
| 2 | Output 2 Descriptor | 0xf09c | 0x0138 | uint16 | Phantom (non-configurable) |
| 3 | Output 3 Descriptor | 0xf09d | 0x013a | uint16 | Phantom (non-configurable) |

Refer to the specific output type for further information.

9.4.1 Scaling Minimum / Maximum Values

When Sensor Mapping is used the user may specify the input signal range through the Scaling Minimum and Scaling Maximum parameters. There is one pair of registers for each of the 4 possible outputs.

| Sensor | Name | Modbus Address | I2C Address | Size | Description |
|--------|---------------------|-------------------|----------------|-------|------------------------|
| 0 | Output 0 Low Scale | 0xf1f0 | 0x03e0 | float | Sets lower input range |
| 0 | Output 0 High Scale | 0xf1f2 | 0x03e4 | float | Sets upper input range |
| 1 | Output 1 Low Scale | 0xf1f4 | 0x03e8 | float | Sets lower input range |
| 1 | Output 1 High Scale | 0xf1f6 | 0x03ec | float | Sets upper input range |
| 2 | Output 2 Low Scale | 0xf1f8 | 0x03f0 | float | Sets lower input range |
| | Output 2 High Scale | 0xf1fa | 0x03f4 | float | Sets upper input range |
| 3 | Output 3 Low Scale | 0xf1fc | 0x03f8 | float | Sets lower input range |
| 3 | Output 3 High Scale | 0xf1f2e | 0x03fc | float | Sets upper input range |

When either the Low Scale or High Scale value changes, an internal calculation is performed to calculate the linear transformation to be applied to the sensor reading.

9.4.2 Output Values

Outputs use float values which represent the percentage of full scale. If the output is not mapped, the value written (0 - 100%) is identical to the value that is read back.

If the output is mapped, the scaling values are used to transform the minimum input value to 0% and the maximum input value to 100%.

| Output | Name | Modbus Address | I2C Address | Size | Description |
|--------|----------------|-------------------|----------------|-------|--------------------------------------|
| 0 | Output 0 Value | 0xf078 | 0x00f0 | float | Percent of full-scale value (0-100%) |
| 1 | Output 1 Value | 0xf07a | 0x00f4 | float | Percent of full-scale value (0-100%) |
| 2 | Output 2 Value | 0xf07c | 0x00f8 | float | Percent of full-scale value (0-100%) |
| 3 | Output 3 Value | 0xf07e | 0x00fc | float | Percent of full-scale value (0-100%) |



9.4.3 Output Names

Each output has a name. The default names for the outputs are **Output_0** through **Output_3**. The default names may be overwritten, such as 'Stack_Lite' or 'Control_Valve'. Names are restricted to 16 characters.

| Output | Name | Modbus Address | I2C Address | Size | Description |
|--------|---------------|-------------------|----------------|----------|----------------------|
| 0 | Output 0 Name | 0xf078 | 0xf720 | char[16] | Defaults to Output_0 |
| 1 | Output 1 Name | 0xf07a | 0xf728 | char[16] | Defaults to Output_1 |
| 2 | Output 2 Name | 0xf07c | 0xf730 | char[16] | Defaults to Output_2 |
| 3 | Output 3 Name | 0xf07e | 0xf738 | char[16] | Defaults to Output_3 |

The Output names are retained until a factory reset occurs.

It is strongly recommended that:

- 1. Spaces within the name should be replaced with the '_' character.
- 2. All output names on a particular device are unique if duplicate functions are supported append a '_x' string, where x represents the instance. For example, Stack_Lite_1 and Stack_Lite_2 could be used if 2 stack lights are being connected.

9.5 4-20 mA Output Configuration

4-20 mA outputs are widely used due to several advantages over-voltage outputs:

- 1. Higher noise immunity
- 2. Ability to power the sensing device using the measurement current provided total power is less than ~ 3.5 mA X minimum loop voltage.
- **3.** Automatic wire break detection if the signal wires break the current drops to 0 mA, allowing the control system to detect the fault.
- **4.** Automatic wire short detection if the signal wires are shorted the current will exceed the specified 20 mA, allowing the control system to detect the fault.



The HANI™ Tank Temperature Sensor 4-20 mA Loop Powered device requires a minimum loop voltage of 8.0 volts, allowing the device to be powered using conventional 4-20 mA control signals. The factory default configuration connects the measured temperature to the 4-20 mA output signal.

| 4-20 mA Output Configuration | | | | | | | | |
|------------------------------|-------------|-------|--------------------|---------------|-----------|---------|----------|-----------|
| 7 | 6 | 5 | 4 | | 3 | 2 | 1 | 0 |
| | | | (| Output Config | guration | | | |
| | | | System Error | | High Rang | e Error | Low Ra | nge Error |
| 0 | 0 | 0 | 3.8 mA 0 | | 3.8 mA | 0 | 3.8 mA | 0 |
| 0 | 0 | 0 | 21.5 1 | | 21.5 mA | 1 | 21.5 m/ | 1 |
| | | | mA | | Pass-thru | 2 (3) | Pass-thr | u 2 (3) |
| 15 | 14 | 13 | 12 | | 11 | 10 | 9 | 8 |
| | Output Type | | | | | | | |
| Sen | sor Mapp | ing | Manning | | | | | |
| No Mappi | ng 0 | - - | Mapping Enabled | | | | | |
| Sensor (|) 1 | 0 0 | | | | Outp | out Type | |
| Sensor 1 | 1 1 | 0 1 | Not 0 Enabled | | 4-20 m/ | 0 | 1 0 | 0 |
| Sensor 2 | 2 1 | 1 0 | Enabled 1 | | | • | | |
| Sensor 3 | 3 1 | 1 1 | | | | | | |

9.5.1 High Range / Low Range

The High Range and Low Range configuration values determine what 4-20 mA signal is generated if the signal is above or below the specified input range. The pass-thru option indicates that the output signal is not clamped.

If the Measured Value exceeds the user-defined Input Maximum an *Over-Range* condition exists. The 4-20 mA output may be configured to generate a Fault High (21.5 mA) current or a Fault Low (3.8 mA) current when an Over Range condition occurs.

Similarly, if the Measured Value is less than the user-defined Input Minimum an *Under-Range* condition exists, and the output may be configured to generate either a Fault High or Fault Low output.

A Loop Error occurs if the applied voltage of the 4-20 mA loop drops below the specified minimum loop voltage and the output will be driven to a low Error level of ~ 3.5 mA.

9.5.2 System Error

The System Error setting defines whether the output is driven to a low current or high current if an internal system error occurs.

9.5.3 Output Type

The Output Type is fixed as a 4-20 mA output.

9.5.4 Mapping Enabled

If set, the read-only Mapping Enabled bit indicates that the output may be optionally directly mapped to a sensor input. If the Mapping Enabled bit is clear no mapping is supported, and the Sensor Mapping field is ignored.



9.5.5 Output Mapping

The Output Mapping value may select 'no mapping' or Sensor 0 through 3. If no mapping is selected the 4-20 mA output may be directly controlled by writing a value from 0 - 100 % (0 mA to 24 mA) to the internal Output Value. If a Sensor is selected the 4-20 mA output will be scaled to track the measured sensor value between the Scale Low and Scale High range.

If no sensor mapping is in place the output value is determined by the percent activation applied (0 – 100 %). For example, 50% excitation generates an output current of 12 mA, whereas an 75% activation generate an output of (75 / 100) * 24 mA == 18 mA.

9.5.6 Scaling Minimum/Maximum Values

When Sensor Mapping is used with the 4-20mA output, the user may specify the input signal range through the Scaling Minimum and Scaling Maximum parameters.

| Name | Modbus Address | I2C Address | Size | Description |
|-----------------|-------------------|----------------|-------|------------------------|
| Scaling Minimum | 0xf1f0 | 0x03e0 | float | Sets lower input range |
| Scaling Maximum | 0xf1f2 | 0x03e4 | float | Sets upper input range |



Note: Due to the Loop Power requirements specifying an output value below 15% (3.5 mA) will typically be clamped at 3.6 mA.

9.5.7 4-20 mA Loop Powered Error

A Loop Error occurs if the applied voltage of the 4-20 mA loop drops below the specified minimum loop voltage and the output will be driven to a low Error level of ~ 3.5 mA.

9.6 Digital Output Configuration

The Digital output option provides two output signals which may be configured for ON/OFF, PWM, or SERVO outputs through the Output Configuration registers. The remaining outputs are assigned as phantom devices which are non-configurable.



The highlighted entries show typical default configurations.

| Digital Output Configuration | | | | | | | | | | |
|------------------------------|-----------|-------------|--------------|----|---|-------|---------|-----|---|---|
| 7 | 6 | 5 | 4 | 3 | | 2 | 1 | | (|) |
| Output Configuration | | | | | | | | | | |
| | | | | | | | Ra | ate | | |
| | | | | | | 1 | .00 Hz | 0 | 0 | 0 |
| | | | | | | | 10 Hz | 0 | 0 | 1 |
| | | Servo Range | Active State | | | | 1 Hz | 0 | 1 | 0 |
| | | 1.0 – 2.0 0 | LOW 0 | | | (|).1 Hz | 0 | 1 | 1 |
| | | 0.5 – 2.5 1 | HIGH 1 | | | | 50 Hz | 1 | 0 | 0 |
| | | | | | | 3 | 33 Hz | 1 | 0 | 1 |
| | | | | | | 2 | 25 Hz | 1 | 1 | 0 |
| | | | | | | 2 | 20 Hz | 1 | 1 | 1 |
| 15 | 14 | 13 | 12 | 11 | | 10 | 9 | | 8 | 3 |
| | | | Output Type | | | | | | | |
| | | | | | | | | | | |
| Sor | nsor Mapp | ina | | | | | | | | |
| No Mapping | 0 | _ _ | Mapping | | | 0 | utput T | ype | | |
| Sensor 0 | 1 | 0 0 | Enable | | | Null | 0 | 0 | 0 | 0 |
| Sensor 1 | 1 | 0 0 | Not 0 | | 0 | N/OF | F 0 | 0 | 0 | 1 |
| Sensor 2 | 1 | 1 0 | Enabled | | | PWM | 0 | 0 | 1 | 0 |
| Sensor 3 | 1 | 1 1 | Enabled 1 | | (| Servo | 0 | 0 | 1 | 1 |
| 2611201.3 | 1 | т т | | | | | | | | |
| | | | | | | | | | | |

9.6.1 Rate

The Rate determines the repetition rate, or frequency, of the Digital Output. For On/Off outputs the rate field is ignored.

9.6.1.1 PWM Rate

The digital output supports the following PWM frequencies:

| PWM Rate | Name | Description |
|----------|--------|---|
| 0 | 100 ⊔- | PWM signal has constant 100 Hertz frequency (10 msec |
| 0 | 100 Hz | repetition rate) with 0 – 100 % duty cycle |
| , | 10 Hz | PWM signal has constant 10 Hertz frequency (100 msec |
| 1 | 10 HZ | repetition rate) with 0 – 100 % duty cycle |
| 0 | 1 11- | PWM signal has constant 1 Hertz frequency (1 sec repetition |
| 2 | 1 Hz | rate) with 0 – 100 % duty cycle |
| 2 | 0111- | PWM signal has constant 0.1 Hertz frequency (10 second |
| 3 | 0.1 Hz | repetition rate) with 0 – 100 % duty cycle |



9.6.1.2 SERVO Rate

Smart Sensor probes support the following SERVO frequencies:

| PWM Rate | Name | Description | |
|---|--------|---|--|
| 0 | 100 Hz | PWM signal has constant 100 Hertz frequency (10 msec repetition rate) with 0 – 100 % duty cycle | |
| 4 PWM signal has constant 50 Hertz frequency (20 repetition rate) with 0 – 100 % duty cycle | | | |

9.6.2 Output Type

Smart Sensor probes support NULL (0), ON/OFF (1), PWM (2) and SERVO (3) outputs. When set to NULL the output signal will be left in a high impedance state. When set to ON/OFF the Rate and Servo Range controls have no effect. When the SERVO type is selected the Duty-Cycle is restricted so the output signal is either 0.5 – 2.5 msec or 1.0 to 2.0 msec based on the Servo Range bit.

9.6.3 Active State

Smart Sensor digital outputs may be configured as Active HIGH or Active LOW. When set to 1 (Active High), the output will be high impedance when active. When set to 0 (Active Low), the output will be low impedance (~ 0.0 volts) when active. The Factory reset value is 0 (Low).

9.6.4 Mapping Enabled

The read-only Mapping Enabled bit indicates that the output may be optionally directly mapped to a sensor input based on the Sensor Mapping field. If the Mapping Enabled bit is clear no mapping is supported, and the Sensor Mapping field is ignored.

9.6.5 Output Mapping

The Output Mapping value may select 'no mapping' or any of Sensor 0..3. If no mapping is selected the output may be directly controlled by writing a value from 0-100% to the internal Output Value. If a Sensor is selected and the hardware supports the mapping the output will track the selected sensor value, scaled by the Output Minimum and Output Maximum values.

If Output Mapping is enabled for PWM outputs the scaling values are used such that a signal input at or below the Scaling Low-value results in a 0% output and a signal input at or above the Scaling High-value results in a 100% PWM duty cycle.

If Output Mapping is enabled for SERVO outputs the scaling values are used such that a signal input at or below the Scaling Low-value results in a minimum (0.5 or 1.0 msec) pulse width and a signal input at or above the Scaling High-value results in a maximum (2.0 or 2.5 msec) pulse width.

WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's WARRANTY adds an additional one (1) month grace period to the normal **one** (1) **year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components in which wear is not warranted, include but are not limited to contact points, fuses, and triacs.

OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by the company will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

RETURN REQUESTS/INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR **WARRANTY** RETURNS, please have the following information available BEFORE contacting OMEGA:

- 1. Purchase Order number under which the product was PURCHASED.
- 2. Model and serial number of the product under warranty, and
- 3. Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

- 1. Purchase Order number to cover the COST of the repair,
- 2. Model and serial number of the product, and
- 3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a trademark of OMEGA ENGINEERING, INC.

© Copyright 2019 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.

Where Do I Find Everything I Need for Process Measurement and Control? OMEGA...Of Course!

Shop online at omega.com

TEMPERATURE

☑ Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies

☑ Wire: Thermocouple, RTD & Thermistor

☑ Calibrators & Ice Point References

Recorders, Controllers & Process Monitors

☑ Infrared Pyrometers

PRESSURE, STRAIN AND FORCE

☑ Transducers & Strain Gages

Displacement Transducers

☑ Instrumentation & Accessories

FLOW/LEVEL

☑ Rotameters, Gas Mass Flowmeters & Flow Computers

Air Velocity Indicators

☑ Turbine/Paddlewheel Systems

☑ Totalizers & Batch Controllers

pH/CONDUCTIVITY

☑ Benchtop/Laboratory Meters

☑ Controllers, Calibrators, Simulators & Pumps

☑ Industrial pH & Conductivity Equipment

DATA ACQUISITION

☑ Data Logging Systems

Wireless Sensors, Transmitters, & Receivers

☑ Signal Conditioners

☑ Data Acquisition Software

HEATERS

Heating Cable

☑ Cartridge & Strip Heaters

☑ Immersion & Band Heaters

Flexible Heaters

Laboratory Heaters

ENVIRONMENTAL MONITORING AND CONTROL

✓ Metering & Control Instrumentation

Refractometers

✓ Pumps & Tubing

Air, Soil & Water Monitors

☑ Industrial Water & Wastewater Treatment