



Product Change Notification: SYST-22EELM397

Date:

29-May-2026

Product Category:

8-Bit Microcontrollers

Notification Subject:

PIC18F06/16Q41 Silicon Errata and Data Sheet Clarifications

Affected CPNs:

[SYST-22EELM397_Affected_CPN_05292026.pdf](#)

[SYST-22EELM397_Affected_CPN_05292026.csv](#)

Notification Text:

SYST-22EELM397
Microchip has released a new Document for the PIC18F06/16Q41 Silicon Errata and Data Sheet Clarifications of devices. If you are using one of these devices please read the document located at PIC18F06/16Q41 Silicon Errata and Data Sheet Clarifications. Notification Status: Final Description of Change: Added silicon errata issue 1.10.1. Impacts to Data Sheet: None Reason for Change: To Improve Productivity Change Implementation Status: Complete Date Document Changes Effective: 29 May 2026

Description of Change:

Added silicon errata issue 1.10.1.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 29 May 2026

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

PIC18F06/16Q41 Silicon Errata and Data Sheet Clarifications

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from

Affected Catalog Part Numbers (CPN)

PIC18F06Q41-E/SL

PIC18F06Q41-E/ST

PIC18F06Q41-I/SL

PIC18F06Q41-I/ST

PIC18F06Q41T-I/SL

PIC18F06Q41T-I/ST

PIC18F16Q41-E/SS

PIC18F16Q41-E/SO

PIC18F16Q41-E/P

PIC18F16Q41-E/REB

PIC18F16Q41-I/SS

PIC18F16Q41-I/SO

PIC18F16Q41-I/P

PIC18F16Q41-I/REB

PIC18F16Q41T-I/2LX

PIC18F16Q41T-I/SS

PIC18F16Q41T-I/SO

PIC18F16Q41T-I/REB

PIC18F16Q41T-E/2LX

Introduction

The PIC18F06/16Q41 devices you have received conform functionally to the current device data sheet (DS40002214G), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the table below.

The errata described in this document will be addressed in future revisions of the PIC18F06/16Q41 silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Table 1. Silicon Device Identification

Part Number	Device ID	Revision ID			
		A4	A5	A6	B1
PIC18F06Q41	0x7580	0xA004	0xA005	0xA006	0xA041
PIC18F16Q41	0x7560	0xA004	0xA005	0xA006	0xA041



Important: Refer to the **Device/Revision ID** section in the current **“PIC18-Q41 Family Programming Specification”** (DS40002143) for more detailed information on Device Identification and Revision IDs for a specific device.

Table 2. Silicon Issue Summary

Module	Feature	Item No.	Issue Summary	Affected Revisions			
				A4	A5	A6	B1
Analog-to-Digital Converter with Computation	ADCC	1.1.1	ADC cannot operate in certain low-power conditions	X			
		1.1.2	Double Sample Conversions	X	X	X	
Oscillator	XT mode	1.2.1	Maximum clock frequency limited to 2 MHz for XT mode	X			
	Fail-Safe Clock Monitor	1.2.2	Enabling the FOSC Fail-Safe Clock Monitor alongside the Primary or Secondary Oscillator Clock Monitor causes issues in Sleep	X			
	EC mode	1.2.3	Maximum clock frequency for EC mode is 32 MHz for $V_{DD} < 2.0V$	X			
I ² C	I ² C	1.3.1	I2CxADR0/1/2/3 registers have incorrect Reset value	X			
		1.3.2	I ² C Start and/or Stop Flags may be set when I ² C is enabled	X	X		
		1.3.3	MDR bit is not cleared after bus time-out	X	X	X	X
		1.3.4	Bus time-out not detected properly when External Host Clock stretches	X	X	X	X
		1.3.5	Clock Stretch Disable not working properly	X	X	X	X
		1.3.6	Bus time-out causes false Start/Stop	X	X	X	X
		1.3.7	CSTR bit is not cleared after bus time-out	X	X	X	X
	Multi-Host Mode	1.3.8	Operating in Multi-Host Mode will cause bus failures	X	X	X	X
Operational Amplifier	OPA	1.4.1	Charge Pump On Control (CPON) bit is reserved	X			
		1.4.2	Internal resistor ladder does not disconnect in Unity Gain mode	X			
Universal Asynchronous Receiver Transmitter	UART	1.5.1	UART TXDE signal may go low before the STOP bit has been entirely transmitted	X	X	X	
		1.5.2	Asynchronous 9-bit UART Address mode address mismatch	X	X	X	
Signal Measurement Timer	SMT	1.6.1	Reset Bit	X	X	X	
PIC18 CPU	FSR Shadow Registers	1.7.1	FSR Shadow Registers are not writable	X	X	X	
ICSP™	Low-Voltage Programming (LVP)	1.8.1	Low-Voltage Programming is not possible when V_{DD} is below BORV while BOR is enabled	X	X	X	
Instruction Set	PUSHL Instruction	1.9.1	The PUSHL instruction incorrectly executes	X	X	X	X
Memory	DIA	1.10.1	The TSLR2 and TSHR2 Values Stored in the DIA Table are Incorrect	X	X	X	X
Note: Only those issues indicated in the last column apply to the current silicon revision.							

1. Silicon Errata Issues

NOTICE

This document summarizes all silicon errata issues from all revisions of silicon, previous and current. Only the issues indicated by the bold font in the following tables apply to the current silicon revision.

1.1. Module: Analog-to-Digital Converter with Computation (ADCC)

1.1.1. ADC Cannot Operate in Certain Low-Power Conditions

The ADC will not function when all of the following conditions exist: When the MCU system clock is sourced from LFINTOSC or SOSC and when both the BOR and FVR features are disabled.

Work around

- Method 1: Use a system clock other than LFINTOSC or SOSC.
- Method 2: Enable the BOR feature.
- Method 3: Enable the FVR feature.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.1.2. Double Sample Conversions

When enabling a Double Sample Conversion ($DSEN = 1$) with no precharge time ($ADPRE = 0$) and no acquisition time ($ADACQ = 0$), the maximum number of cycles of acquisition time is inserted prior to the second conversion. The first conversion will be performed as expected with no precharge time and no acquisition time. It is only between the first and second conversions where a maximum number of cycles of acquisition time are performed unexpectedly.

Work Around

Method 1:

Disable Double Sample Conversion ($DSEN = 0$) and perform two single conversions back to back.

Method 2:

If adding acquisition time is acceptable, then select no precharge time along with the desired acquisition time.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.2. Module: Oscillator (OSC)

1.2.1. Maximum Clock Frequency Limited to 2 MHz for XT Mode

The maximum clock frequency for the intermediate gain setting that supports quartz crystal and ceramic resonator operation (XT mode) is being reduced from 4 MHz to 2 MHz.

Work around

For crystal or resonator frequencies above 2 MHz, use HS mode.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.2.2. Enabling the FOSC Fail-Safe Clock Monitor Alongside the Primary or Secondary Oscillator Clock Monitor Causes Issues with Sleep

When the FOSC Fail-Safe Clock Monitor is enabled (FCMEN Configuration bit = 1) and either the Primary or Secondary Fail-Safe Clock Monitor is also enabled (FCMENS and/or FCMENP = 1), putting the device to Sleep will cause a Fail-Safe condition to trigger. This has the effect of erroneously triggering Fail-Safe interrupts when there has not been a clock interruption. This can also cause the Watchdog Timer to not properly wake up the part from Sleep.

Work around

If proper functionality in Sleep is required, do not enable the Primary or Secondary Fail-Safe Clock Monitor while the FOSC Fail-Safe Clock Monitor is enabled. If Primary or Secondary Clock Monitoring in Sleep is desired, disable the FOSC Fail-Safe Clock Monitor before the device goes to Sleep.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.2.3. Maximum Clock Frequency for EC Mode Is 32 MHz for $V_{DD} < 2.0V$

When configured in External Clock High-Power (ECH) mode and operating at $V_{DD} < 2.0V$, the maximum input clock frequency is 32 MHz.

Work around

To obtain a system clock frequency of 64 MHz in ECH mode at $V_{DD} < 2.0V$, use a 16 MHz external clock in conjunction with the 4x Phase-Locked Loop (PLL) circuit (i.e., either RSTOSC Configuration bits = 0b010 or OSCCON1bits.NOSC = 0b010).

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.3. Module: Inter-Integrated Circuit (I²C)

1.3.1. The I2CxADR0/1/2/3 Registers Have Incorrect Reset Value

The I2CxADR0/2 registers reset to 0xFF when the I2CxMD is enabled instead of 0x00. The I2CxADR1/3 registers reset to 0xFE when the I2CxMD is enabled instead of 0x00.

Work around

None.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.3.2. The I²C Start and/or Stop Flags May Be Set When I²C Is Enabled

When I²C is enabled, erroneous Start and/or Stop conditions may be detected. This can generate erroneous I²C interrupts, if enabled.

Work Around

Use the following procedure to correctly detect the Start and Stop conditions:

1. Disable the Start and Stop conditions interrupt functions.
2. Enable the I²C module.
3. Wait 250 ns + six instruction cycles ($F_{OSC}/4$).
4. Clear the Start and Stop conditions interrupt flags.
5. Enable the Start and Stop conditions interrupt functions, if used.

```
I2CxPIEBits.SCIE = 0;      // Disable Start condition interrupt
I2CxPIEBits.PCIE = 0;      // Disable Stop condition interrupt
I2CxCON0bits.EN = 1;       // Enable I2C
Delay();                   // Wait for 250 ns + 6 instruction cycles (FOSC/4)
I2CxPIRbits.SCIF = 0;      // Clear the Start condition interrupt flags
I2CxPIRbits.PCIF = 0;      // Clear the Stop condition interrupt flags
I2CxPIEBits.SCIE = 1;      // Enable Start condition interrupt if used
I2CxPIEBits.PCIE = 1;      // Enable Stop condition interrupt if used
```

Affected Silicon Revisions

A4	A5	A6	B1
X	X		

1.3.3. MDR Bit Is Not Cleared after Bus Time-Out

In the Host mode of the I²C module, when a bus time-out occurs during clock stretching and TOREC = 1, the MDR bit will not be cleared and a Stop will not be transmitted on the bus.

Work around

Force a Stop on the bus by setting the P bit upon bus time-out in Host mode. Forcing a Stop on the bus clears the MDR bit.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.3.4. Bus Time-Out Not Detected Properly When External Host Clock Stretches

When the module is operating in Client mode and an external Host device is clock stretching after the 8th SCL clock and a bus time-out occurs, the bus time-out is not detected properly. When the external Host times out before the Client and releases SCL to generate a Stop condition, the module continues to stretch SDA as if to generate an ACK and hangs the bus, and a Stop is never seen on the bus.

Work around

Reset the module by toggling the EN bit.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.3.5. Clock Stretch Disable Not Working Properly

When the CSD bit is set between a Start condition and the 8th falling SCL edge, the I²C module enters a state where the module clock stretches indefinitely after the next Start until a bus time-out occurs.

Work around

Force a reset of the module by toggling the EN bit.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.3.6. Bus Time-Out Causes False Start/Stop

When the module is operating in Client mode and an external Host device is clock stretching, and a bus time-out occurs in the Client, the Client releases SDA and goes into the idle state. After the external Host generates a Stop condition on the bus by releasing SCL, the module can erroneously drive a low pulse on the SDA line, which acts as a false Start and Stop on the bus.

Work around

None.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.3.7. CSTR Bit Is Not Cleared after Bus Time-Out

When the module is operating in Client mode and TOREC = 1, and a bus time-out occurs during clock stretching, the CSTR bit will not be cleared, and the module continues to clock stretch and hang the bus.

Work around

Reset the I²C module by toggling the EN bit.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.3.8. Operating in Multi-Host Mode Will Cause Bus Failures

If operating in Multi-Host mode and a second host drives SDA low at the same time the Start bit is generated, the module will fail to go into Host mode but will continue to send an address and data as if it won arbitration. I2CCNT fails to decrement, and the module will remain in this state until a bus time-out occurs or the device is reset.

Work around

None.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.4. Module: Operational Amplifier

1.4.1. The Charge Pump On Control (CPON) Bit Is Reserved

When not operating the OPA near the rails, the Charge Pump On Control (CPON) bit can be used to disable the charge pump in order to save on current consumption. This feature is currently not available, and the charge pump is always enabled whenever the OPA module is in operation.

Work around

None.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.4.2. Internal Resistor Ladder Does Not Disconnect in Unity Gain Mode

When using the OPA module in a unity gain configuration, the internal resistor ladder will not automatically disconnect from the operational amplifier, which may adversely affect the gain of the circuit. This applies when the peripheral has been configured to operate in Unity Gain mode in software by setting the UG bit, or in hardware using the hardware controlled override feature.

Work around

Disconnect the internal resistor ladder from the operational amplifier by writing to the Inverting Input Channel Selection (NCH) bits. All signals can be disconnected from the operational amplifier by writing 0b000 to the NCH bits.

Affected Silicon Revisions

A4	A5	A6	B1
X			

1.5. Module: Universal Asynchronous Receiver Transmitter (UART)


1.5.1. UART TXDE Signal May Go Low Before the STOP Bit Has Been Entirely Transmitted

The UART Transmit Drive Enable (TXDE) signal could potentially transition into a low state before the UART Stop bit has been entirely transmitted due to the effects of parasitic capacitance on the TX line. In some applications, this could result in communication being prematurely terminated due to the TXDE signal going low before the STOP bit has had enough time to settle.

Work Around

To ensure that the Stop bit settles into its final logic state before the TXDE signal transitions low, a biasing circuit can be implemented. A biasing circuit allows the TX line to either be driven high or low, rather than being left in a floating tri-state mode, where prolonged rise or fall times could lead to communication being disrupted. This bias circuit must only be implemented on one end of the serial bus, and a termination resistor must be used on the other end. The figure below shows an example of a bias circuit that can be used to achieve this.

Please note that the resistor values used in this circuit are recommendations and that the actual resistor values required may vary based on the application.

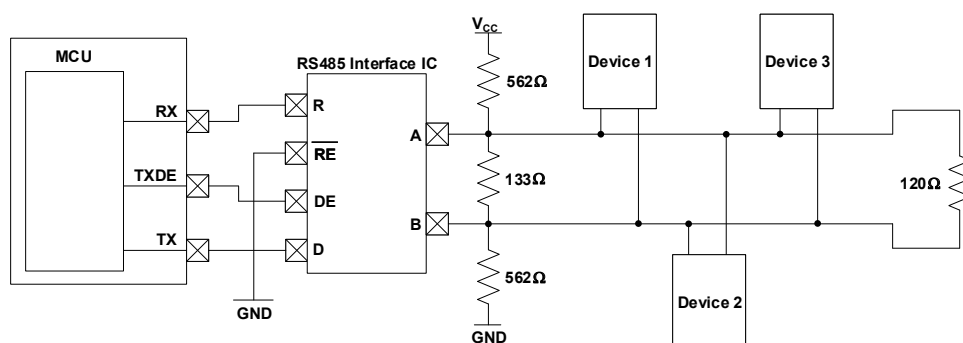

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.5.2. Asynchronous 9-bit UART Address Mode Address Mismatch

In Asynchronous 9-bit UART Address mode, there is the possibility that a false address mismatch may occur even when the address of both devices match, or that a false address match may occur when there is an address mismatch between the devices.

Work around

None. Do not use the UART modules in Asynchronous 9-bit Address Mode.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.6. Module: Signal Measurement Timer (SMT)

1.6.1. Reset Bit

If the SMT clock prescaler is set to any value other than '00', setting the RST bit will cause the module to stop working. The RST bit will remain at the value '1', the counter will not increment, and no interrupts will be generated. The problem is cleared by turning the module off and on or by performing a device reset.

Work Around

Method 1:

Do not set the RST bit; manual reset is usually not required for typical operation because the measurement logic will reset the counter automatically.

Method 2:

Write zero to the counter manually. Either disable the module or the clock before using this method.

Method 3:

Use 1:1 prescaler (PS = 00).

Method 4:

Use the CLKREF subsystem to provide a prescaled clock and set PS = 00.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.7. Module: PIC18 Core

1.7.1. FSR Shadow Registers Are Not Writable

Writing to the FSR shadow registers does not result in accurate values being stored in the registers. Consequently, reading the FSR shadow registers after they have been written will return inaccurate data.

Work Around

Writes to the FSR shadow registers can be performed safely using the following steps:

1. Save regular FSR2 value into RAM.
2. Write the regular FSR2 with the targeted value minus the computed offset (IR[6:0] + 1, see below).
3. Write the shadow FSRxL (data doesn't matter); this will clock the shadow FSR with the FSR computed offset value.

4. Decrement FSR2 value by 1, since FSRxH increments the address by 1 (IR[6:0]).
5. Write FSRxH.
6. Restore the regular FSR2 from the stored RAM value.

The FSR shadow will have the desired value and the regular FSR will have the original value.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.8. Module: Low-Voltage Programming (LVP)

1.8.1. Low-Voltage Programming Not Possible

Low-Voltage Programming is not possible when V_{DD} is below the selected BORV voltage level while BOR is enabled.

Work Around

Method 1:

Disable BOR to use Low-Voltage Programming.

Method 2:

Raise V_{DD} above the selected BORV level while using Low-Voltage Programming.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	

1.9. Module: Instruction Set

1.9.1. The PUSHL Instruction Executes Incorrectly

The PUSHL instruction of the PIC18 Extended Instruction Set incorrectly executes when FSR2 is loaded with certain values.

Work Around

Do not use PUSHL when FSR2 is loaded with any of the following values:

- 0xDB
- 0xDC
- 0xDE
- 0xE3
- 0xE4
- 0xE6
- 0xEB
- 0xEC
- 0xEE

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

1.10. Module: Memory

1.10.1. The TSLR2 and TSHR2 Values Stored in the DIA Table Are Incorrect

The Temperature Indicator Low Range (TSLR2) and Temperature Indicator High Range (TSHR2) measurement values stored in the Device Information Area (DIA) in Program Memory are incorrect and should not be used to calculate the device die temperature.

Work Around

The following steps can be used to measure the die temperature (T_{MEAS}):

1. Place the device in a temperature-controlled environment and allow the device to reach the desired steady-state temperature.
2. Ensure that the device operating voltage (V_{DD}) is 3.0V, and the ADC positive reference voltage (V_{REF+}) is 2.048V (the Gain and Offset values of the DIA table are measured with these parameters).
3. Obtain the ADC count value of the measured analog voltage: The analog output voltage, V_{MEAS} , is converted to a digital count value by the Analog-to-Digital Converter (ADC) and is referred to as ADC_{MEAS} .
4. Obtain the Gain value from the DIA table. This parameter is TSLR1 for the low range setting or TSHR1 for the high range setting of the temperature indicator module.
5. Obtain the Offset value from the DIA table. This parameter is TSLR3 for the low range setting or TSHR3 for the high range setting of the temperature indicator module.

The following equation provides an estimate for the die temperature based on the above parameters:

Equation 1-1. Die Temperature (in °C)

$$T_{MEAS} = \frac{\frac{(ADC_{MEAS} \times Gain)}{256} + Offset}{10}$$

Where:

ADC_{MEAS} = ADC reading at temperature being measured

Gain = Gain value stored in the DIA table

Offset = Offset value stored in the DIA table

Note: It is recommended to take the average of ten measurements of ADC_{MEAS} to reduce noise and improve accuracy.

Affected Silicon Revisions

A4	A5	A6	B1
X	X	X	X

2. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40002214G):

Note:

Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

2.1. Interrupt Vector Priority Table

Table 11-2 incorrectly states the vector numbers for CWG1, NCO1, DMA2SCNT, DMA2DCNT, DMA2OR, and DMA2A. The corrected values are shown below with changes highlighted in **bold**:

Table 2-1. Interrupt Vector Priority Table

Vector Number	Interrupt source	Vector Number (cont.)	Interrupt source (cont.)
0x0	Software Interrupt	0x2D	CLC2
0x1	HLVD (High/Low-Voltage Detect)	0x2E	PWM2PR
0x2	OSF (Oscillator Fail)	0x2F	PWM2
0x3	CSW (Clock Switching)	0x30	INT1
0x4	NVM	0x31	-
0x5	CLC1 (Configurable Logic Cell)	0x32	CWG1 (Complementary Waveform Generator)
0x6	CRC (Cyclic Redundancy Check)	0x33	NCO1 (Numerically Controlled Oscillator)
0x7	IOC (Interrupt-On-Change)	0x34	DMA2SCNT
0x8	INT0	0x35	DMA2DCNT
0x9	ZCD (Zero-Cross Detection)	0x36	DMA2OR
0xA	AD (ADC Conversion Complete)	0x37	DMA2A
0xB	ACT (Active Clock Tuning)	0x38	I2C1RX
0xC	CM1 (Comparator)	0x39	I2C1TX
0xD	SMT1 (Signal Measurement Timer)	0x3A	I2C1
0xE	-	0x3B	I2C1E
0xF	SMT1PWA	0x3C	-
0x10	ADT	0x3D	CLC3
0x11 - 0x13	-	0x3E	PWM3PR
0x14	DMA1SCNT (Direct Memory Access)	0x3F	PWM3
0x15	DMA1DCNT	0x40	U2RX
0x16	DMA1OR	0x41	U2TX
0x17	DMA1A	0x42	U2E
0x18	SPI1RX (Serial Peripheral Interface)	0x43	U2
0x19	SPI1TX	0x44	-
0x1A	SPI1	0x45	CLC4
0x1B	TMR2	0x46	-
0x1C	TMR1	0x47	SCAN
0x1D	TMR1G	0x48	U3RX
0x1E	CCP1 (Capture/Compare/PWM)	0x49	U3TX
0x1F	TMR0	0x4A	U3E
0x20	U1RX	0x4B	U3
0x21	U1TX	0x4C	DMA3SCNT
0x22	U1E	0x4D	DMA3DCNT
0x23	U1	0x4E	DMA3OR
0x24	TMR3	0x4F	DMA3A
0x25	TMR3G	0x50	INT2
0x26	PWM1PR	0x51	-
0x27	PWM1	0x52	-

Table 2-1. Interrupt Vector Priority Table (continued)

Vector Number	Interrupt source	Vector Number (cont.)	Interrupt source (cont.)
0x28	SPI2RX	0x53	TMR4
0x29	SPI2TX	0x54	DMA4SCNT
0x2A	SPI2	0x55	DMA4DCNT
0x2B	-	0x56	DMA4OR
0x2C	CM2 (Comparator)	0x57	DMA4A

3. Appendix A: Revision History

Doc Rev.	Date	Comments
H	05/2026	Added silicon errata issue 1.10.1.
G	03/2025	Added silicon errata issue 1.9.1; added DS Clarifications 2.1; updated DS revision letter.
F	08/2023	Added Silicon Revision B1. Added silicon errata items 1.3.3, 1.3.4, 1.3.5, 1.3.6, 1.3.7, 1.3.8 and 1.8.1.
E	04/2022	Updated the flash memory cell endurance specification data sheet clarification. Added silicon errata item 1.7.1.
D	02/2022	Added silicon revision A6. Added silicon errata items 1.1.2, 1.3.2, 1.5.1 and 1.6.1.
C	11/2020	Added silicon revision A5.
B	08/2020	Added silicon errata item 1.5.1.
A	06/2020	Initial document release.

Microchip Information

Trademarks

The “Microchip” name and logo, the “M” logo, and other names, logos, and brands are registered and unregistered trademarks of Microchip Technology Incorporated or its affiliates and/or subsidiaries in the United States and/or other countries (“Microchip Trademarks”). Information regarding Microchip Trademarks can be found at <https://www.microchip.com/en-us/about/legal-information/microchip-trademarks>.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP “AS IS”. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP’S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer’s risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip products are strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is “unbreakable”. Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Product Page Links

[PIC18F06Q41](#), [PIC18F16Q41](#)