

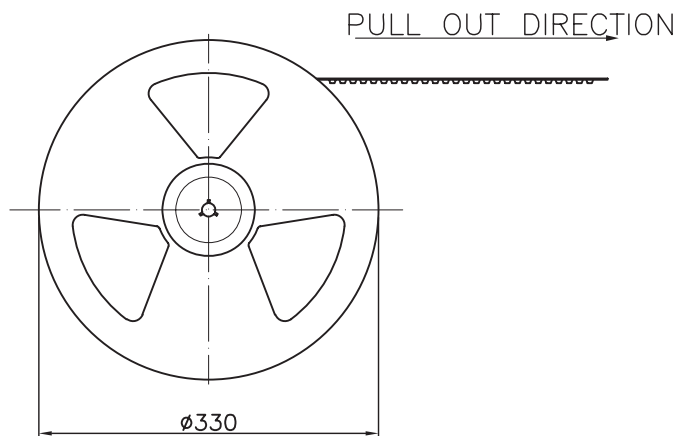



RoHS Compliant		*NOTE: theoretical value related to the Tin plating; however, due to the sensitive actuator, we recommend not to make more than 1 or 2 cycles in order to maintain acceptable mechanical & electrical conditions									
				PROJECTION: 	GENERAL TOLERANCE .X = +/- 0.2 .XX = +/- 0.15	 WÜRTH ELEKTRONIK					SIZE
M	05-JUN-15	TPK REVIEW	AK								
L	13-DEC-13	TPK UPDATE	QL								
K	10-APR-13	ACTUATOR	AR								
J	23-JAN-13	UNIT $\mu \Rightarrow \mu$ "	QL	APPROVAL: GMo	UNIT: MM	DESCRIPTION: 1.0MM ZIF FPC HORIZONTAL TOP CONTACT TYPE - TAPE & REEL PACKAGING					A4
I	18-SEP-12	MC NOTE	GG		SCALE:						
H	13-DEC-10	COPLANARITY	GG		SHEET: 1/2	WERI PART NO: 686 1xx 141 22					
REV	DATE	FILE	BY		DRAW: AK						

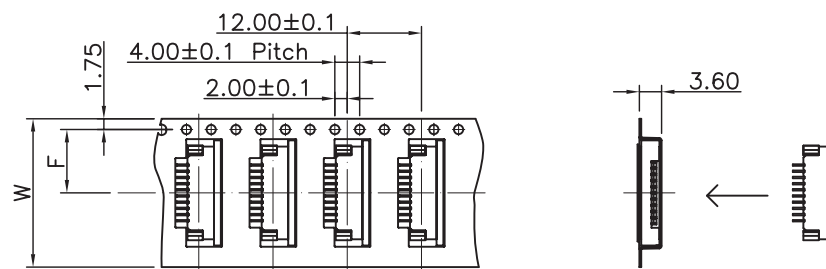


PART-NO.	4-9PIN	10-14PIN	15-26PIN	27-30PIN
W	24.00	32.00	44.00	56.00
F	11.50	14.20	20.20	26.20
S0	— —	28.40	40.40	52.40

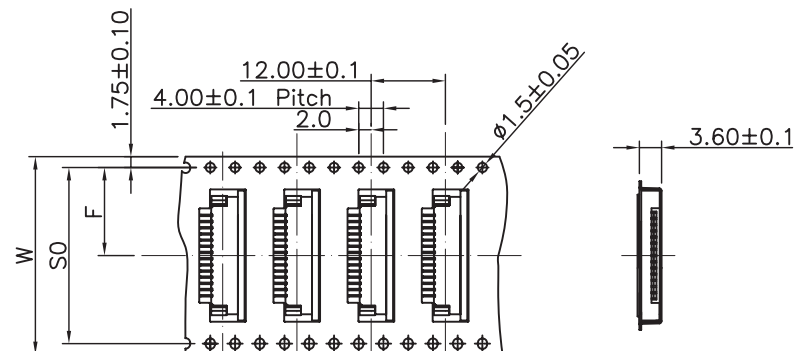


RoHS Compliant				PROJECTION: 	GENERAL TOLERANCE .X = ± 0.2 .XX = ± 0.15	 WÜRTH ELEKTRONIK	DESCRIPTION: 1.0MM ZIF FPC HORIZONTAL TOP CONTACT TYPE - TAPE & REEL PACKAGING WERI PART NO: 686 1xx 141 22	SIZE A4
G								
F								
E								
D								
C				APPROVAL: GMo	UNIT: MM			
B					SCALE:			
A					SHEET: 2/2			
REV	DATE	FILE	BY		DRAW: AK			

①

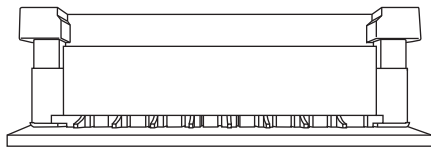


②

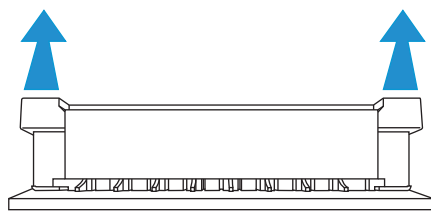


Pull the actuator upwards in the open position

Ⓐ

①

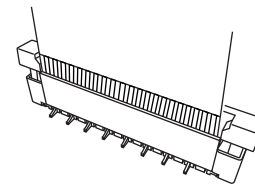

②

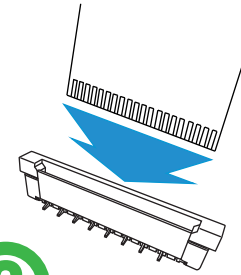


Insert the FFC cable vertically until the conductor almost disappears

Ⓑ




Press actuator in the middle to make there is no gap and the actuator is locked


①

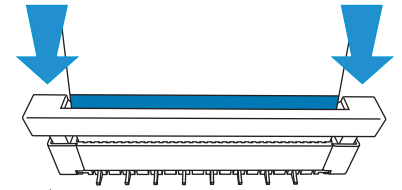



②

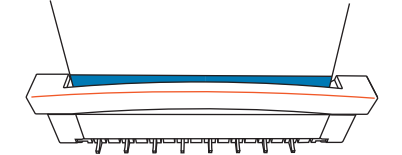

Press both ends of the actuator

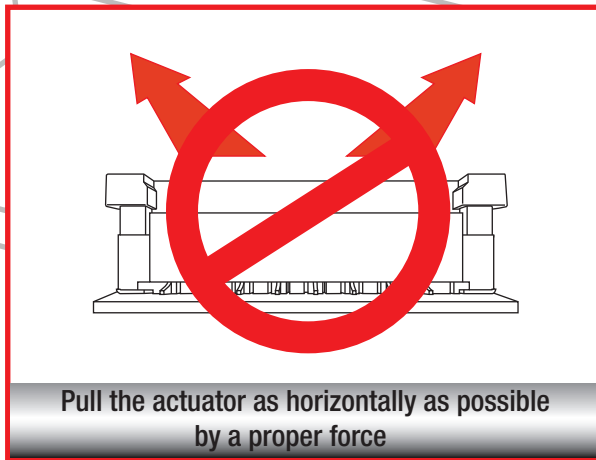

A

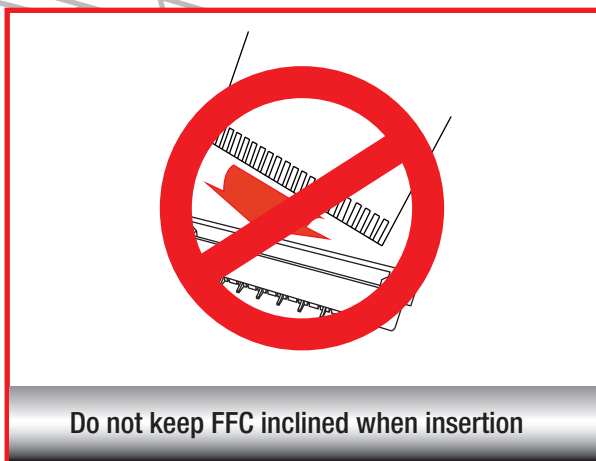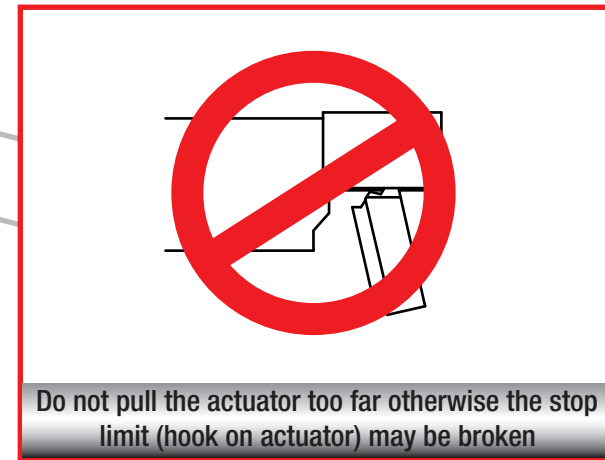

B

