
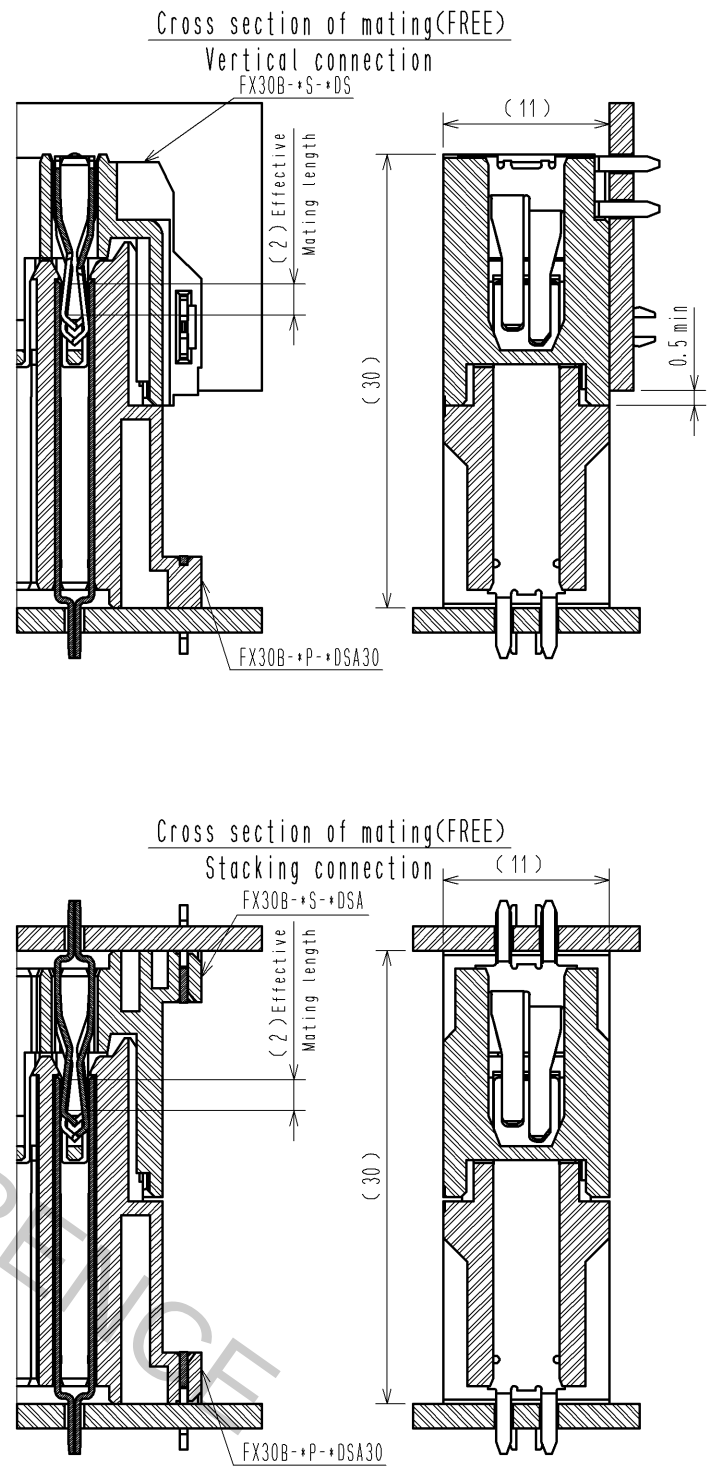



Oct.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case that the application demands a high level of reliability, such as automotive,
please contact a company representative for further information.

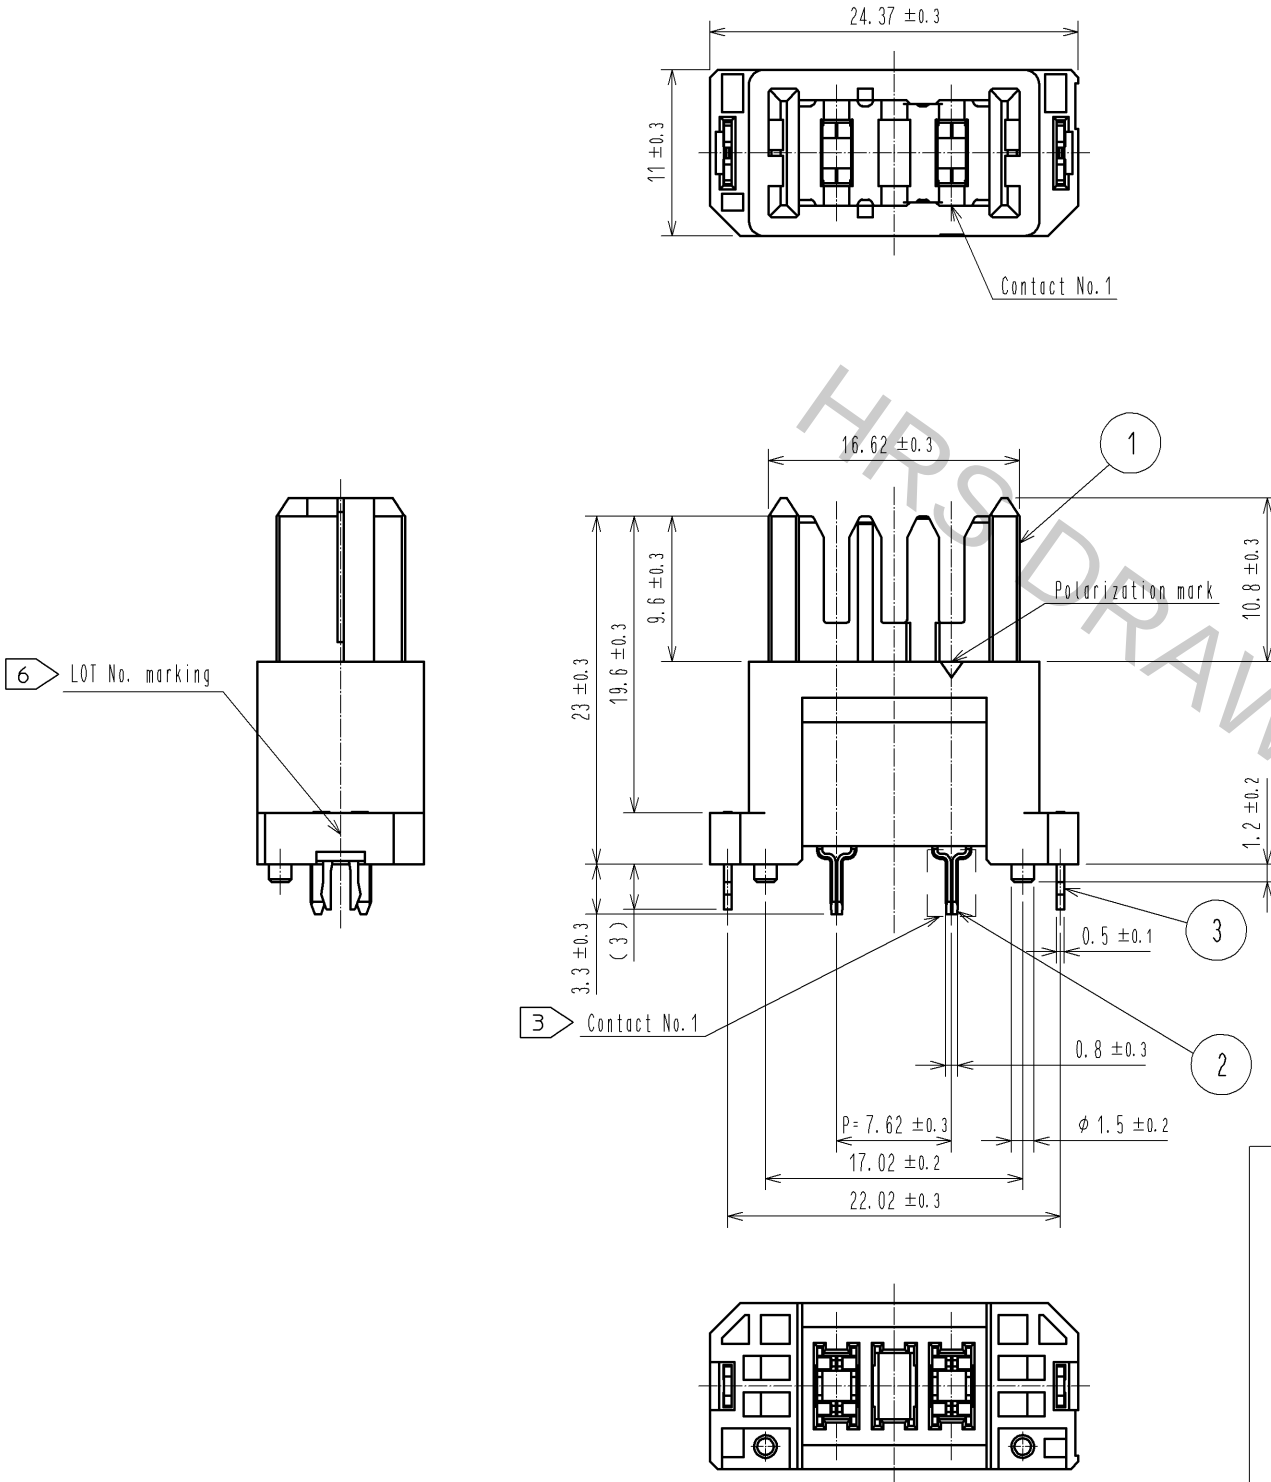

- NOTE
- 1 This product is packaged in tray. (42pcs/tray)
 - 2 Blemish and hit mark can be occurred through out the manufacturing process which dosen' t affect quality level.
Also, black spot could be observed on the surface of housing.
 - 3 For the contact NO., adjacent two pairs of leads placed back-to-back (4 leads in total) Compose one line.
 - 4 Misalignment absorbing range: ±0.3mm max.
 - 5 The dimension in parentheses are for references.
 - 6 Lot NO. is indicated at either one of the position as shown.

2	Copper alloy	Contact area:Gold-plating 0.1μm	4	Polystyrene	
		Lead area:Tin-plating 1.0μm			
		Under plating:Nickel 1.0μm			
1	Polyamide	Black UL94V-0	3	Phosphor bronze	Tin-plating 3.0μm
NO. MATERIAL		FINISH , REMARKS	NO. MATERIAL		FINISH , REMARKS
UNITS mm		SCALE 2 : 1	COUNT		DESCRIPTION OF REVISIONS
DESIGNED		CHECKED		DATE	
APPROVED : HS. OKAWA		14. 09. 12		DRAWING NO.	
CHECED : KN. SHIBUYA		14. 09. 12		PART NO.	
DESIGNED : DK. AIMOTO		14. 09. 12		CODE NO.	
DRAWN : DK. AIMOTO		14. 09. 12		CL570-3304-3-00	
HRS HIROSE ELECTRIC CO., LTD.		EDC3-359161-00		FX30B-2P-7. 62DSA30	
				1/2	

Oct.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case that the application demands a high level of reliability, such as automotive,
please contact a company representative for further information.

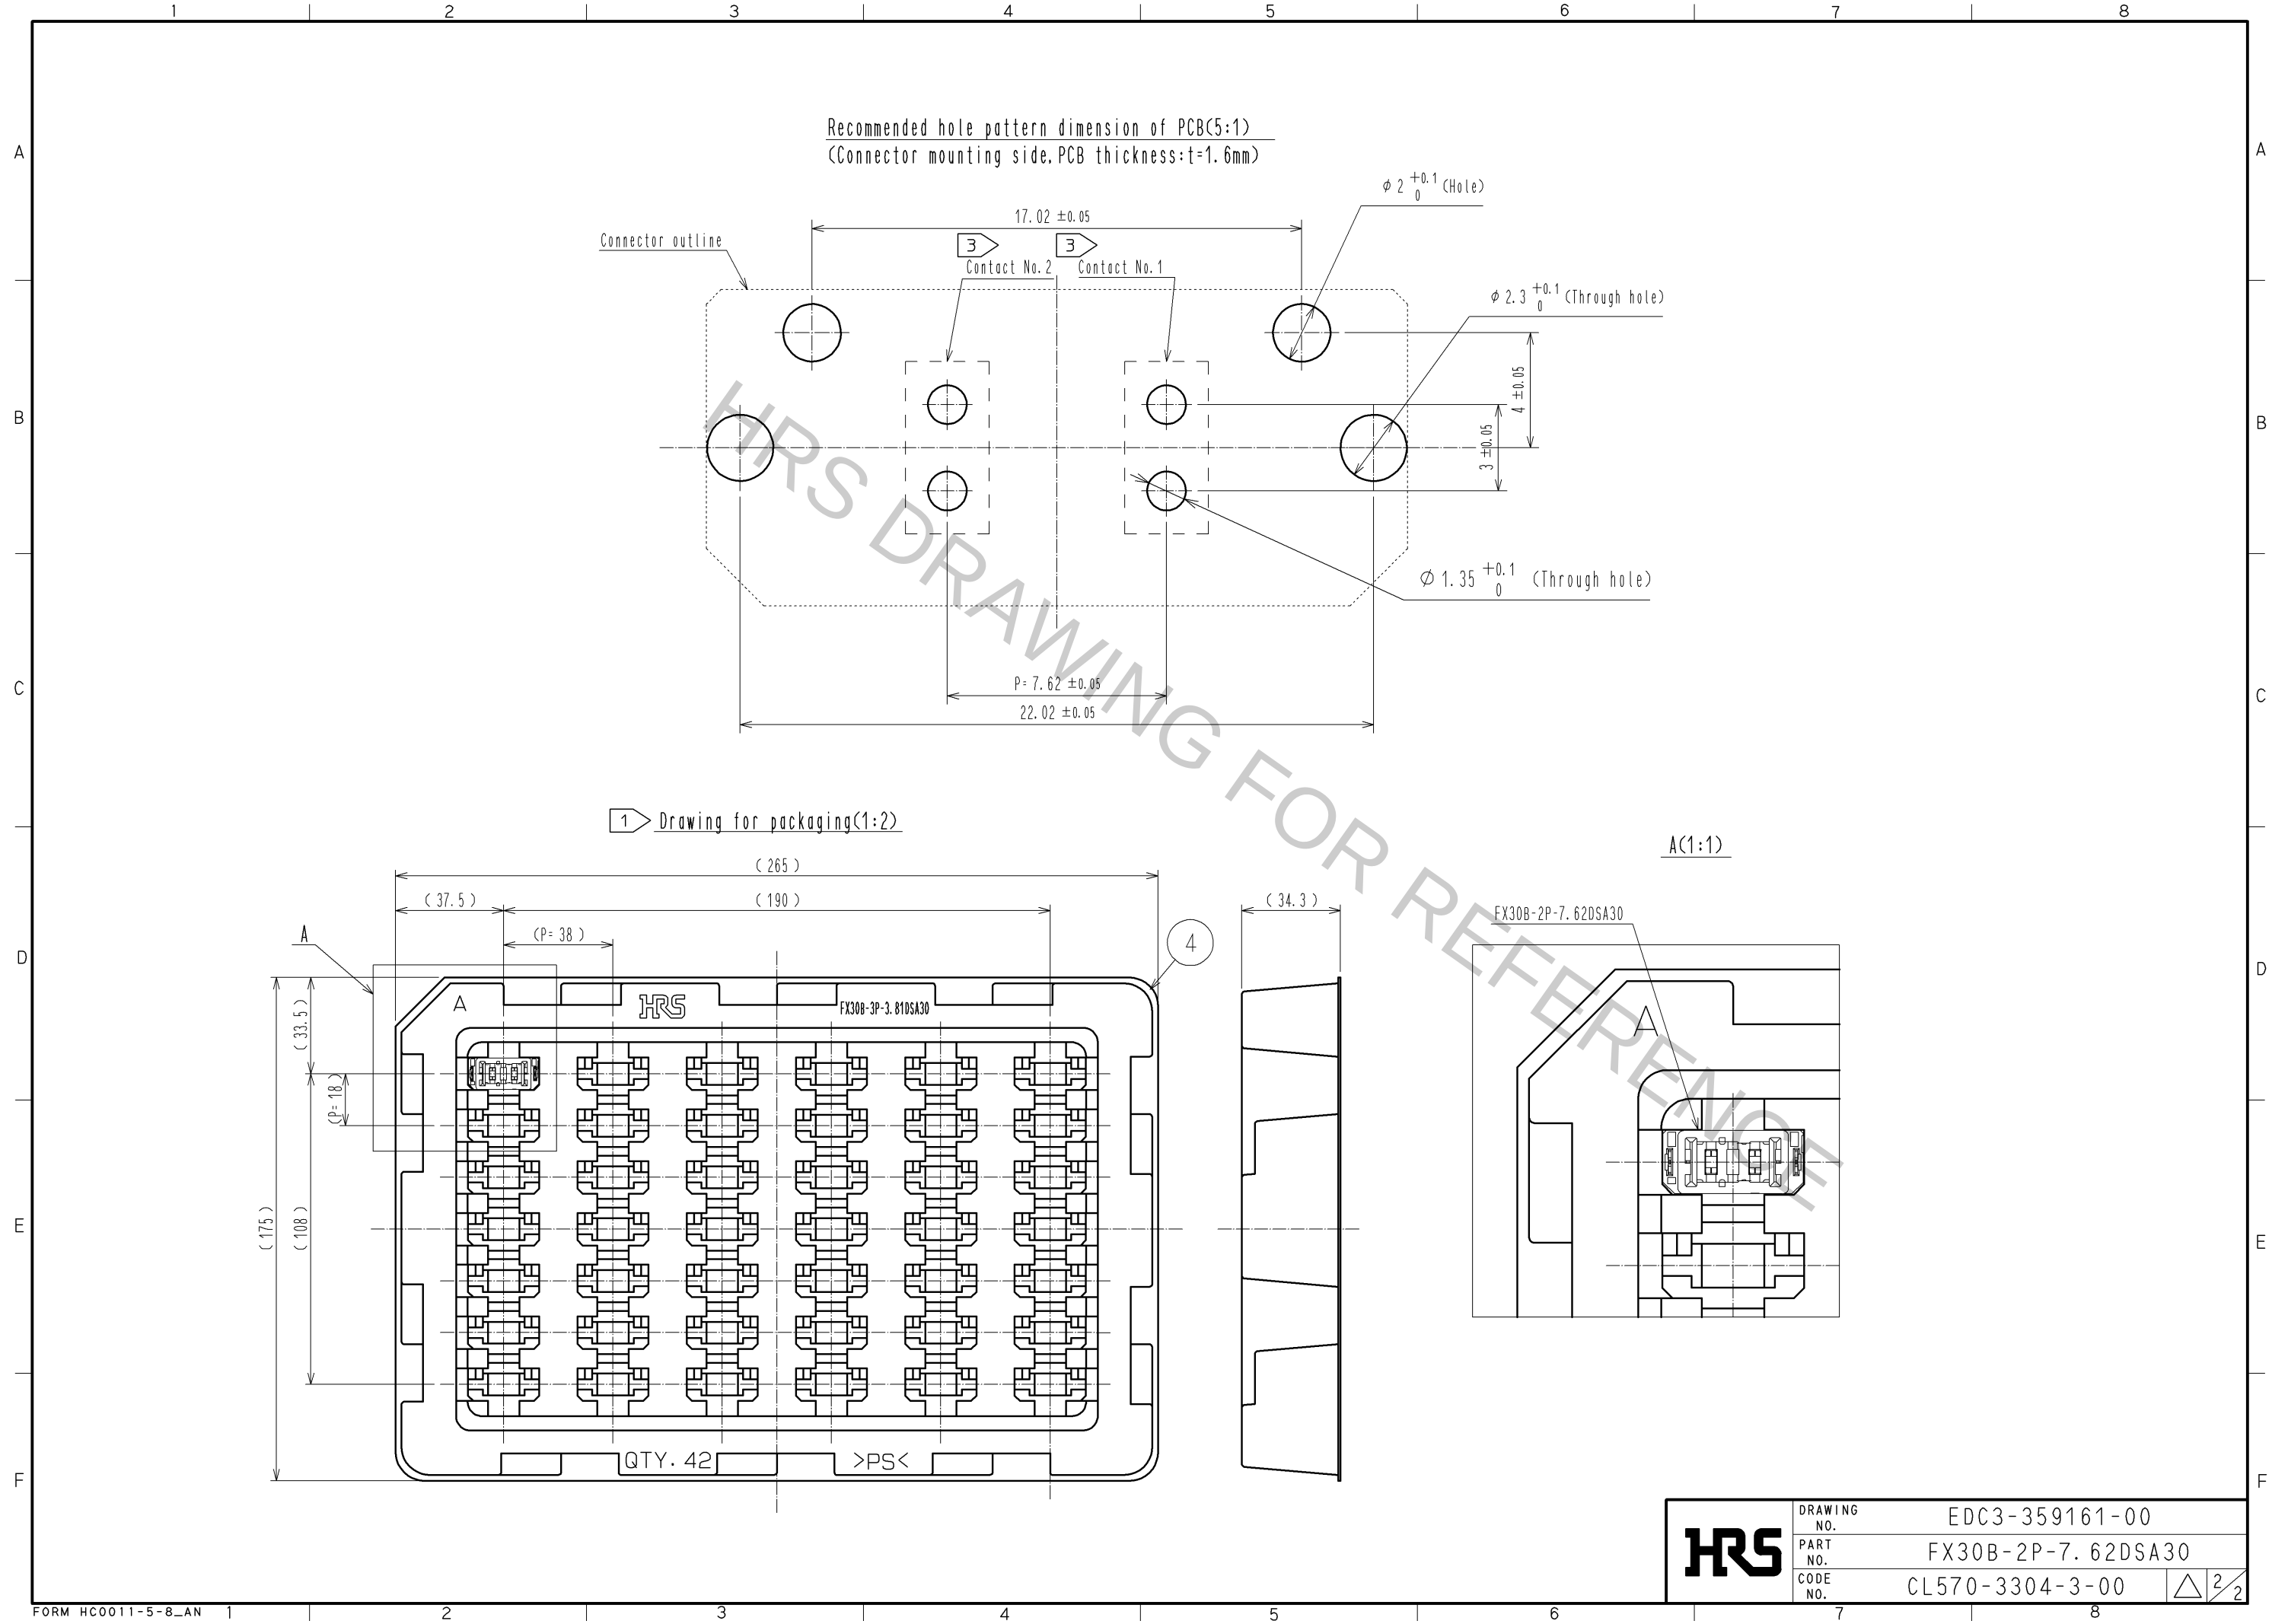

HRS	DRAWING NO.	EDC3-359161-00
	PART NO.	FX30B-2P-7.62DSA30
	CODE NO.	CL570-3304-3-00
		$\triangle$ 2/2