

### 1 Products affected

Product hierarchy no. *			archy no. *	Part no.	SBU	Type / Description	Customer part no.	
ſ	SBU PG	PGU	Туре					
	02 007	003	0000002298	See list below	Appliance Inlet	4798		
	*SRL(2 digit) / PG (3 digit) / PGL(3 digit) / Type (10 digit)							


List of part numbers affected							
4798.9000	4798.9100	4798.9200	4798.9000.15	4798.9000.21			
4798.9100.15	4798.9100.21	4798.9200.15	4798.9200.21				

### 2 Type of change

Change of material, V-Lock cord retaining feature as standard.

## 3 Detailed description of change

- Material change from PA6 to PA66/6 to pass the enhanced requirements of glow wire test acc. to IEC 60695-2-12 and -13
- V-Lock feature integrated as standard (not an option anymore)
- Flange will have a new form on the back side to improve molding process.

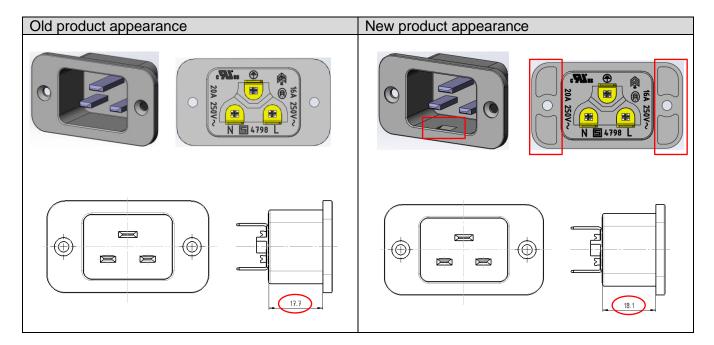

As the V-Lock notch and material for enhanced glow wire tests will be standard features, the material numbers with index .15 and .21 are obsolete and will be replaced by the standard numbers:

# 4 Reason of change

- Change of material
- V-Lock feature implemented as a standard feature.

Product Change Notification					PCN 4798			
owner	creation date	release date	released by	change order no	rev	page	0440 0222	
hotzar	2015-12-05	2016-03-14	stadelt1	2009470	Α	1 of 2	0118.2322	



### 5 Release date

The change takes effect in ww 15/2016 (Date code 1615 or higher on label).

# 6 Impact of change and recommended action

Form Yes Yes Socket has notch for V-Lock cord retaining, flange new form on

the back side, extended socket dimension.

Fit Yes Yes, installation depth is 0.4 mm extended.

Function Yes V-Lock feature is standard (not an option anymore)

Production Site No There is no change of the production site

Product Label No No label change

Customer Action No Check installation depth in the application.

Change SCHURTER part number if affected.

### 7 Reference Documents / Attachments

Kind of document	Remarks
Data Sheet 4798	

Product Change Notification					PCN 4798			
owner	creation date	release date	released by	change order no	rev	page	0440 0222	
hotzar	2015-12-05	2016-03-14	stadelt1	2009470	Α	2 of 2	0118.2322	