

1 Products affected

Product hierarchy no. *				Part no.	SBU	Type / Description	Customer part no.
SBU	PG	PUG	Type				
02	006	016	0000001504	See list below	Power Entry Modules w. Filter	5200	

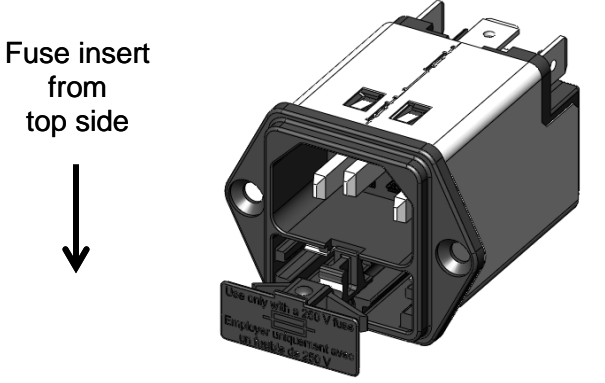
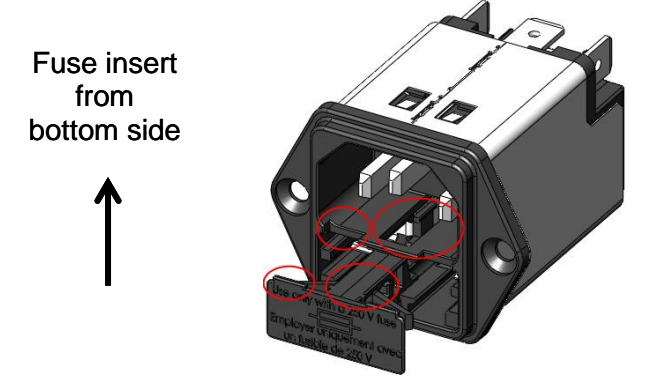
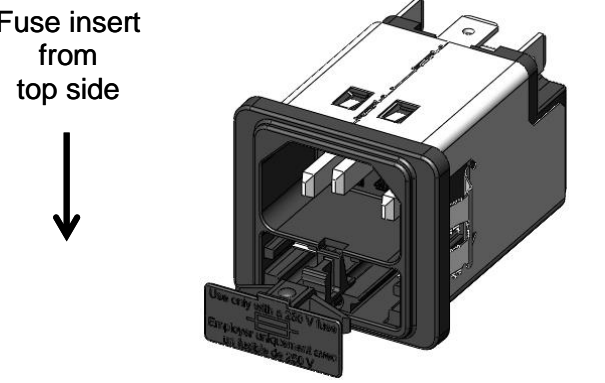
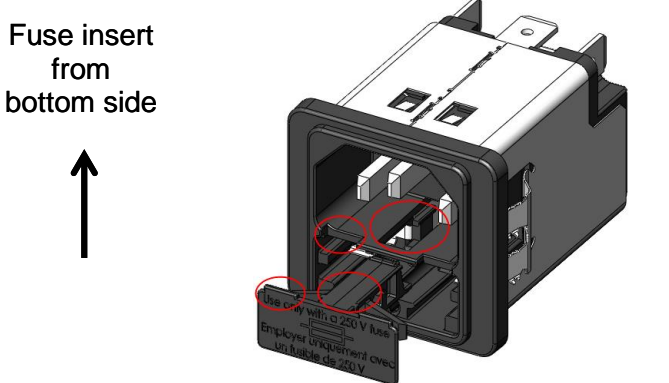
*SBU (2-digit) / PG (3-digit) / PUG (3-digit) / Type (10-digit)

List of part numbers affected				
5200.0123.1	5200.0123.3	5200.0143.1	5200.0143.3	5200.0223.1
5200.0223.3	5200.0243.1	5200.0243.1.01	5200.0243.3	5200.0423.1
5200.0423.3	5200.0423.5	5200.0443.1	5200.0443.3	5200.0623.1
5200.0623.3	5200.0643.1	5200.0643.3	5200.0823.1	5200.0823.3
5200.0843.1	5200.0843.3	5200.1023.1	5200.1023.3	5200.1043.1
5200.1043.3				

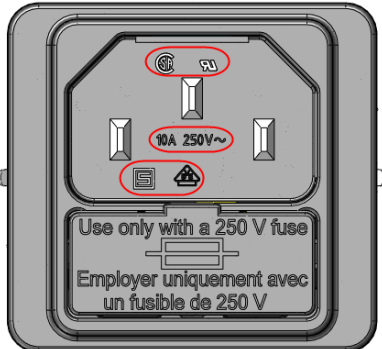
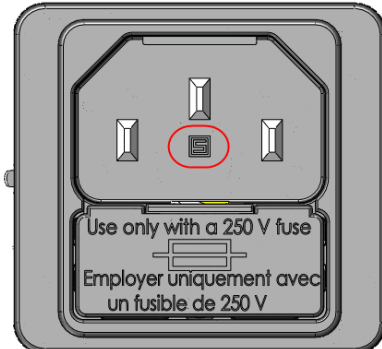
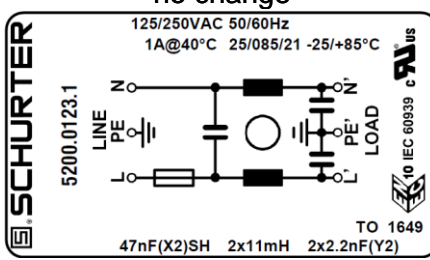
2 Type of change

1. V-Lock cord retaining integrated as standard
2. Material change
3. Modification of approval marks

3 Detailed description of change

Old product appearance		New product appearance	
<ul style="list-style-type: none"> - Slot for V-Lock cord retention - Fuse assembling from opposite side - Fusedrawer has two latches on the side to pull-out the fusedrawer, until now is only one latch 			
Screw-on mounting; Old Fuse insert from top side 	Screw-on mounting; New Fuse insert from bottom side 		
Snap-in mounting; Old Fuse insert from top side 	Snap-in mounting; New Fuse insert from bottom side 		

Product Change Notification						PCN 5200	
owner	creation date	release date	released by	change order no	rev	page	D10-007-430
schaidro	2016-08-24	2016-12-07	blumhe	2011605	A	1 of 2	

Old product approval marks	New product approval marks
Picture show is snap-in mounting, change also applies to screw version. No approval and rating marks on the IEC connector.	
Old; 	New; 
no change 	

4 Reason of change

- V-Lock cord retaining implemented as a standard feature
- Product improvement to fulfil the enhanced glow wire requirements according to the updated standard IEC 60127-6 and the standard IEC 60335-1 for appliances in unattended use.

5 Release date

The change will be rolled-out starting ww 05/2017 and lasts approx. 12 months depending on the variant.

6 Impact of change and recommended action

Form	Yes	- Slot for V-Lock cord retention - Insertion of the fuse is changed to bottom side - Fuse drawer has 2 latches sideways
Fit	No	No dimensional change
Function	Yes	Compatible with V-Lock cordsets
Production Site	No	No change of the production site
Product Label	No	No change
Customer Action	No	Notification only

7 Reference Documents / Attachments

Kind of document	Remarks
5200	Datasheet

Product Change Notification					PCN 5200		
owner	creation date	release date	released by	change order no	rev	page	D10-007-430
schaidro	2016-08-24	2016-12-07	blumhe	2011605	A	2 of 2	