
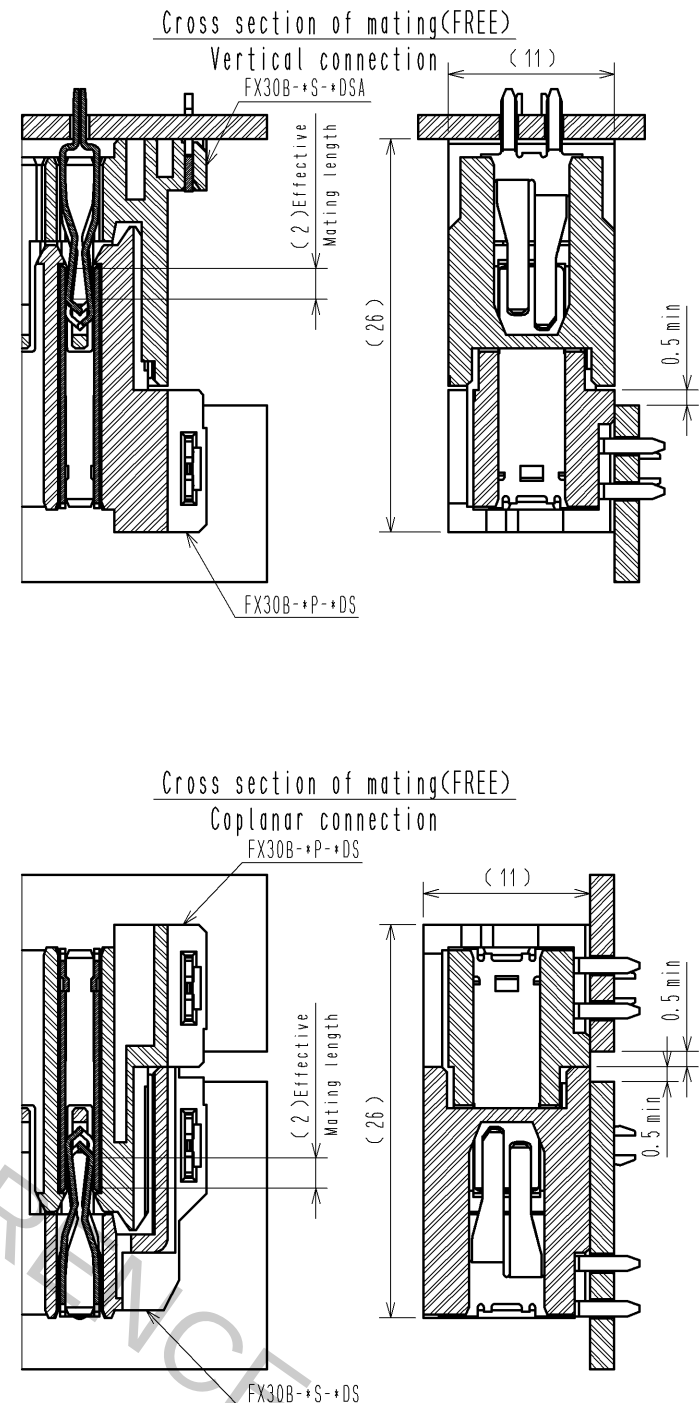


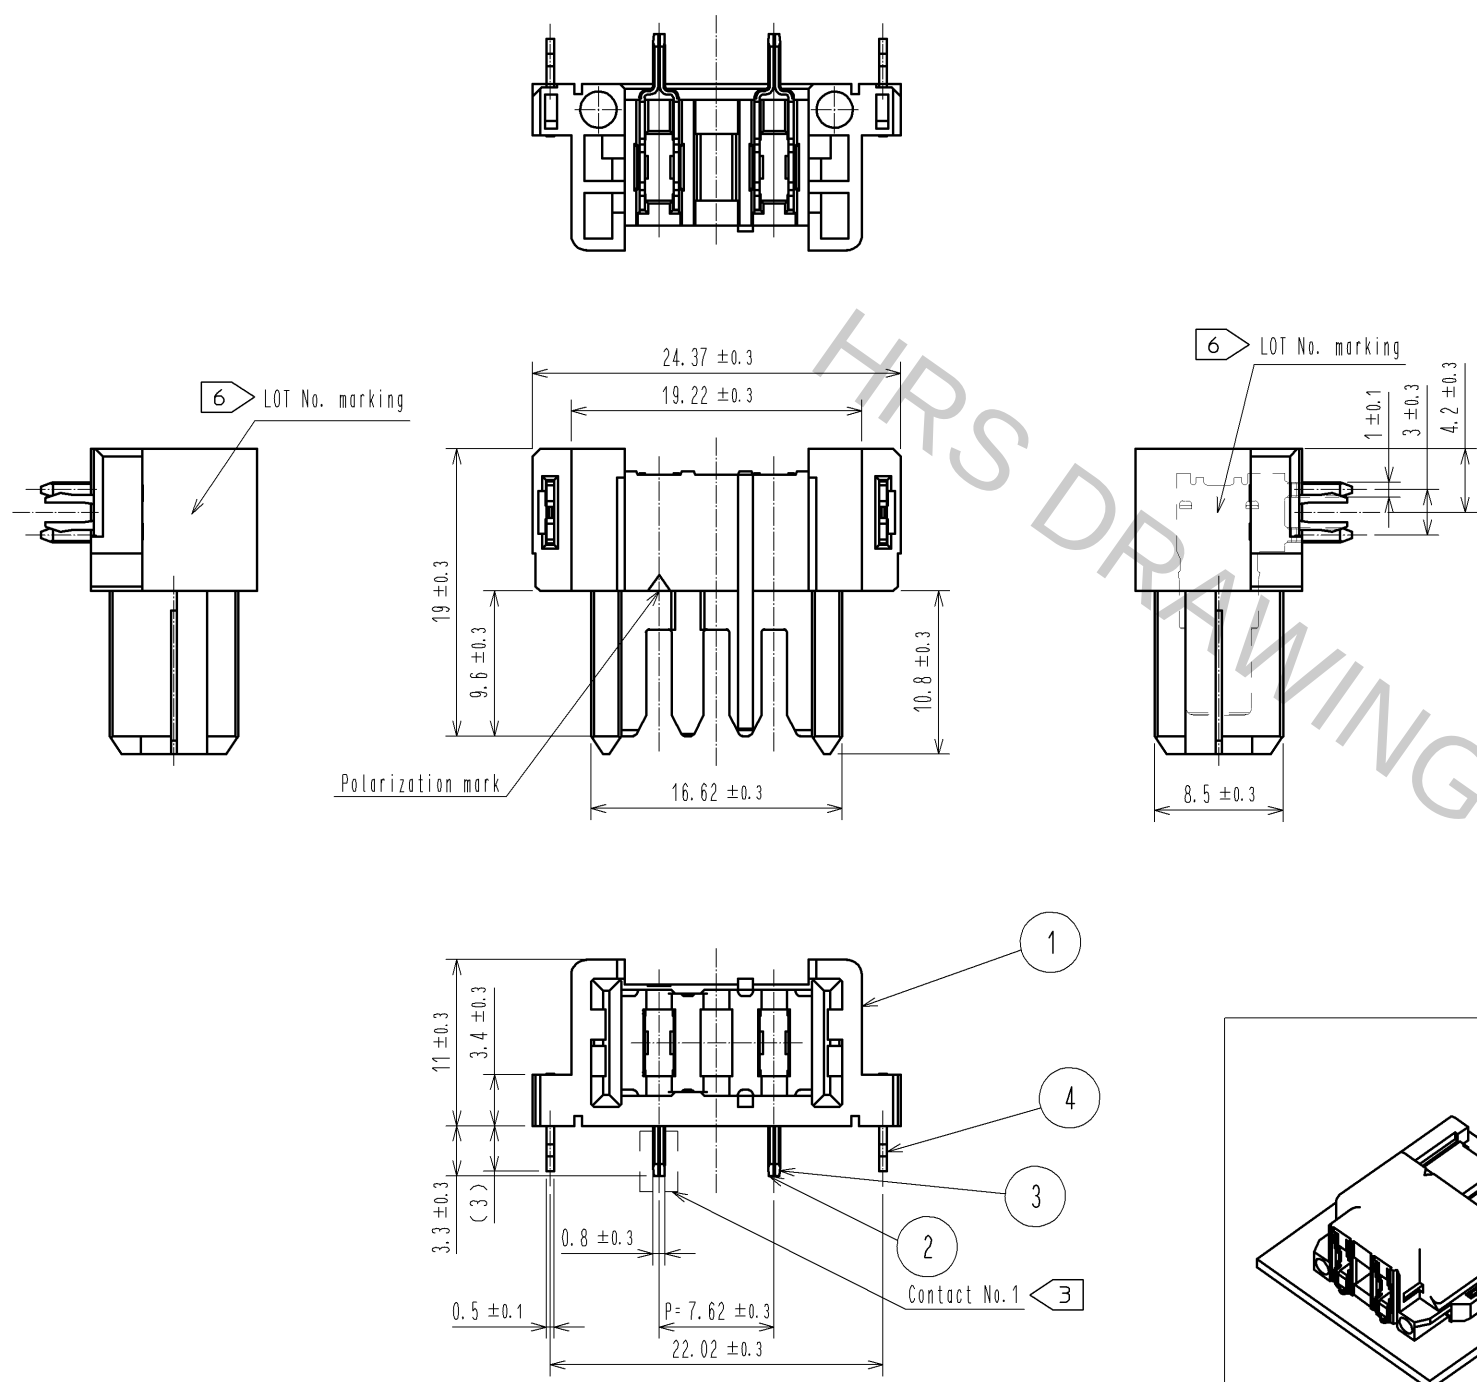


NOTE 1 This product is packaged in tray. (24pcs/tray)
2 Blemish and hit mark can be occurred through out the manufacturing process
whitch dosen' t affect quality level.
Also, black spot could be observed on the surface of housing.
3 For the contact NO., adjacent two pairs of leads placed back-to-back (4 leads in total)
Compose one line.
4 Misalignment absorbing range: ±0.3mm max.
5 The dimension in parentheses are for references.
6 Lot NO. is indicated at either one of the position as shown.
7 Pay attention to the recommended PCB thickness and finished through-hole dimensions.
Low retention force to PCB could induce angled mounting due to the unbalanced center
Of the connector.


				5	Polystyrene	
				4	Phosphor bronze	Tin-plating 3.0μm Under plating: Nickel 1.0μm
2	Copper alloy	Contact area: Gold-plating 0.1μm Lead area: Tin-plating 1.0μm Under plating: Nickel 1.0μm		3	Copper alloy	Contact area: Gold-plating 0.1μm Lead area: Tin-plating 1.0μm Under plating: Nickel 1.0μm
1	Polyamide	Black UL94V-0				
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS	
UNITS mm		SCALE 2 : 1	COUNT △	DESCRIPTION OF REVISIONS		DESIGNED
						CHECKED
						DATE
APPROVED : HS. OKAWA		14. 09. 12	DRAWING NO.	EDC3-359163-00		
CHECED : KN. SHIBUYA		14. 09. 12	PART NO.	FX30B-2P-7. 62DS		
DESIGNED : DK. AIMOTO		14. 09. 12	CODE NO.	CL570-3404-8-00		
DRAWN : DK. AIMOTO		14. 09. 12				

Oct.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case that the application demands a high level of reliability, such as automotive,
please contact a company representative for further information.


Recommended hole pattern dimension of PCB(5:1)
(Connector mounting side, PCB thickness:t=1.6mm) 7

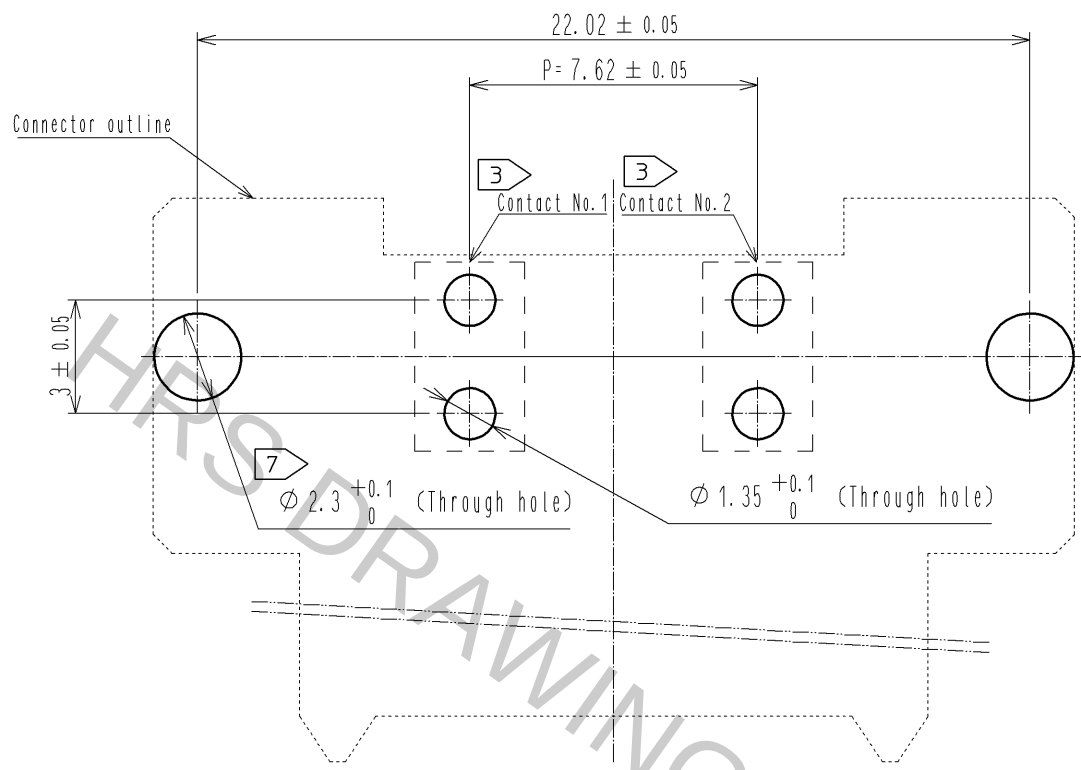

1 Drawing for packaging(1:2)

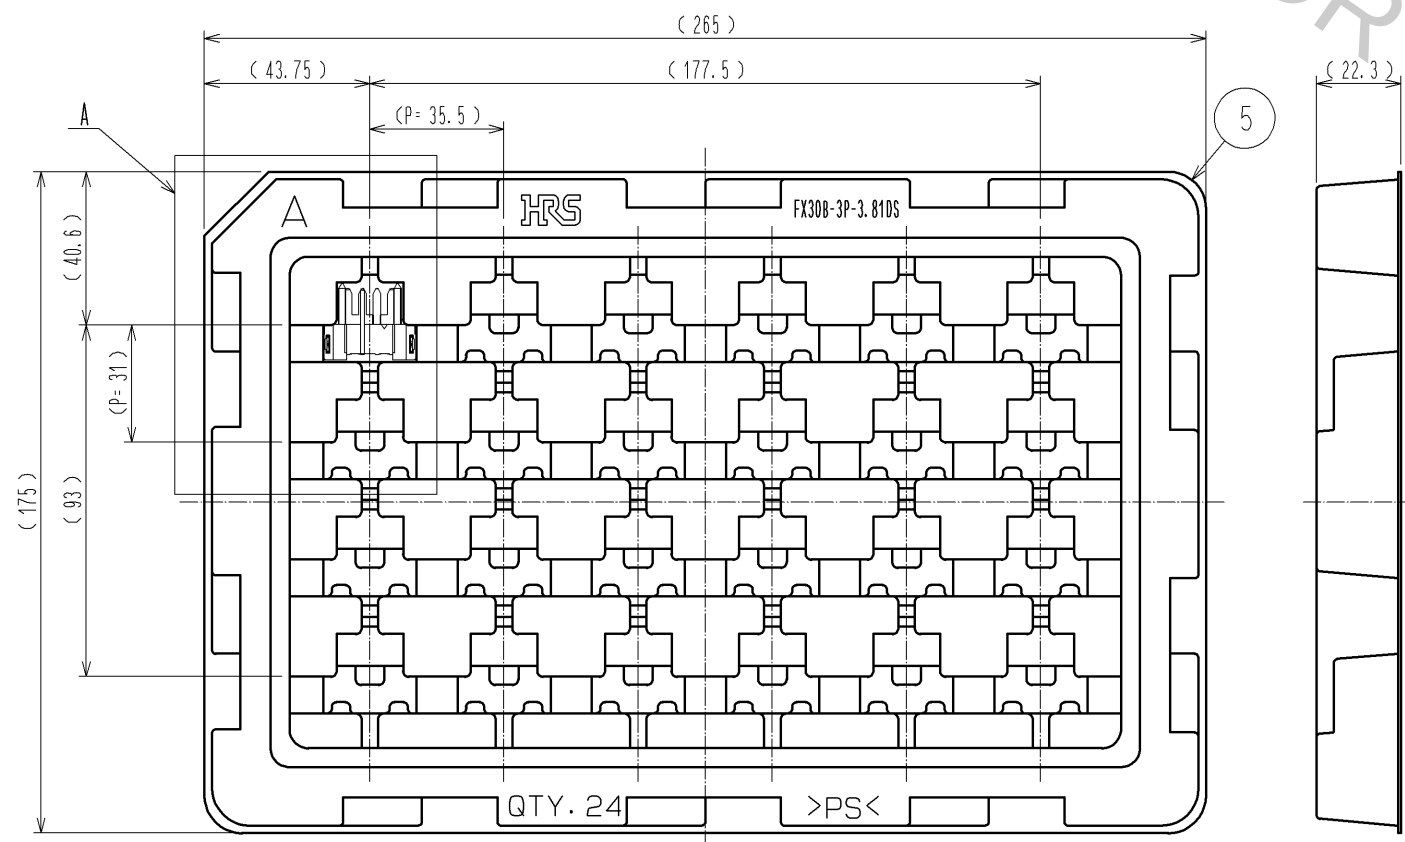

A(1:1)

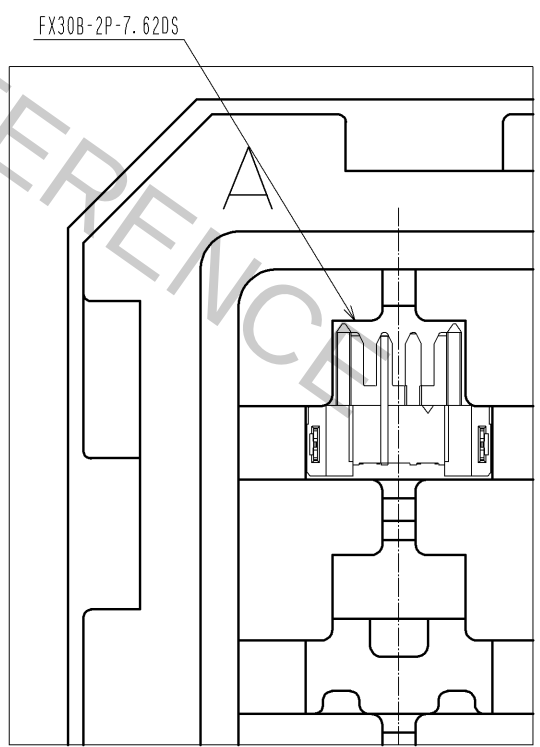

DRAWING NO.	EDC3-359163-00
PART NO.	FX30B-2P-7.62DS
CODE NO.	CL570-3404-8-00

2/2