
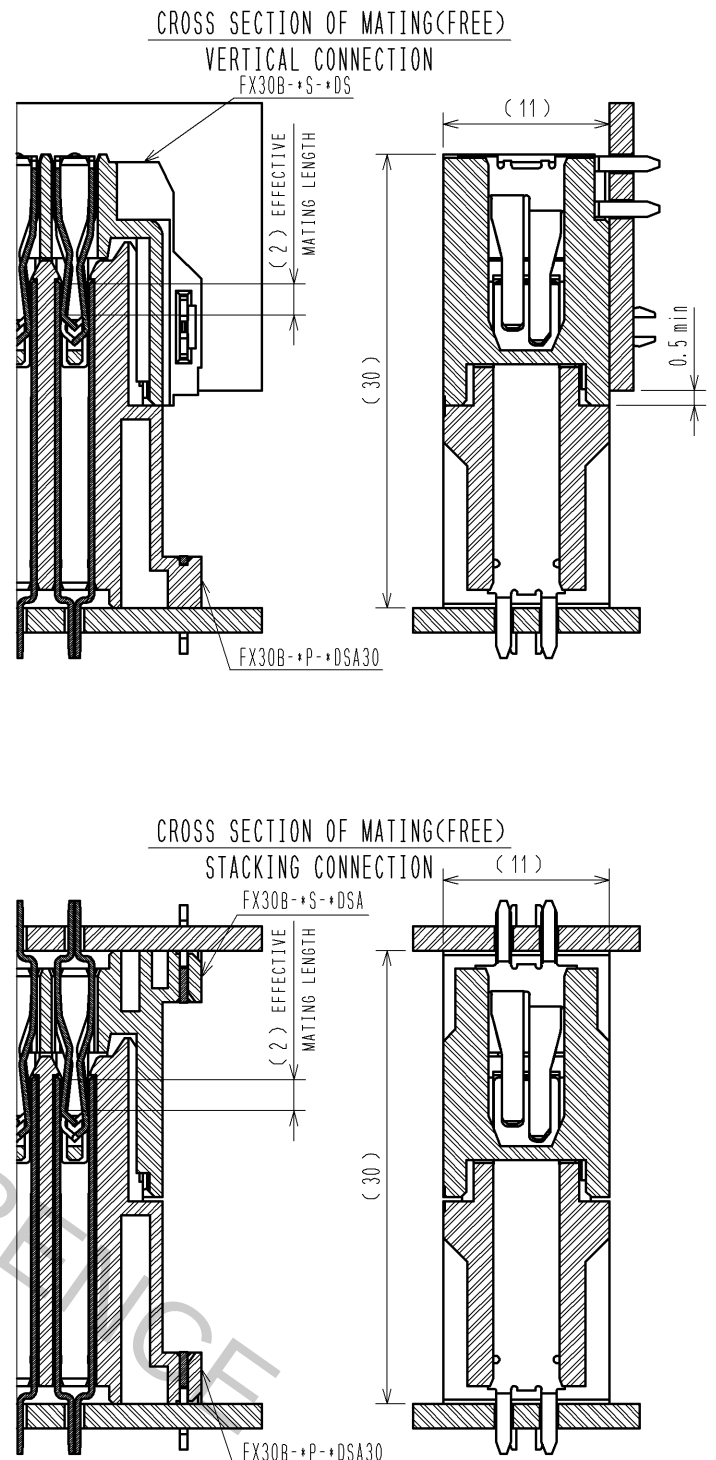
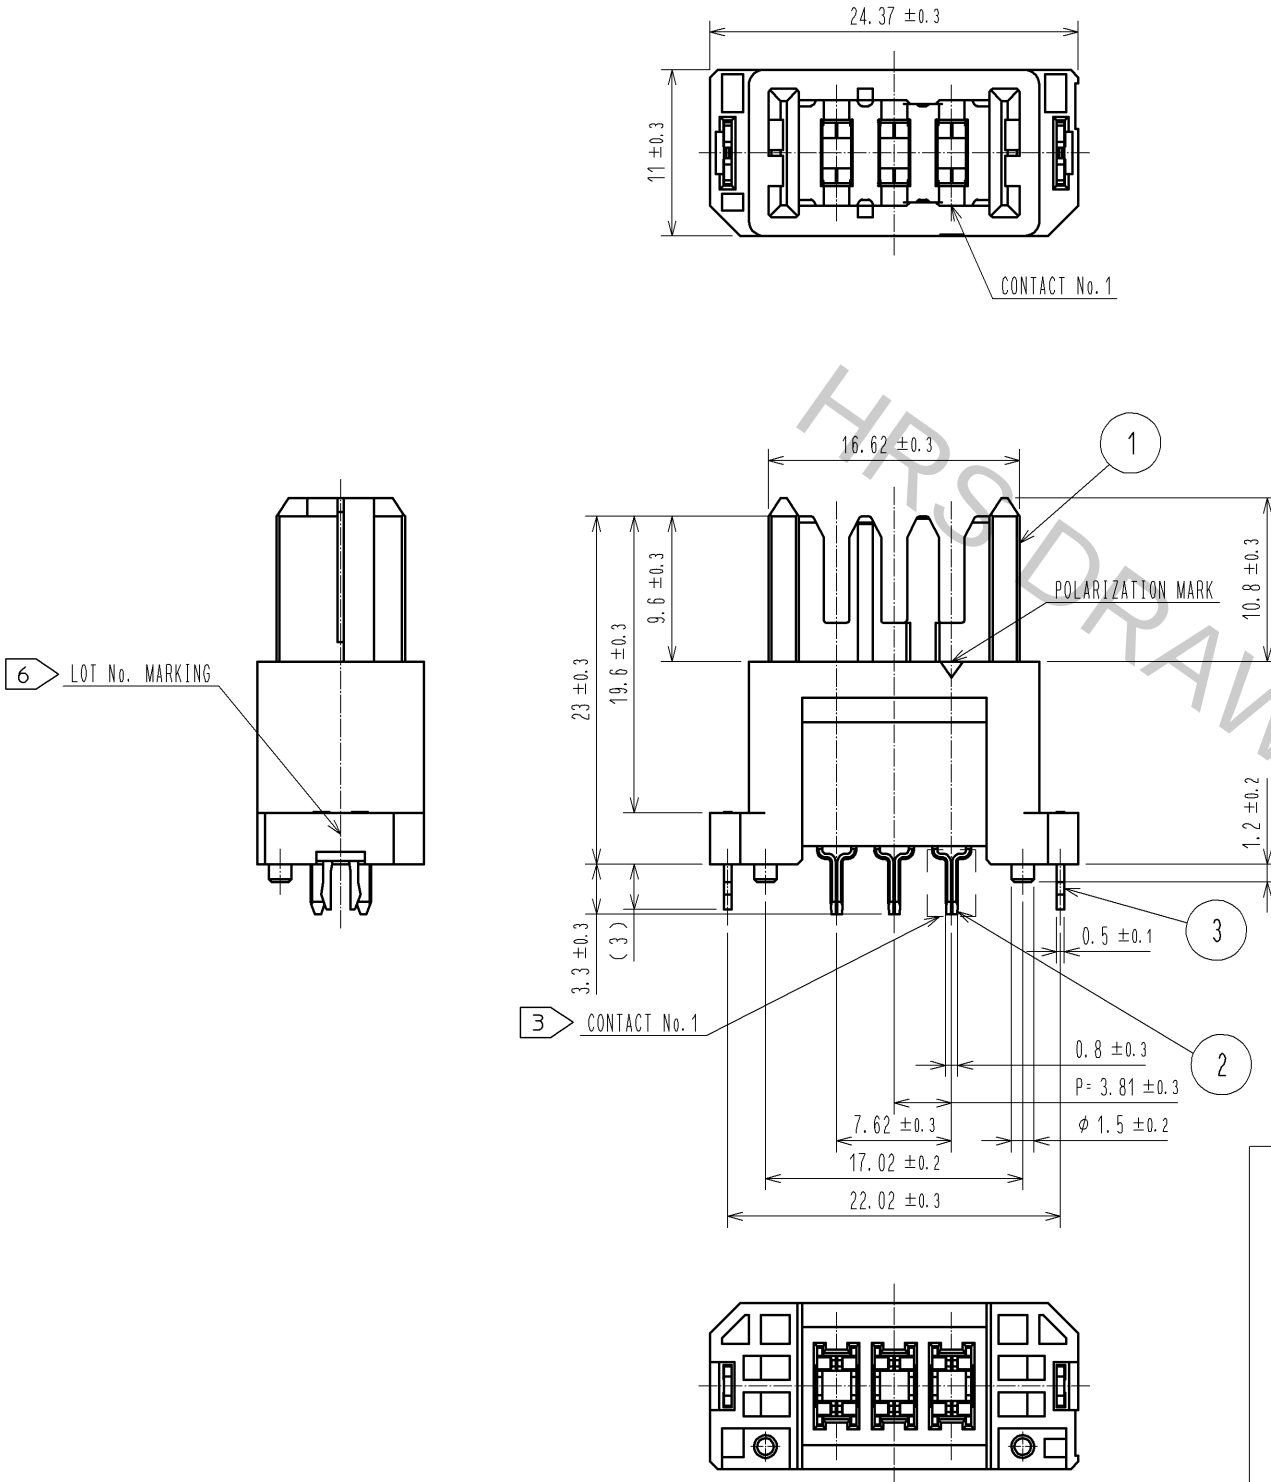





NOTE

- THIS PRODUCT IS PACKAGED IN TRAY. (42pcs/TRAY)
- BLEMISH AND HIT MARK CAN BE OCCURED THROUGH OUT THE MANUFACTURING PROCESS WHICH DOESN'T AFFECT QUALITY LEVEL.
ALSO, BLACK SPOT COULD BE OBSERVED ON THE SURFACE OF HOUSING.
- FOR THE CONTACT NO., ADJACENT TWO PAIRS OF LEADS PLACED BACK-TO-BACK (4 LEADS IN TOTAL) COMPOSE ONE LINE.
- MISALIGNMENT ABSORBING RANGE: $\pm 0.3\text{mm max.}$
- THE DIMENSION IN PARENTHESES ARE FOR REFERENCES.
- LOT NO. IS INDICATED AT EITHER ONE OF THE POSITION AS SHOWN.

2	COPPER ALLOY	CONTACT AREA:GOLD-PLATING 0.1 μm			4	POLYSTYRENE			
		LEAD AREA:TIN-PLATING 1.0 μm							
		UNDER PLATING:NICKEL 1.0 μm							
1	POLYAMIDE	BLACK UL94V-0			3	PHOSPHOR BRONZE	TIN-PLATING 3.0 μm		
							UNDER PLATING:NICKEL 1.0 μm		
NO.	MATERIAL	FINISH , REMARKS			NO.	MATERIAL	FINISH , REMARKS		
UNITS mm			SCALE 2 : 1	COUNT 	DESCRIPTION OF REVISIONS		DESIGNED	CHECKED	DATE
 HIROSE ELECTRIC CO., LTD.			APPROVED : HS. OKAWA		13.03.13	DRAWING NO. EDC3-347265-00			
			CHECED : KI. HIROKAWA		13.03.12	PART NO. FX30B-3P-3.81DSA30			
			DESIGNED : DK. AIMOTO		13.03.11	CODE NO. CL570-3301-5-00			
			DRAWN : DK. AIMOTO		13.03.11				
							 1/2		

Oct.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case that the application demands a high level of reliability, such as automotive,
please contact a company representative for further information.

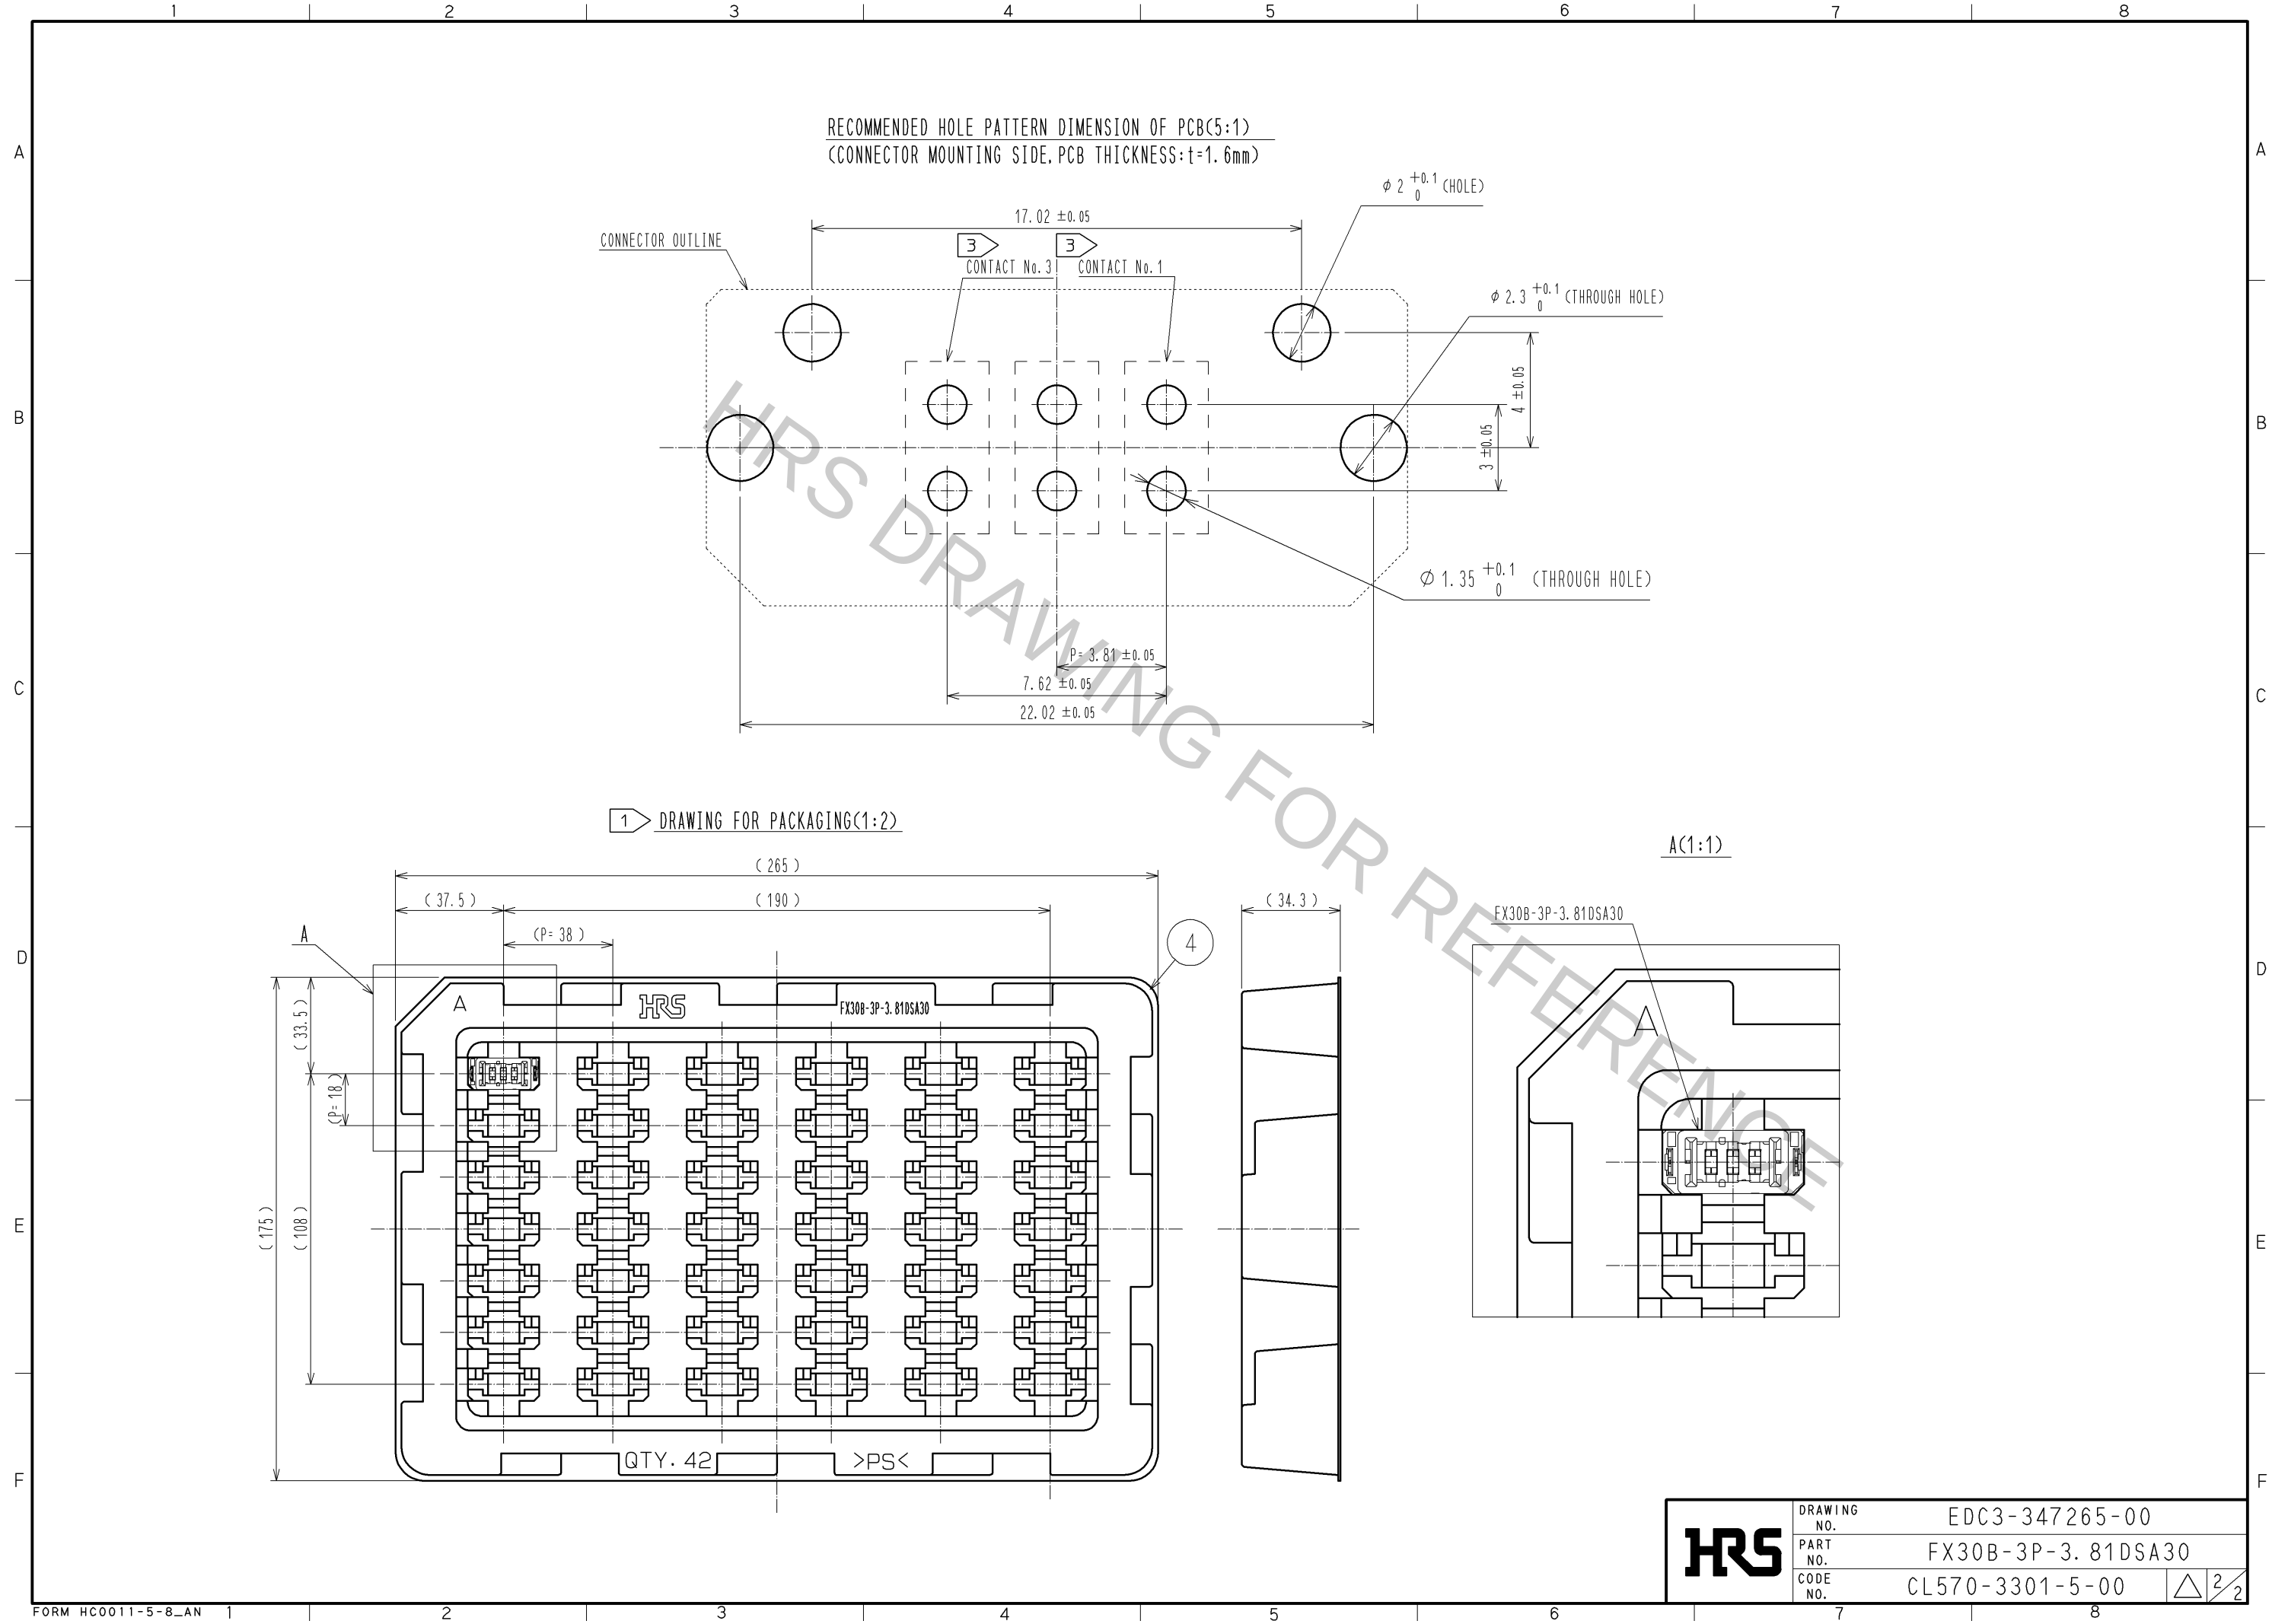

HRS	DRAWING NO.	EDC3-347265-00
	PART NO.	FX30B-3P-3.81DSA30
	CODE NO.	CL570-3301-5-00