

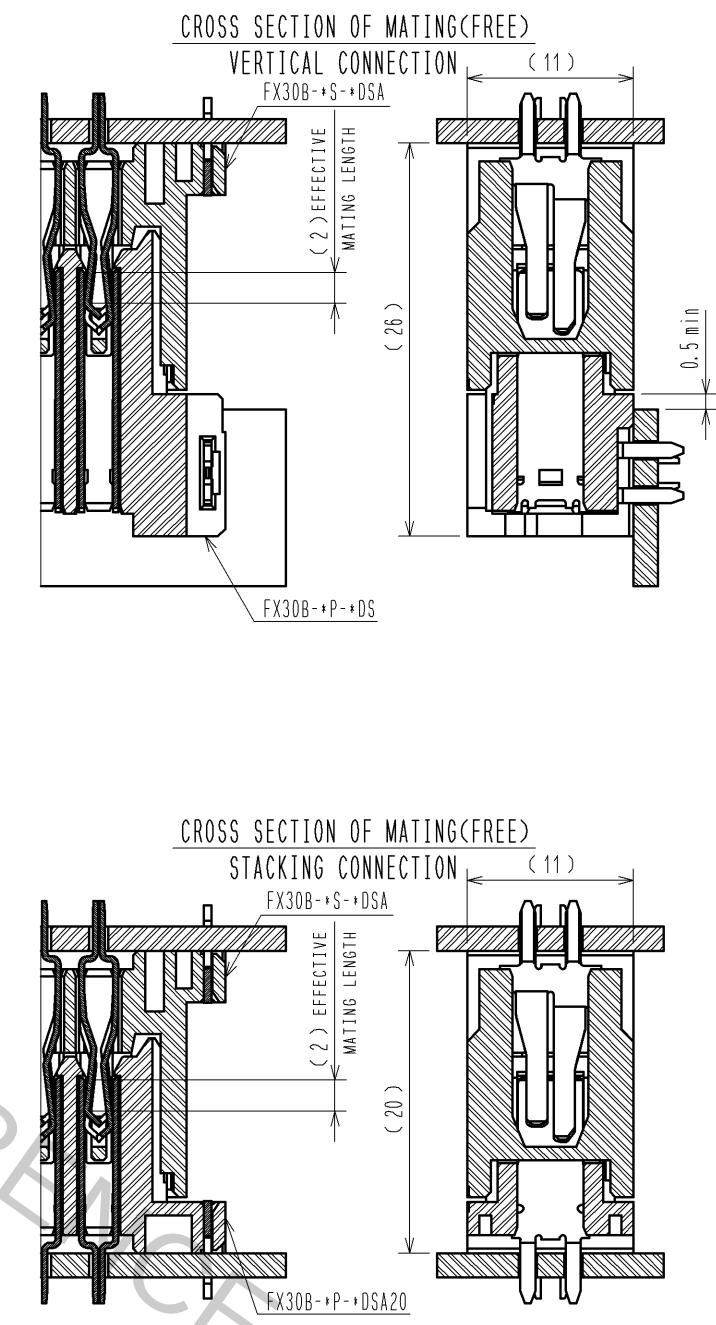


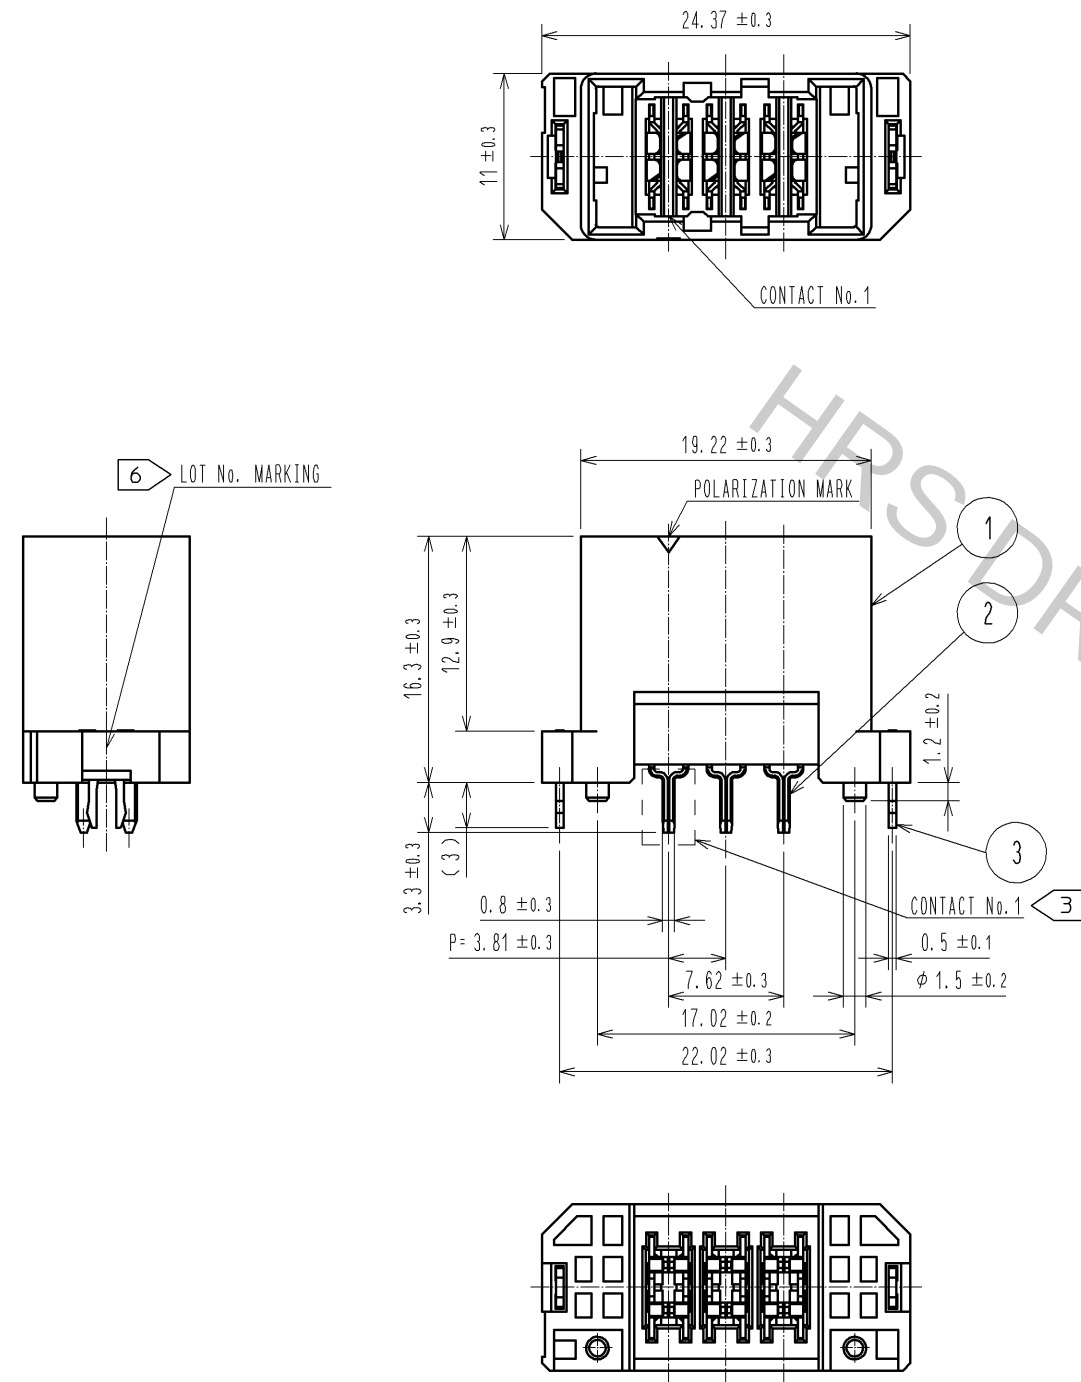


NOTE 1 THIS PRODUCT IS PACKAGED IN TRAY. (42pcs/TRAY)
2 BLEMISH AND HIT MARK CAN BE OCCURED THROUGH OUT THE MANUFACTURING PROCESS WHICH DOSEN' T AFFECT QUALITY LEVEL.
ALSO, BLACK SPOT COULD BE OBSERVED ON THE SURFACE OF HOUSING.
3 FOR THE CONTACT NO., ADJACENT TWO PAIRS OF LEADS PLACED BACK-TO-BACK (4 LEADS IN TOTAL) COMPOSE ONE LINE.
4 MISALIGNMENT ABSORBING RANGE: ±0.3mm max.
5 THE DIMENSION IN PARENTHESES ARE FOR REFERENCES.
6 LOT NO. IS INDICATED AT EITHER ONE OF THE POSITION AS SHOWN.

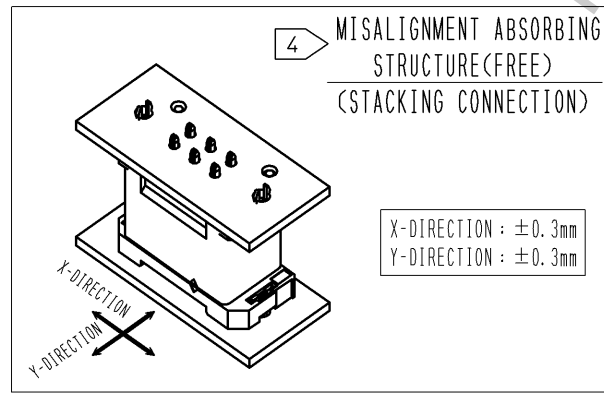

2	COPPER ALLOY	CONTACT AREA:GOLD-PLATING 0.1 μm	4	POLYSTYRENE	
		LEAD AREA:TIN-PLATING 1.0 μm			
		UNDER PLATING:NICKEL 1.0 μm			
1	POLYAMIDE	BLACK UL94V-0	3	PHOSPHOR BRONZE	TIN-PLATING 3.0 μm
NO. MATERIAL		FINISH , REMARKS	NO. MATERIAL		FINISH , REMARKS
UNITS mm		SCALE 2 : 1	COUNT		DESCRIPTION OF REVISIONS
DESIGNED		CHECKED		DATE	
APPROVED : HS. OKAWA		13.03.13		DRAWING NO. EDC3-347273-00	
CHECED : KI. HIROKAWA		13.03.12		PART NO. FX30B-3S-3.81DSA	
DESIGNED : DK. AIMOTO		13.03.11		CODE NO. CL570-3501-4-00	
DRAWN : DK. AIMOTO		13.03.11			

Oct.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case that the application demands a high level of reliability, such as automotive,
please contact a company representative for further information.

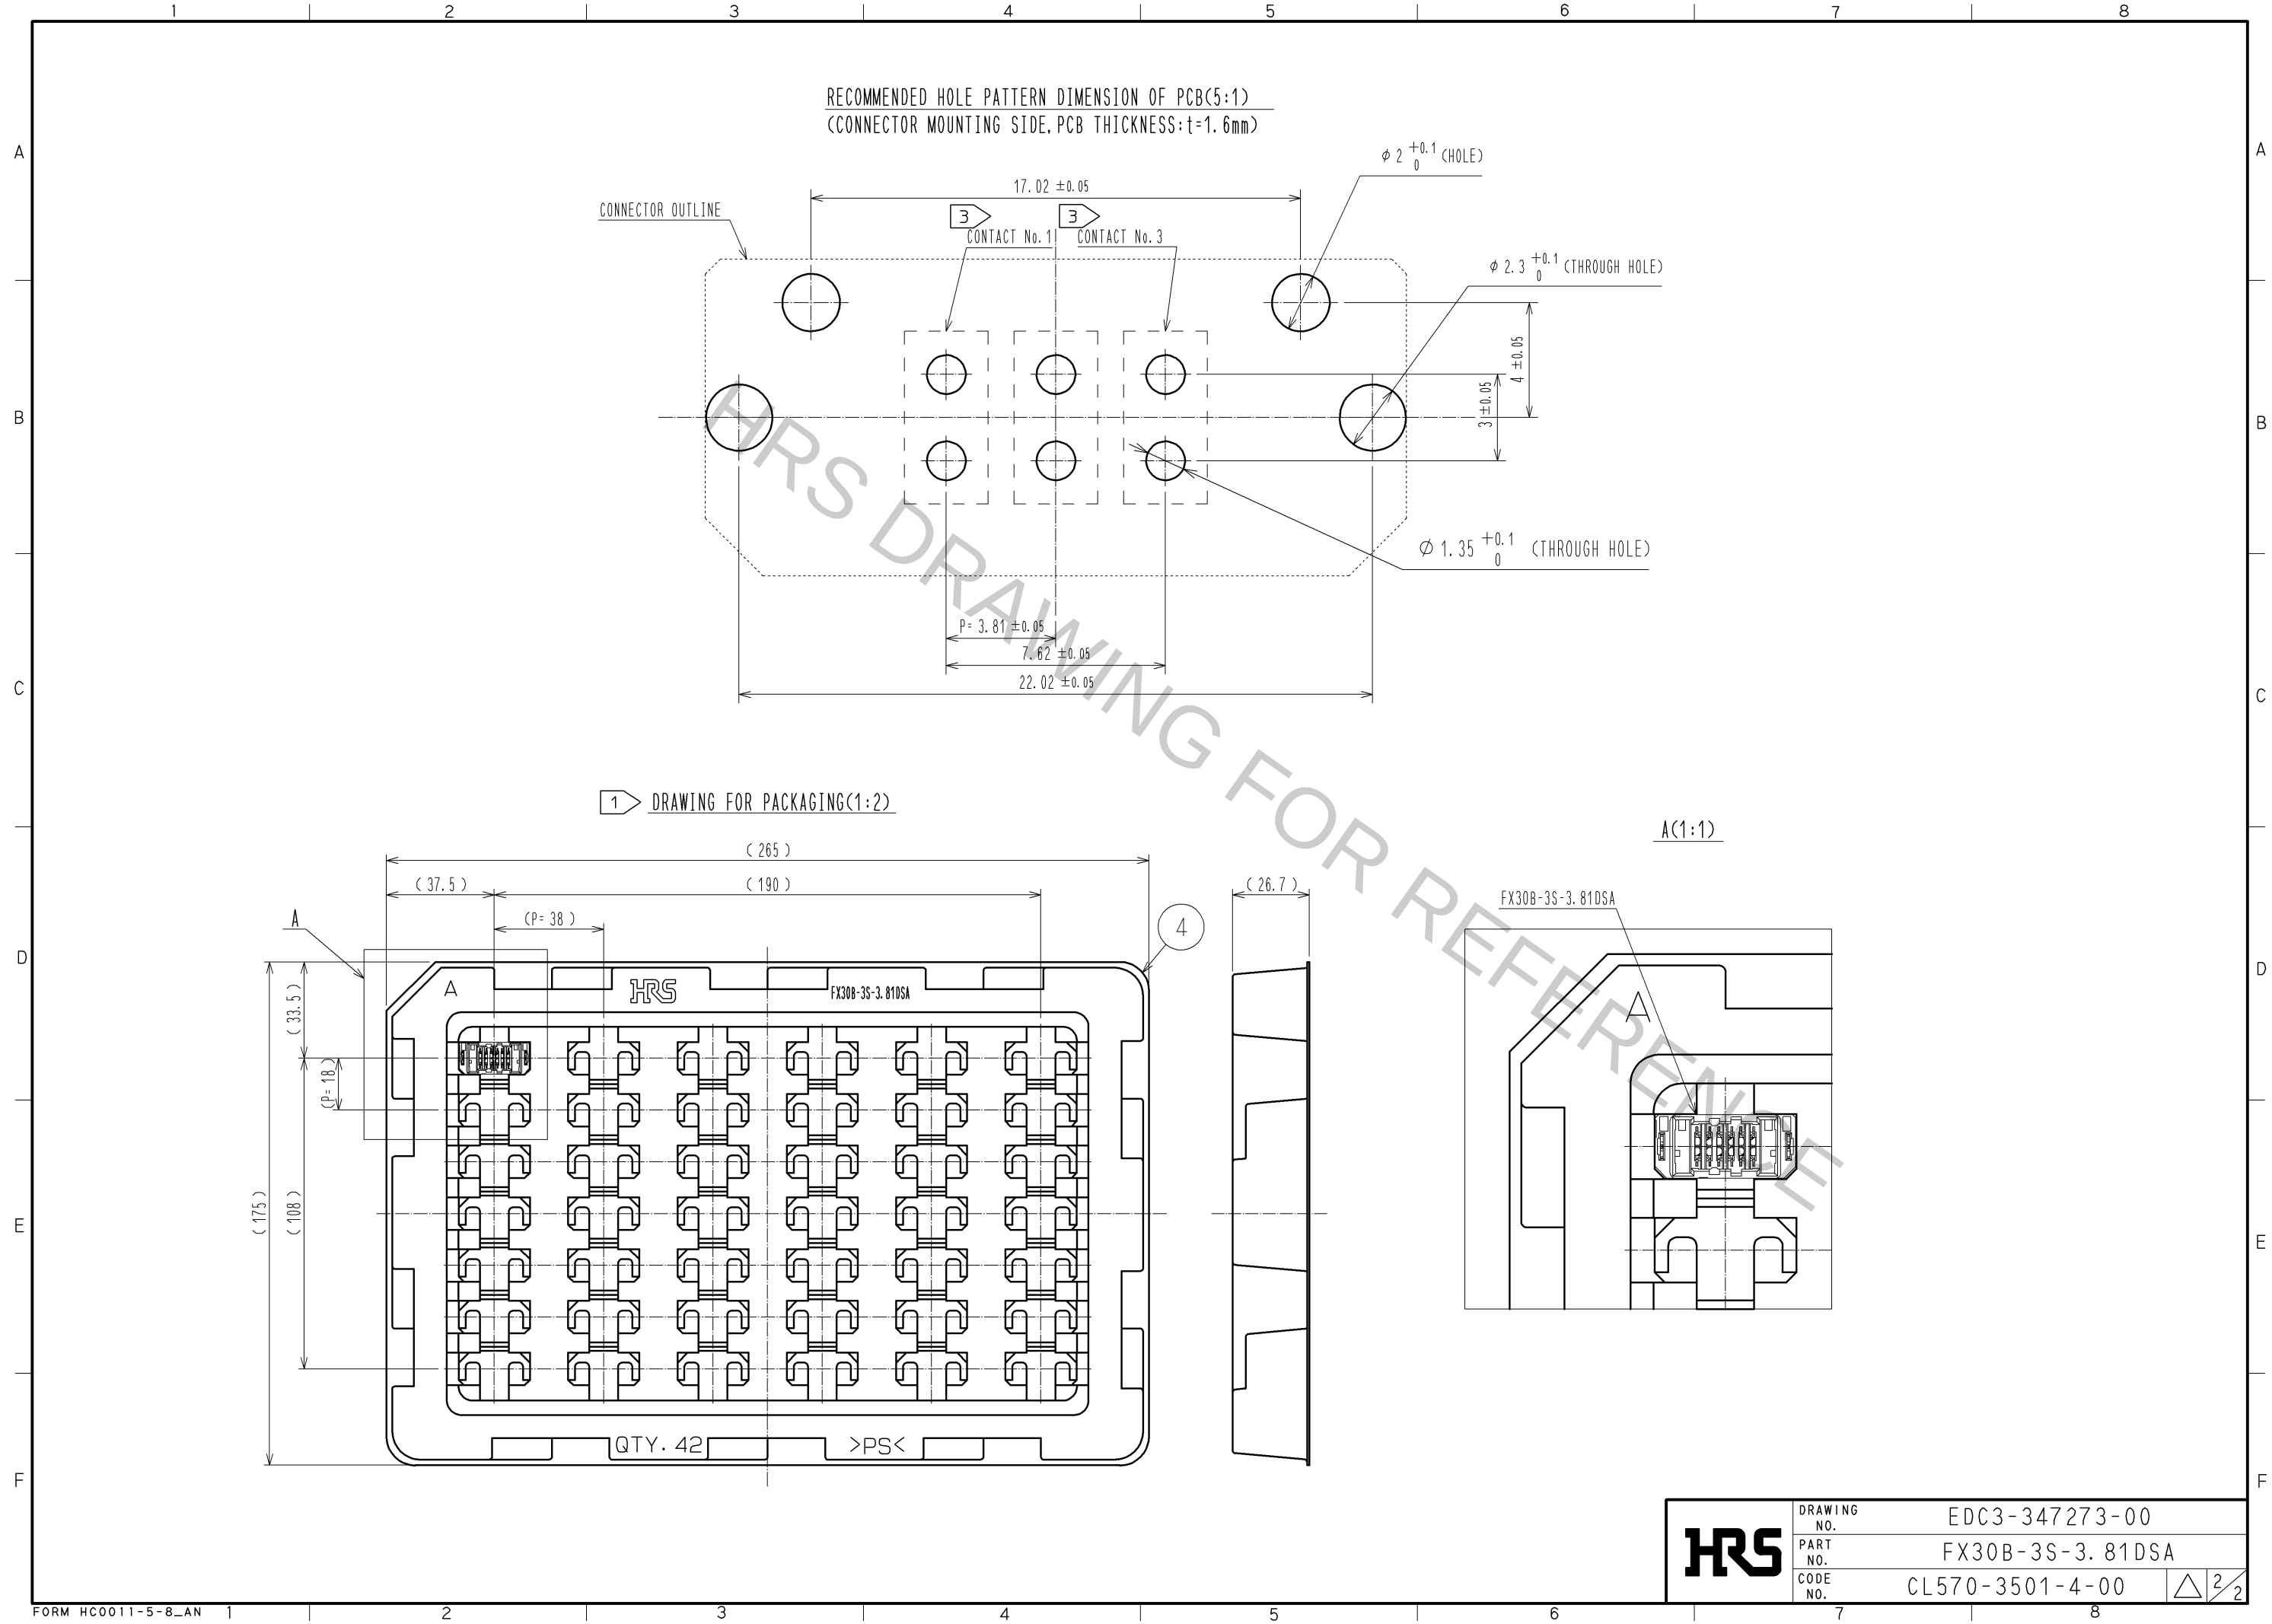

HRS	DRAWING NO.	EDC3-347273-00
	PART NO.	FX30B-3S-3.81DSA
	CODE NO.	CL570-3501-4-00
		22