



Technical Data Sheet

UR5604 Polyurethane Resin

Product Description

UR5604 is a two part, high performance polyurethane especially formulated for potting and encapsulating.

Features

- Good Electrical Properties
- Excellent Adhesion
- Low Water Absorption
- Flame Retardant – fully approved to UL 94-V-0
- Contains No Halogens
- Low mixed system viscosity
- Non Toxic
- Long pot life

Approvals:	RoHS Compliant	Yes
	UL Approval	UL94 V-0

Typical Properties:

Liquid Properties:	Base Material	Polyurethane
	Density Part A - Resin (g/ml)	1.62
	Density Part B - Hardener (g/ml)	1.21
	Part A Viscosity (mPa s @ 23°C)	20000
	Part B Viscosity (mPa s @ 23°C)	50
	Mixed System Viscosity (mPa s @ 23°C)	2000
	Mix Ratio (Weight)	5.21:1
	Mix Ratio (Volume)	3.88:1
	Usable Life (20°C)	40 mins
	Gel Time (23°C)	90 mins
	Cure Time (23 °C)	24 hours
	Cure Time (60 °C)	3 hours
	Colour Part A - Resin	Black
	Colour Part B - Hardener	Brown
	Storage Conditions	Dry Conditions: Above 15°C, Below 35°C
	Shelf Life	12 months
	Exotherm	
	(Measured on 100ml sample in a cylinder of diameter 49.4mm @ 23°C)	< 35°C
	Shrinkage	< 1%


Cured System:	Thermal Conductivity (W/mK)	0.45
	Cured Density (g/ml)	1.54
	Temperature Range (°C)	-40 to +130
	Max Temperature Range (Short Term °C / Mins)	+155
	Weight Loss after 600 Hours @ 155°C	7%
	Dielectric Strength (kV/mm)	18
	Volume Resistivity (ohm-cm)	10 ¹⁴
	Shore Hardness (@ 23°C)	A75/D25
	(@ -77°C)	D80
	(@ -60°C)	D80
	Hardness after 600 Hours @ 155°C	A92
	Colour (Mixed System)	Black
	Flame Retardency	Yes
	Loss Tangent @ 50 Hz	0.015
	Permittivity @ 50 Hz	4.90
	Comparative Tracking Index	>600 Volts
	Water Absorption (9.7mm thick disk, 51mm diameter) 10 days @ 20°C / 1 hour @ 100°C	<0.5% / <1%
	Elongation At Break	Not Measured

Mixing Procedures

Resin Packs

It is important not to remove the aluminium outer wrapping until immediately before use. To open, cut the aluminium outer being very careful not to damage the inner pack.

When in Resin pack form, the resin and hardener are mixed by removing the clip and moving the contents around inside the pack until thoroughly mixed. To remove the clip, remove both end caps, grip each end of the pack and pull apart gently. By using the removed clip, take special care to push unmixed material from the corners of the pack. Mixing normally takes from two to four minutes depending on the skill of the operator and the size of the pack. Both the resin and hardener are evacuated prior to packing so the system is ready for use immediately after mixing. The corner may be cut from the pack so that it may be used as a simple dispenser.

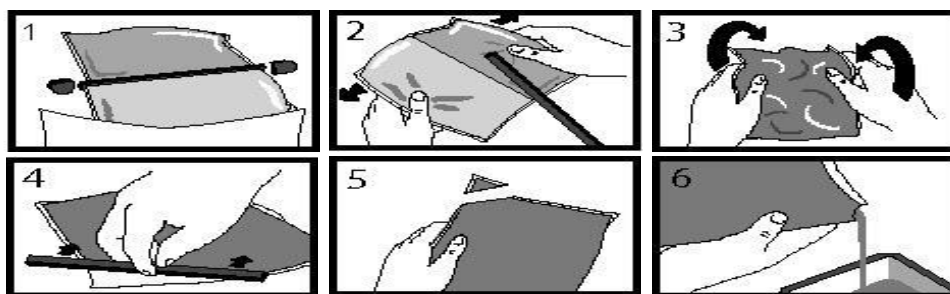

Bulk Mixing

When mixing, care must be taken to avoid the introduction of excessive amounts of air. Automatic mixing equipment is available which will not only mix both the resin and hardener accurately in the correct ratio but do this without introducing air. Containers of Part A (Resin) and Part B (Hardener) should be kept sealed at all times when not in use to prevent the ingress of moisture. Bulk material must be thoroughly mixed before use. Incomplete mixing will result in erratic or partial curing.

General

Sedimentation of the resin has been minimised by careful attention to the formulation. However, any sediment which may have occurred over long periods of time must be dispersed before removing any material from the container. This dispersion can be carried out (if necessary) by stirring with a broad bladed spatula or gently rolling the can. Take care not to introduce excessive amounts of air during this operation or it may be necessary to re-evacuate the resin. Sedimentation will be accelerated by storage at high temperatures. Sedimentation found in resin packs forms no problem since the sediment is re-mixed when the pack is used.

Additional Information

Curing Schedule

Do not heat cure large volumes immediately. Allow these to gel at room temperature and post-cure at high temperature if required (refer to liquid properties for details). Small volumes (250ml) may be heat cured immediately.

Cleaning

It is advisable for machines & containers to be cleaned before the resin has been allowed to cure. Electrolube's Resin Removal Stripper (RRS) is suitable for cleaning machines and containers. Cured resin may be slowly softened and removed by soaking in our RRS.

Storage

When storing under very cold conditions, the hardener may crystallise. If this occurs, simply warm (40°C) the container gently until all crystals have re-melted.

Health & Safety

Always refer to the Health & Safety data sheet before use. These can be downloaded from www.electrolube.com

Rev: 2 (Feb '12)

Copyright Electrolube 2012

All information is given in good faith but without warranty. Properties are given as a guide only and should not be taken as a specification.

Electrolube cannot be held responsible for the performance of its products within any application determined by the customer, who must satisfy themselves as to the suitability of the product.