




Right-Angle Shapes, MIL style


Helashrink 1100 Series, with rib

Features and Benefits

- Used in conjunction with a circular grooved adaptor for strain relief

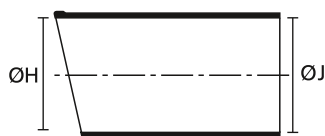

a: Expanded form (supplied)

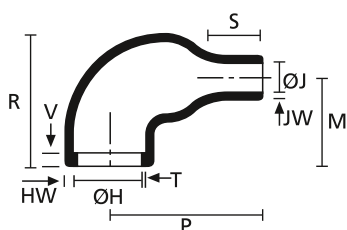

b: Fully recovered form (after heating)



1108-4 supplied / fully recovered.



For Material / Adhesive information please refer to page 244.

TYPE	ØH min. a	ØH max. b	ØJ min. a	ØJ max. b	P ± 10%	R ± 10%	HW ± 20%	JW ± 30%	V max	T ± 20%	M nom	S nom	Article-No.
1108-4-G	16.5	7.9	16.5	3.8	17.3	20.1	1.0	1.6	3.3	1.0	15.2	5.1	411-08480


All dimensions in mm. Subject to technical changes.

Right-Angle Shapes


Helashrink 1100 Series, without rib

Features and Benefits

- Strain relief for connector cable
- Easy re-entry for repair when combined with hot melt adhesive

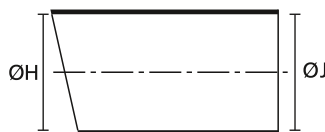

a: Expanded form (supplied)

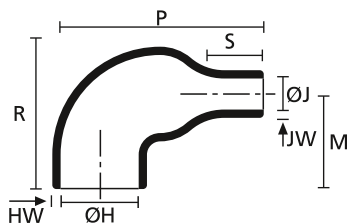

b: Fully recovered form (after heating)



1108-1 supplied / fully recovered.

TYPE	ØH min. a	ØH max. b	ØJ min. a	ØJ max. b	P ± 10%	R ± 10%	HW ± 20%	JW ± 30%	M nom	S nom	Article-No.
1108-1-G	16.5	7.9	16.5	3.8	17.3	20.1	1.0	1.6	15.2	5.1	411-08180

All dimensions in mm. Subject to technical changes.