

TECHNICAL DATA

RSE300 and RSE600 Infrared Cameras



SUPERIOR IMAGE QUALITY

SPATIAL RESOLUTION

RSE300

1.85 mRad

RSE600

0.93 mRad

RESOLUTION

RSE300

320x240

RSE600

640x480

FIELD OF VIEW

RSE300

34 °H x 25.5 °V


RSE600

34 °H x 25.5 °V


Mounted infrared cameras for research, science and engineering

- MATLAB* and LabVIEW* software compatibility allows users to integrate infrared data, images and videos to support R&D analysis
- 320x240 and 640x480 resolution options
- See the details you need with **optional smart lenses:** 2x and 4x telephoto, wide angle and macro lenses
- Optimize images, generate customizable reports and export images to the format of your choice with SmartView* desktop software
- Eliminate potential for mis-diagnosis with automatically focused images throughout your field of view with **MultiSharp™** Focus

100 % Focused-Every object. Near and far. MultiSharp™ Focus.

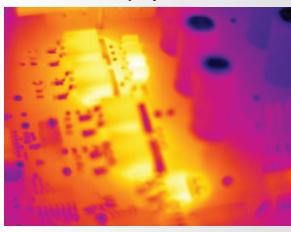

Manual focus

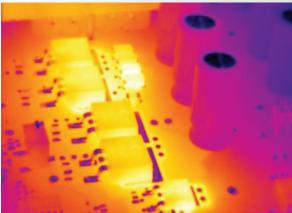

MultiSharp Focus, available on the RSE300 and RSE600 Infrared Cameras









Detailed specifications

| | RSE300 | RSE600 |
|---|---|--|
| Key Features | | |
| Detector resolution | 320x240 (76,800 pixels) | 640x480 (307,200 pixels)** |
| FOV with standard lens (spatial resolution) | 1.85 mRad | 0.93 mRad |
| Field of view | 34 °H x 25.5 °V | 34 °H x 25.5 °V |
| Minimum focus distance | 15 cm (approx. 6 in) | |
| amera focus options | Focus is adjusted in SmartView® desktop software | |
| MultiSharp™ Focus | Yes, focused near and far, throughout the field of view | |
| R-Fusion* technology | Yes, in SmartView* desktop software. Five modes of image blending (AutoBlend™ mode, Picture-in-Picture (PIP), IR/Visible alarm, Full IR, Full visible light) add the context of the visible details to your infrared image | |
| nterfaces for image/data transfer | Supported in camera data ports: GigE Vision | |
| 'hermal sensitivity (NETD) | ≤ 0.030 °C at 30 °C target temp (30 mK)* | ≤ 0.040 °C at 30 °C target temp (40 mK)* |
| ilter mode (NETD improvement) | , | Yes |
| evel and span | Smooth auto and manual scaling, in SmartView® desktop software | |
| Fast auto toggle between manual and auto modes | Yes, in SmartView® desktop software | |
| Fast auto-rescale in manual mode | Yes, in SmartView® desktop software | |
| Minimum span (in manual mode) | 0.1 °C (0.18 °F), in SmartView® desktop software | |
| Minimum span (in auto mode) | <1.0 °C (<1.8 °F), in SmartView® desktop software | |
| Built-in digital camera (visible light) | 5 megapixel industrial performance | |
| 'rame rate | 60 Hz or 9 Hz versions | |
| Digital zoom | Variable up to 16x in SmartView® desktop software | |
| ata storage and image capture | | |
| femory options | Connect to SmartView® desktop software for storage to device | |
| nage capture, review, save mechanism | Capture, save and analyze images in SmartView® desktop software | |
| mage file formats | Non-radiometric (.bmp) or (.jpeg) or fully-radiometric (.is2); no analysis software required for non-radiometric (.bmp, .jpg and .avi) files | |
| Software | SmartView* desktop software—full analysis and reporting software Compatible with MATLAB* and LabVIEW* software | |
| Export file formats with SmartView* desktop software | Bitmap (.bmp), GIF, JPEG, PNG, TIFF | |
| oice annotation | Yes, in SmartView* desktop software | |
| R PhotoNotes™ | Yes, in SmartView [®] desktop software | |
| 'ext annotation | Yes, in SmartView [®] desktop software | |
| 'ideo recording | Radiometric, in SmartView*desktop software, with exports to standard non-radiometric formats | |
| 'ile formats video | Non-radiometric (MPEG-encoded .AVI) and fully-radiometric (.IS3), in SmartView* software | |
| emote display viewing | Yes, see the live stream of the camera display on your PC, or TV monitor, via Ethernet cable to SmartView* desktop software | |
| demote control operation | Yes, through SmartView* desktop software | |
| emperature measurement | | |
| Temperature measurement range (not calibrated pelow -10 °C) | -10 °C to +1200 °C (14 °F to +2192 °F) | |
| Accuracy | ± 2 °C or ± 2 %, whichever is greater | |
| autocapture | Yes, in SmartView* desktop software | |
| Reflected background temperature compensation | Yes, in SmartView* desktop software | |
| 'ransmission correction | Yes, in SmartView* desktop software | |
| olor palettes | Available through IR-Fusion® technology in desktop software | |
| Standard palettes | 8: Ironbow, Blue-Red, High Contrast, Amber, Amber Inverted, Hot Metal, Grayscale, Grayscale Inverted | |
| Ultra Contrast™ palettes | 8: Ironbow Ultra, Blue-Red Ultra, High Contrast Ultra, Amber Ultra, Amber Inverted Ultra, Hot Metal Ultra, Grayscale Ultra, Grayscale Inverted Ultra | |

^{*}Best possible

2 Fluke Corporation RSE300 and RSE600 Infrared Cameras





^{**}Option to output 320x240 infrared data through GigE Vision



Detailed specifications (continued)

| | RSE300 | RSE600 |
|--------------------------------------|---|--|
| Key Features | | |
| Color alarms (temperature alarms) | Yes, in SmartView® desktop software–high temperature, low temperature, and isotherms (within range) | |
| Infrared spectral band | 8 µm to 14 µm (long wave) | |
| Operating temperature | -10 °C to +50 °C (14 °F to 122 °F) | |
| Storage temperature | -20 °C to +50 °C (-4 °F to 122 °F) | |
| Relative humidity | 10 % to 95 % non-condensing | |
| Center-point temperature measurement | Yes, in SmartView® desktop software | |
| Spot temperature | Yes, in SmartView® desktop software–hot and cold spot markers | |
| User-definiable spot markers | $Unlimited\ user-definable\ spot\ markers, in\ SmartView {\tt @ }\ desktop\ software$ | |
| Center box | Expandable-contractible measurement box with MIN-MAX-AVG temp display, in desktop software | |
| Electromagnetic compatibility | EN 61326-1:2013 IEC 61326-1:2013; (Industrial) | |
| US FCC | CFR 47, Part 15 Subpart B Class A | |
| Vibration | IEC 60068-2-26 (sinusoidal vibration): 3G, 11–200 Hz, 3 axis. | |
| Shock | IEC 60068-2-27 (mechanical shock): 50G, 6 ms, 3 axis. | |
| Size (HxWxL) | 8.3 cm x 8.3 cm x 16.5 cm (3.3 in x 3.3 in x 6.5 in) | |
| Weight | 1 kg (2.2 lbs) | |
| Enclosure rating | IEC 60529: IP67 (protected against dust, limited ing | ress; protection against water spray from all directions) |
| Warranty | Two years (standard), extended warranties are available | |
| Recommended calibration cycle | Two years (assumes normal operation and normal aging) | |
| Supported languages | | n, Japanese, Korean, Polish, Portuguese, Russian, Simplified Chinese, itional Chinese, and Turkish |

Ordering information

FLK-RSE300 60Hz Thermal Imager; 320x240 FLK-RSE300 9Hz Thermal Imager; 320x240 FLK-RSE300 9Hz/CH Thermal Imager; 320x240;

9 Hz, China

lacktriangle

FLK-RSE300 60Hz/JP Thermal Imager; 320x240;

60 Hz, Japan

FLK-RSE600 60Hz Thermal Imager; 640x480

FLK-RSE600 9Hz Thermal Imager; 640x480

FLK-RSE600 9Hz/CH Thermal Imager; 640x480;

9 Hz, China

 $\textbf{FLK-RSE600 60Hz/JP} \ \ \textbf{Thermal Imager; 640x480;}$

60 Hz, Japan

What's included

Infrared camera with standard infrared lens; AC power supply; Ethernet cable; Antenna

Available by free download: SmartView* desktop software and user manual

Software can be downloaded at

www.fluke.com/smartviewdownload

Optional accessories

FLK 0.75X WIDE LENS Infrared Wide Angle Lens FLK 2X LENS Infrared Telephoto Lens

(2X magnification)

FLK 4X LENS Infrared Telephoto Lens

(4X magnification)

FLK MACRO LENS Infrared Macro Lens

BOOK-ITP Introduction to Thermography Principles Book

FLK-RSE-MB Mounting bracket

 $\textbf{FLK-RSE-STAND} \ \textbf{RSE} \ \textbf{Stand}$

Visit your local Fluke website or contact your local Fluke representative for more information.



Fluke. Keeping your world up and running.®

Fluke CorporationPO Box 9090, Everett, WA 98206 U.S.A.

Fluke Europe B.V.

PO Box 1186, 5602 BD Eindhoven, The Netherlands

Modification of this document is not permitted without written permission from Fluke Corporation.

For more information call:

In the U.S.A. (800) 443-5853 or Fax (425) 446-5116 In Europe/M-East/Africa +31 (0)40 267 5100 or Fax +31 (0)40 267 5222 In Canada (800)-36-FLUKE or

Fax (905) 890-6866 From other countries +1 (425) 446-5500 or

Fax +1 (425) 446-5116 Web access: http://www.fluke.com

©2017, 2018 Fluke Corporation. Specifications subject to change without notice. 4/2018 6009950c-en

3 Fluke Corporation $\,\,$ RSE300 and RSE600 Infrared Cameras