

PWM and Tach Output Brushless DC Fan 06056EA-12S (D-Type)

NMB

General Specifications

Motor Type:

DC Brushless Three Phase Motor

Motor Protection:

Auto Restart / Polarity Protection (Motor withstands reverse connection for positive and negative leads.)

Insulation Resistance:

10MΩ or over with a DC 500V Megger

Dielectric Withstand Voltage:

AC 700V 1sec or 500V 1min

Allowable Ambient Temperature Range:


-10°C ~ + 60°C (Operating)

-30°C ~ + 70°C (Storage)
(non-condensing environment)



**For reference only. Please refer to fan outline for details*

Characteristic Curves

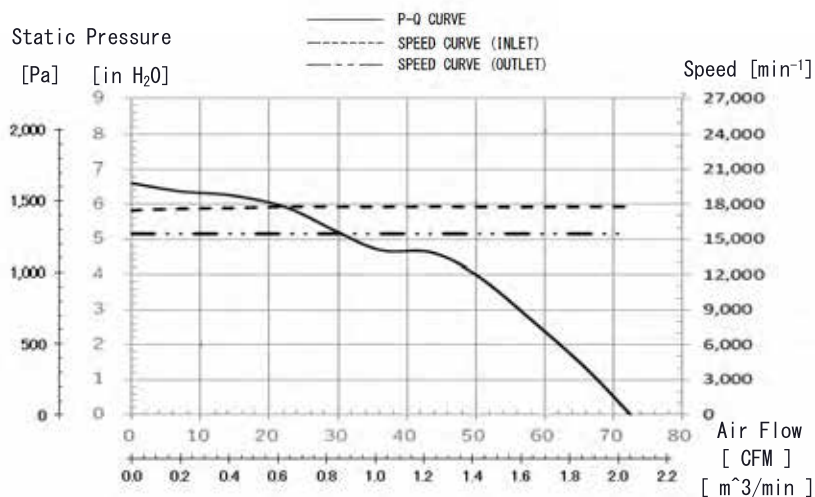

Features

- High performance counter rotating fan with eight wires and PWM with tach signal
- Efficient motor technology, high torque, and aerodynamic impeller design
- Energy saving, low vibration, and increased life expectancy
- Available in 12 volts with tach output and PWM speed control
- Outfitted with NMB precision machined ball bearings for long life
- Three phase motor design for high speed and efficient cooling

Life Expectancy L10

70,000 Hours at 40°C

**Fan life expectation is based on free air operation at 40°C, rated voltage, and indoor benign lab environment*

**1: Values in Free Air*

Specifications


MODEL	Rating Voltage	Operating Voltage	Current		Input Power		Speed Inlet/Outlet	Max. Air Flow		Max. Static Pressure		Noise	Mass
	(V)	(V)	Avg (A)*1	Max (A)*1	Avg (W)*1	Max (W)*1		(CFM)	(m³/min)	(in H₂O)	(Pa)	(dB)*1	(g)
06056EA-12S-E6D-L	12	10.8 to 13.2	3.20	4.20	38.40	50.40	17,750/15,450	72.0	2.00	6.60	1640	74.0	200

PWM and Tach Output Brushless DC Fan 06056EA-12S (D-Type)

NMB

PWM Specifications


Connection

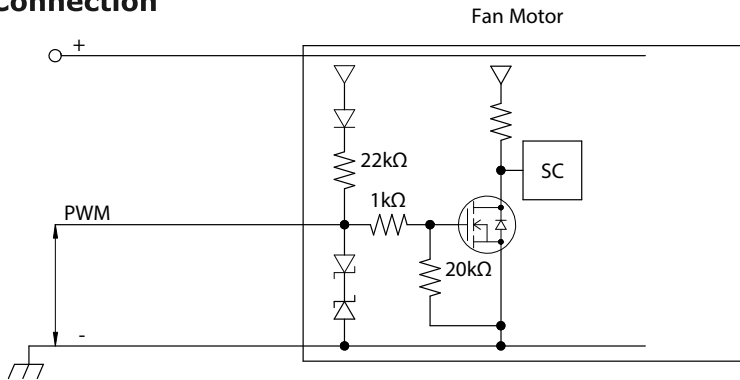

1. PWM Control

- Vst = Low Level (0V~0.4V) → Stop (On Duty 0%)
- Vst = High Level (4.0V~5.0V) → Full Speed (On Duty 100%)
- Vst = Open → Full Speed

2. PWM Duty & PWM Input Pulse

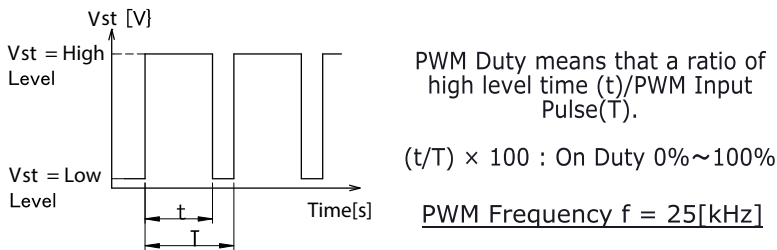

3. The condition for PWM control are as follows



- When you use this under PWM control, always be sure the motor's operation under practical mounting state. Fan motor may not start up caused by PWM control at very low speed condition.)
- To run at Rating Voltage
- Please use the start with Duty 20% or more at 25kHz.[At rated voltage input, Ambient temperature 25°C]

PWM Characteristic Curve

PWM Duty vs Speed Curve
<Reference Value>
Conditions : At Rating Voltage, Vst(H)=5V, f=25kHz, Ta=25

Inlet


Outlet

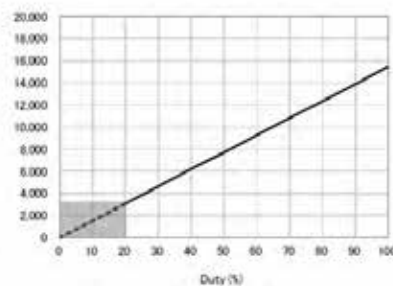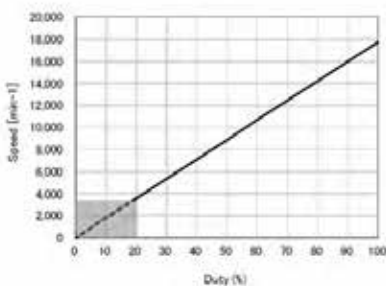

TACHO Specifications


Tachometer Signal

- Output Circuit: Open Drain
- Specification
Absolute Maximum Ratings at Ta=25°C
V_{D5}max: +15V
I_Dmax: 5mA[V_{CE}(sat)max=1.5V]

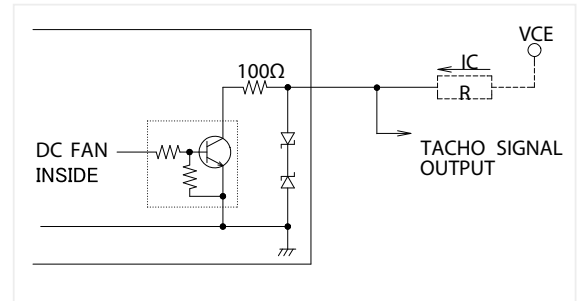


3. Output Waveform: At Rated Voltage Output Signal Voltage

Case-1

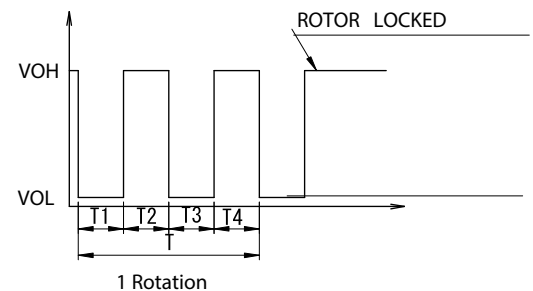

Case-2

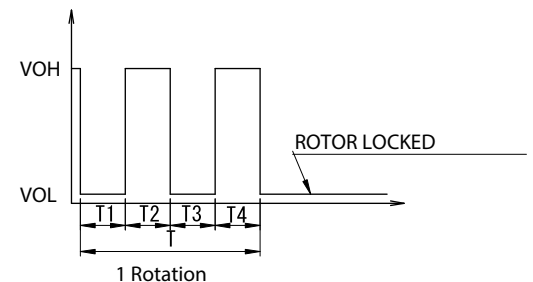

- When the rotor is locked at VOH position of signal, signal keeps VOH position.
- When the rotor is locked at VOL position of signal, signal keeps VOL position.
- T=T1+T2+T3+T4=60/m=1 rotation

m: Fan Speed (min⁻¹)


Tacho Duty Cycle=50%±10%

PWM and Tach Output Brushless DC Fan 06056EA-12S (D-Type)

NMB

Outlines

(Name Plate)

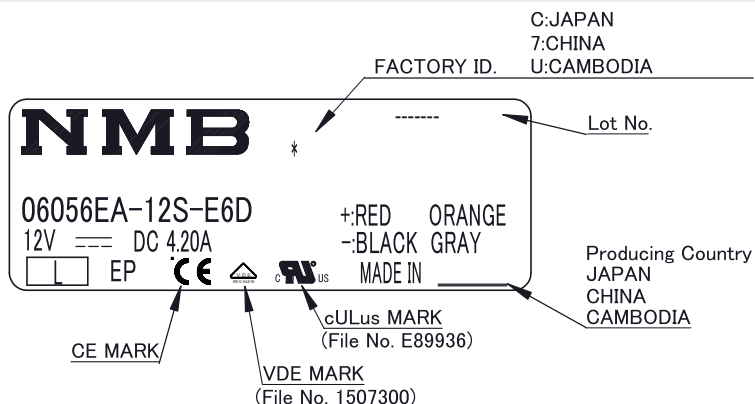

Materials

Casing: Plastic (Black UL94V-0)


Impeller: Plastic (Black UL94V-0)

Bearing: Ball Bearing

Lead Wire: UL10368 AWG24 or AWG26 OR
Equivalent for Red, Black, Orange, Gray
UL10368 AWG26 or AWG28 or Equivalent
for White, Brown, Yellow, Blue

[INLET FAN]	[OUTLET FAN]
(+)/Red	(+)/Orange
(-)/Black	(-)/Gray
(TACH)/White	(TACH)/Yellow
(PWM)/Brown	(PWM)/Blue

(Outline)

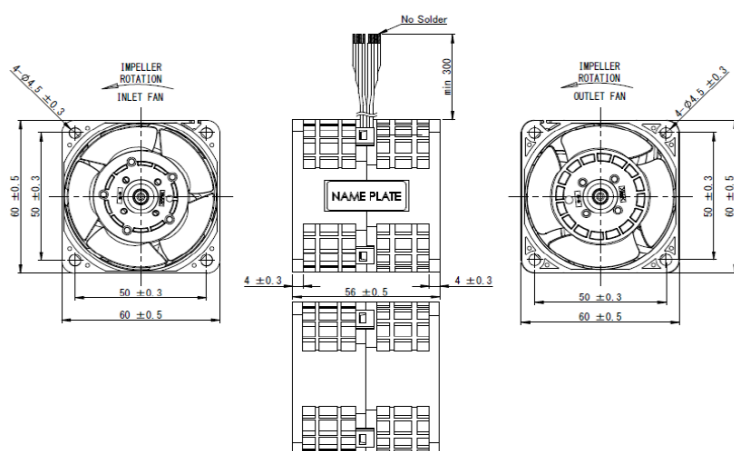

(Panel Out-line)

