

LOCTITE[®] 270™

December 2019

PRODUCT DESCRIPTION

 $LOCTITE^{$ [®] 270TM provides the following product

characteristics:				
Technology	Acrylic			
Chemical Type	Dimethacrylate ester			
Appearance (uncured)	Green liquid			
Fluorescence	Positive under UV light			
Components	One component -			
	requires no mixing			
Viscosity	Low			
Cure	Anaerobic			
Secondary Cure	Activator			
Application	Threadlocking			
Strength	High			

LOCTITE[®] 270[™] is designed for the permanent locking and sealing of threaded fasteners. The product cures when confined in the absence of air between close fitting metal surfaces and prevents loosening and leakage from shock and vibration. LOCTITE[®] 270[™] is particularly suited for heavy duty applications such as studs into motor housings, nuts onto studs in pump housings and other fasteners where high strength is 270™ LOCTITE® reauired. provides robust curina performance. It not only works on active metals (e.g. brass, copper) but also on passive substrates such as stainless steel and plated surfaces. The product offers high temperature performance and oil tolerance. It tolerates minor surface contaminations from various oils, such as cutting, lubrication, anti-corrosion and protection fluids.

NSF International

Registered to NSF Category P1 for use as a sealant where there is no possibility of food contact in and around food processing areas. **Note:** This is a regional approval. Please contact your local Technical Service Center for more information and clarification.

TYPICAL PROPERTIES OF UNCURED MATERIAL

Specific Gravity @ 25 °C

Viscosity, Brookfield - RVT, 25 °C, mPa·s (cP): Spindle 2, speed 20 rpm 400 to 600


Viscosity, Cone & Plate, 25 °C, mPa·s (cP): Cone C60/1°Ti @ shear rate 129 s⁻¹ 450

Flash Point - See SDS

TYPICAL CURING PERFORMANCE


Cure Speed vs. Substrate

The rate of cure will depend on the substrate used. The graph below shows the breakaway strength developed with time on M10 steel nuts and bolts. compared to different materials and tested according to ISO 10964.

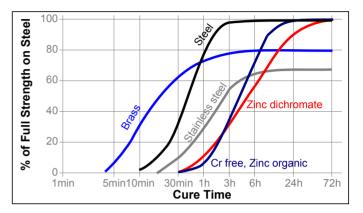

Cure Speed vs. Bond Gap

The rate of cure will depend on the bondline gap. Gaps in threaded fasteners depends on thread type, quality and size. The following graph shows shear strength developed with time on steel pins and collars at different controlled gaps and tested according to ISO 10123.

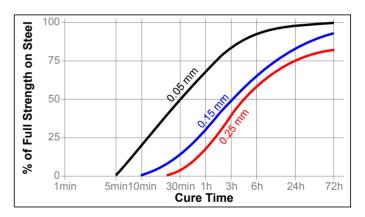


Cure Speed vs. Temperature

The rate of cure will depend on the temperature. The graph below shows the breakaway strength developed with time at different temperatures on M10 steel nuts and bolts and tested according to ISO 10964.




11

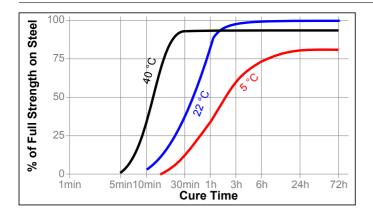

Cure Speed vs. Activator

Where cure speed is unacceptably long, or large gaps are present, applying activator to the surface will improve cure speed. The graph below shows the breakaway strength developed with time on M10 zinc dichromate steel nuts and bolts using Activator 7471TM, 7649TM, 7088TM and 7091TM and tested according to ISO 10964.

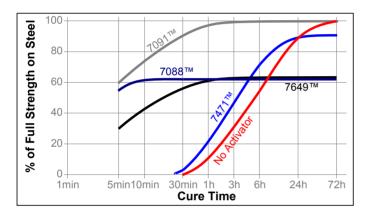

TYPICAL PERFORMANCE OF CURED MATERIAL Adhesive Properties

Cured for 24 hours @ 22°C Breakaway Torque, ISO 10964, Unseated:		
M10 steel nuts and bolts	N∙m	33
M6 steel nuts and bolts	(lb.in) N∙m (lb.in)	(290) 5 (45)
M16 steel nuts and bolts	N∙m	90
	(lb.in)	. ,
3/8 x 16 steel nuts (grade 2) and bolts (grade 5)	N∙m (lb.in)	31 (275)
Prevail Torque @ 180°, ISO 10964, Unseate	d:	
M10 steel nuts and bolts	N∙m	33
	(lb.in)	(290)
M6 steel nuts and bolts	N·m (lb.in)	3
M16 steel nuts and bolts	(lb.in) N∙m (lb.in)	125
3/8 x 16 steel nuts (grade 2) and bolts (grade 5)	N∙m (lb.in)	33 (290)
Breakloose Torque, ISO 10964, Pre-torqued	to 5 N∙m	:
M10 steel nuts and bolts	N·m (lb.in)	39 (345)
3/8 x 16 steel nuts (grade 2) and bolts	N∙ḿ	35

TDS LOCTITE[®] 270[™], December 2019

(grade 5)	(lb.in)	(310)
Prevail Torque @ 180°, ISO 10964, Pre-torqu M10 steel nuts and bolts	ued to 5 № N·m (lb.in)	N·m: 25 (220)
3/8 x 16 steel nuts (grade 2) and bolts (grade 5)	N∙m (lb.in)	31 (275)
Compressive Shear Strength, ISO 10123: Steel pins and collars	N/mm² (psi)	≥9.0 ^{∟мs} (≥1,305)

Cured for 1 week @ 22°C,


Breakloose Torque, ISO 10964, Pre-torqued to 5 N·m:				
M10 zinc phosphate nuts and bolts	N∙m	46		
	(lb.in)	(400)		
M10 stainless steel nuts and bolts	N∙m	30		
	(lb.in)	(265)		

TYPICAL ENVIRONMENTAL RESISTANCE

Cured for 1 week @ 22°C Breakloose Torque, ISO 10964, Pre-torqued to 5 N·m: M10 zinc phosphate steel nuts and bolts


Hot Strength

Tested at temperature

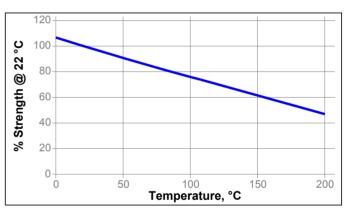

Heat Aging


Aged at temperature indicated and tested @ 22 °C

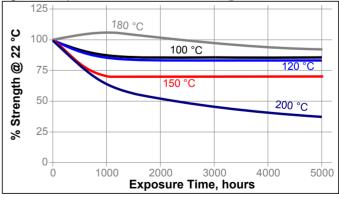



Heat Aging/Hot Strength

Aged under conditions indicated and tested at temperature

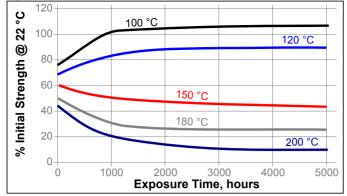

Chemical/Solvent Resistance

Aged under conditions indicated and tested @ °C

		% of initial strength		
Environment	°C	500 h	1000 h	5000 h
Motor oil	125	65	75	75
Unleaded gasoline	22	90	95	95
Brake fluid	22	105	105	100
Water/glycol 50/50	87	75	85	90
Acetone	22	95	95	100
Ethanol	22	95	95	95
E85 Ethanol fuel	22	95	95	95
B100 Bio-Diesel	22	100	100	110

Breakloose Torque, ISO 10964, Pre-torqued to 5 N·m: M10 Stainless steel nuts and bolts

		% of initial strength		
Environment	°C	500 h	1000 h	5000 h
Sodium Hydroxide, 20%	22	75	65	55
Phosphoric Acid, 10%	22	100	95	65

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Safety Data Sheet (SDS).

Where aqueous washing systems are used to clean the surfaces before bonding, it is important to check for compatibility of the washing solution with the adhesive. In some cases these aqueous washes can affect the cure and performance of the adhesive.

This product is not normally recommended for use on plastics (particularly thermoplastic materials where stress cracking of the plastic could result). Users are recommended to confirm compatibility of the product with such substrates.

Directions for use

For Assembly

- For best results, clean all surfaces (external and internal) with a LOCTITE[®] cleaning solvent and allow to dry.
- 2. If the cure speed is too slow, use appropriate activator.

Please see the Cure Speed vs. Activator graph for reference. Allow the activator to dry when needed.

- 3. To prevent the product from clogging in the nozzle, do not allow the tip to touch metal surfaces during application.
- 4. For Thru Holes, apply several drops of the product onto the bolt at the nut engagement area.
- 5. **For Blind Holes**, apply several drops of the product to the lower third of the internal threads in the blind hole, or the bottom of the blind hole.
- For Sealing Applications, apply a 360° bead of product to the leading threads of the male fitting, leaving the first thread free. For bigger threads and voids, adjust product amount accordingly and apply a 360° bead of product on the female threads also.
- 7. Assemble and tighten as required.

For Disassembly

1. Apply localized heat to the assembly to approximately 250 °C. Disassemble while hot.

Clean-up

 Cured product can be removed with a combination of soaking in a LOCTITE[®] solvent and mechanical abrasion such as a wire brush.

Loctite Material Specification^{LMS}

LMS dated June 26, 2009. Test reports for each batch are available for the indicated properties. LMS test reports include selected QC test parameters considered appropriate to specifications for customer use. Additionally, comprehensive controls are in place to assure product quality and consistency. Special customer specification requirements may be coordinated through Henkel Quality.

Storage

Store product in the unopened container in a dry location. Storage information may be indicated on the product container labeling.

Optimal Storage: 8 °C to 21 °C. **Storage below 8** °C or **greater than 28** °C **can adversely affect product properties** Material removed from containers may be contaminated during use. Do not return product to the original container. Henkel Corporation cannot assume responsibility for product which has been contaminated or stored under conditions other than those previously indicated. If additional information is required, please contact your local Henkel representative.

Conversions

 $(^{\circ}C \ge 1.8) + 32 = ^{\circ}F$ kV/mm x 25.4 = V/mil mm / 25.4 = inches μ m / 25.4 = mil N x 0.225 = lb N/mm x 5.71 = lb/in N/mm² x 145 = psi MPa x 145 = psi N·m x 8.851 = lb·in N·m x 0.738 = lb·ft N·mm x 0.142 = oz·in mPa·s = cP

Disclaimer



The information provided in this Technical Data Sheet (TDS) including the recommendations for use and application of the product are based on our knowledge and experience of the product as at the date of this TDS. The product can have a variety of different applications as well as differing application and working conditions in your environment that are beyond our control. Henkel is, therefore, not liable for the suitability of our product for the production processes and conditions in respect of which you use them, as well as the intended applications and results. We strongly recommend that you carry out your own prior trials to confirm such suitability of our product. Any liability in respect of the information in the Technical Data Sheet or any other written or oral recommendation(s) regarding the concerned product is excluded, except if otherwise explicitly agreed and except in relation to death or personal injury caused by our negligence and any liability under any applicable mandatory product liability law.

In case products are delivered by Henkel Belgium NV, Henkel Electronic Materials NV, Henkel Nederland BV, Henkel Technologies France SAS and Henkel France SA please additionally note the following: In case Henkel would be nevertheless held liable, on whatever legal ground,

In case Henkel would be nevertheless held liable, on whatever legal ground, Henkel's liability will in no event exceed the amount of the concerned delivery. In case products are delivered by Henkel Colombiana, S.A.S. the following

In case products are delivered by Henkel Colombiana, S.A.S. the following disclaimer is applicable:

The information provided in this Technical Data Sheet (TDS) including the recommendations for use and application of the product are based on our knowledge and experience of the product as at the date of this TDS. Henkel is, therefore, not liable for the suitability of our product for the production processes and conditions in respect of which you use them, as well as the intended applications and results. We strongly recommend that you carry out your own prior trials to confirm such suitability of our product.

Any liability in respect of the information in the Technical Data Sheet or any other written or oral recommendation(s) regarding the concerned product is excluded, except if otherwise explicitly agreed and except in relation to death or personal injury caused by our negligence and any liability under any applicable mandatory product liability law.

In case products are delivered by Henkel Corporation, or Henkel Canada Corporation, the following disclaimer is applicable:

The data contained herein are furnished for information only and are believed to be reliable. We cannot assume responsibility for the results obtained by others over whose methods we have no control. It is the user's responsibility to determine suitability for the user's purpose of any production methods mentioned herein and to adopt such precautions as may be advisable for the protection of property and of persons against any hazards that may be involved in the handling and use thereof. In light of the foregoing, Henkel Corporation specifically disclaims all warranties expressed or implied, including warranties of merchantability or fitness for a particular purpose, arising from sale or use of Henkel Corporation's products. Henkel Corporation specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. The discussion herein of various processes or compositions is not to be interpreted as representation that they are free from domination of patents owned by others or as a license under any Henkel Corporation patents that may cover such processes or compositions. We recommend that each prospective user test his proposed application before repetitive use, using this data as a guide. This product may be covered by one or more United States or foreign patents or patent applications.

Trademark usage

Except as otherwise noted, all trademarks in this document are trademarks of Henkel Corporation in the U.S. and elsewhere. ® denotes a trademark registered in the U.S. Patent and Trademark Office.

Reference N/A

