

Switching diffuse mode sensor with measurement core technology, 150 mm detection range, red laser light, laser class 1, IO-Link, 2 x push-pull output, M8 plug



Function

The R100 series miniature optical sensors are the first devices of their kind to offer an endto- end solution in a small single standard design – from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Safety Information



CLASS 1 LASER PRODUCT IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and

Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007


Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Pepperl+Fuchs Group www.pepperl-fuchs.com



Triangulation sensor (SbR)

Dimensions

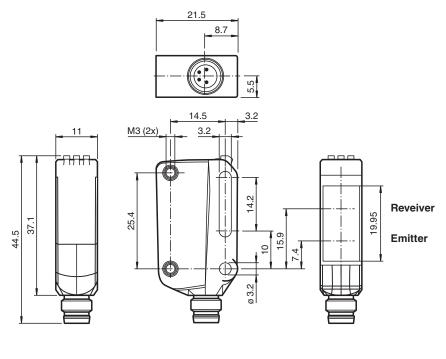



Technical Data

General specifications	
Detection range	8 150 mm
Detection range min.	8 20 mm
Detection range max.	8 150 mm
Adjustment range	20 150 mm
Reference target	standard white, 100 mm x 100 mm
Light source	laser diode
Light type	modulated visible red light
Laser nominal ratings	
Note	LASER LIGHT , DO NOT STARE INTO BEAM
Laser class	1
Wave length	680 nm
Beam divergence	> 5 mrad ; d63 < 1 mm in the range of 50 mm 250 mm
Pulse length	3 µs
Repetition rate	approx. 3 kHz
max. pulse energy	15.2 nJ
Black-white difference (6 %/90 %)	< 3 % at 150 mm
Diameter of the light spot	approx. 2 mm at a distance of 150 mm
Angle of divergence	approx. 1 °
Ambient light limit	EN 60947-5-2 : 30000 Lux
Functional safety related parameters	
MTTF _d	560 a

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

OQT150-R100-2EP-IO-V31-L


Technical Data		
Mission Time (T.)		20.2
Mission Time (T_M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - switch output active constantly off - switch output inactive
Control elements		Teach-In key
Control elements		5-step rotary switch for operating modes selection
Electrical specifications		
Operating voltage	UB	10 30 V DC
Ripple		max. 10 %
No-load supply current	Io	< 20 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type		IO-Link (via C/Q = pin 4)
IO-Link revision		1.1
Device profile		Smart Sensor
Device ID		0x110802 (1116162)
Transfer rate		COM2 (38.4 kBaud)
Min. cycle time		2.3 ms
Process data width		Process data input 2 Bit Process data output 2 Bit
SIO mode support		yes
Compatible master port type		A
Output		
Switching type		The default setting is: C/Q - Pin4: NPN normally open, PNP normally closed, IO-Link Q2 - Pin2: NPN normally-open, PNP normally-closed
Signal output		2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U _d	≤ 1.5 V DC
Switching frequency	f	217 Hz
Response time		2.3 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Laser safety		EN 60825-1:2014
Approvals and certificates		
EAC conformity		TR CU 020/2011
UL approval		E87056 , cULus Listed , class 2 power supply , type rating 1
FDA approval		IEC 60825-1:2007 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Housing width		11 mm
Housing height		44.5 mm
Housing depth		21.5 mm

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Technical Data

Degree of protection	IP67 / IP69 / IP69K
Connection	M8 x 1 connector, 4-pin
Material	
Housing	PC (Polycarbonate)
Optical face	РММА
Mass	approx. 10 g

Connection




Connection Assignment




Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
2	WH	(white)
3	BU	(blue)
4	BK	(black)

Assembly





1	Teach-in button
2	Mode rotary switch
3	Switch output indicator Q2
4	Switch output indicator Q1
5	Operating indicator

Ι	Switch output 1 / switch point B
Ш	Switch output 1 / switch point A
Ш	Switch output 2 / switch point A
IV	Switch output 2 / switch point B
V	Keylock


Refer to "General Notes Relating to Pepperl+Fuchs Product Information".


Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



Characteristic Curve

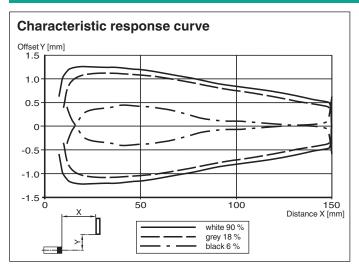

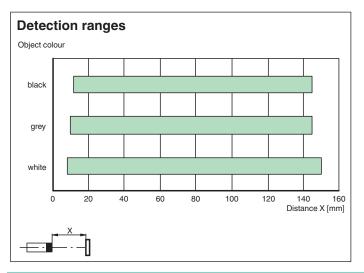

Accessories

8	OMH-ML100-09	Mounting aid for round steel ø 12 mm or sheet 1.5 mm 3 mm
	IO-Link-Master02-USB	IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection
H	OMH-R10X-01	Mounting bracket
	OMH-R10X-02	Mounting bracket
12-	OMH-R10X-04	Mounting bracket
i. di	OMH-R10X-10	Mounting bracket
	OMH-ML100-03	Mounting aid for round steel ø 12 mm or sheet 1.5 mm 3 mm
de a	OMH-ML100-031	Mounting aid for round steel ø 10 14 mm or sheet 1 mm 5 mm

Release date: 2021-09-07 Date of issue: 2021-09-07 Filename: 267075-100156_eng.pdf

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

Accessories			
$\sum_{i=1}^{n}$	V31-GM-2M-PUR	Female cordset single-ended M8 straight A-coded, 4-pin, PUR cable grey	
	V31-WM-2M-PUR	Female cordset single-ended M8 angled A-coded, 4-pin, PUR cable grey	

 Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

 Pepperl+Fuchs Group
 USA: +1 330 486 0001
 Gr

 www.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com



Teach-In

You can use the rotary switch to select the relevant switching threshold A and/or B for teaching in for switch signal Q1 or Q2. The yellow LEDs indicate the current state of the selected output.

To store a threshold value, press and hold the "TI" button until the yellow and green LEDs flash in phase (approx. 1 s). Teach-In starts when the "TI" button is released.

Successful Teach-In is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.


An unsuccessful Teach-In is indicated by rapidly alternating flashing (8 Hz) of the yellow and green LEDs.

After an unsuccessful Teach-In, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.


Different switching modes can be defined by teaching in the relevant distance measured values

for the switching thresholds A and B:

Single point mode:



Window mode:



Every taught-in switching threshold can be retaught (overwritten) by pressing the "TI" button again.

Pressing and holding the "TI" button for > 4 s completely deletes the taught-in value. The yellow and green LEDs go out simultaneously to indicate that this procedure has been completed. Successful resetting is indicated by alternating flashing (2.5 Hz) of the yellow and green LEDs.

Resetting to Factory Default Settings

Press the "TI" button for > 10 s in rotary switch position ,O' to reset to factory default settings. The yellow and green LEDs go out simultaneously to indicate the resetting.

Resetting process starts when the "TI" button is released and is indicated by the yellow LED. After the process the sensor works with factory default settings, immediately.

OMT:

- Factory default settings switch signal Q1: Switch signal active, window mode
- Factory default settings switch signal Q2: Switch signal active, window mode

OQT:

- Factory default settings switch signal Q1:
- Switch signal active, BGS mode (background suppression) • Factory default settings switch signal Q2:
- Switch signal active, BGS mode (background suppression)

Configuration

www.pepperl-fuchs.com

Configuring different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application. Four different operating modes can be set, among other features:

Background suppression operating mode (one switch point):

• Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.

ć	active detection range	
		Background suppression

fa-info@de.pepperl-fuchs.com

Background evaluation operating mode (one switch point):

fa-info@us.pepperl-fuchs.com

· Detection of objects irrespective of type and color against a defined background. Reliable detection of objects at close range

Singapore: +65 6779 9091

fa-info@sg.pepperl-fuchs.com

7

Triangulation sensor (SbR)

OQT150-R100-2EP-IO-V31-L

(detection range >= 0 mm). The background serves as reference.

	active detection ra	ange		
				Background evaluation
.	 		• •	Baokground evaluation

Single point mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- The switch point corresponds exactly to the set point.



Window mode operating mode (two switch points):

- Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- Window mode with two switch points.

e	active detection range	
Foreground suppression	Background suppression	

Center window mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside this window are not detected.
- Window mode with one switch point.

activ	detection range
Foreground suppression	Background suppression

Two point mode operating mode (hysteresis operating mode):

· Detection of objects irrespective of type and color between a defined switch-on and switch-off point.

	I.	active detection ra	ange	
				Output
Output	★	Hysteresis		

Inactive operating mode:

• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"